

# FOREST RIVER WARRANTY CLAIM FORM

<b>DEALER ACCOUNT #</b>	0005106	<b>CLAIM STATUS</b>	Authorized
BASDEN RV CENTER INC		<b>CLAIM</b>	2464454
DBA AMERICAN RV CENTER		<b>CLAIM ORIGIN</b>	WEB
600 E BASELINE ROAD		<b>ORIGINAL CLAIM ID</b>	
EVANSVILLE, IN 47725		<b>VIN</b>	4X4TCKE27TK096786
USA		<b>CHASSIS VIN</b>	
		<b>MILEAGE</b>	0
<b>Labor rate:</b>	\$185.00	<b>SITE/WAREHOUSE</b>	094 / 094A
<b>OWNER INFORMATION</b>		<b>ITEM #</b>	CKT29NM-94
		<b>DEALER RO #</b>	77978
		<b>CLAIM START DATE</b>	10/10/2025
		<b>CLAIM END DATE</b>	01/01/1900

Retail Date of Purchase \_\_\_\_\_ WARRANTY EXPIRATION DATE \_\_\_\_\_

## Claim Line Details

### Labor

**Line# 1**

<b>Operation Code</b>	30-100-01-00-001051	<b>Operational Description</b>
		Cabinet - complete - Interior/Cabinetry/Replace/No Tread Code
<b>Complaint, Cause, Correction</b>		
Original Note : bhoffman@americanrvcenter.com, 2025-10-10 13:12:48 :: THE COVER HEAD COMPARTMENT IS BROKEN FROM TAKING IT APART AND NEEDS FIXED Damaged panel in overhead compartment. To replace the panel in over head compartment the whole overhead compartment must be removed. Removed the overhead doors. Removed the underbelly of Compartments trim. Removed the underbelly Compartment panel to reveal mount screws. Removed all the mount screws and 2 panels from unit. Cleaned all the old staples from panel and compartment base. Going to use the outter underbelly panel to replace the inner panel so i can go ahead and reinstall the over head panel. Panel measurements are 23 1/4in x 78in. Reinstalled overhead compartment.		
<b>Model#</b>	<b>Dlr Sub Hrs</b>	<b>Sub Labor Amt</b>
	3.50	\$647.50
<b>Serial#</b>	<b>Appr Hrs</b>	<b>Appr Labor Amt</b>
	1.75	\$323.75

**Notes**  
splitting time with the dealer as the dealer ehas performed an unauthorized repair to avoid future denials or changes to your claim on all PAR codes PRIOR approval is required thank you

PAR code - The selected code requires authorization from Forest River or the Manufacturing Vendor prior to repair. Please contact the appropriate warranty department.

### Labor

**Line# 2**

<b>Operation Code</b>	30-98-01-00-000997	<b>Operational Description</b>
		Bed Hinge - Interior/Beds, Mattress/Replace/No Tread Code
<b>Complaint, Cause, Correction</b>		
Original Note : bhoffman@americanrvcenter.com, 2025-10-10 13:13:49 :: THE WOOD FOR THE BED THAT FOLDS THE HINDGE IS BENT Bent hinge Removed bent hinge from under master bed and took to table vise and straightened it out and reinstalled.		
<b>Model#</b>	<b>Dlr Sub Hrs</b>	<b>Sub Labor Amt</b>
	0.20	\$37.00
<b>Serial#</b>	<b>Appr Hrs</b>	<b>Appr Labor Amt</b>
	0.20	\$37.00

**Notes**

### Labor

**Line# 3**

<b>Operation Code</b>	10-7-15-16-000144	<b>Operational Description</b>
		Entry Step - Weld - Frame & Chassis/Manual Entry Step/Repair or Replace/Structure
<b>Complaint, Cause, Correction</b>		
Original Note : bhoffman@americanrvcenter.com, 2025-10-10 13:19:15 :: STEPS ARE RUSTED AND PAINT CHIPPING Paint chipping and Rusting on Front Steps in multiple spots. Chipped away the loose paint, wire brushed the rust and painted with Black Gloss Paint.		
<b>Model#</b>	<b>Dlr Sub Hrs</b>	<b>Sub Labor Amt</b>
	0.25	\$46.25
<b>Serial#</b>	<b>Appr Hrs</b>	<b>Appr Labor Amt</b>
	0.25	\$46.25

Notes

---

<b>Submitted</b>	Labor Amt	\$730.75
	Parts & Freight	\$0.00
	Total	\$730.75

---

<b>Approved</b>	Labor Amt	\$407.00
	Parts & Freight	\$0.00
	Total	\$407.00

---

<b>DEALER</b>	<b>DATE</b>
<b>SIGNATURE</b>	

I certify that I have performed these repairs consistent with Forest River Policies.

---

<b>CUSTOMER</b>	<b>DATE</b>
<b>SIGNATURE</b>	

All repairs described have been inspected and are satisfactory.