



Warranty Authorization Form

Date: 10/27/2025

Basden RV Center, Inc. DBA/ American RV
600 E Baseline Rd
Evansville, IN 47725
Ph. (812) 867-5200
cbruce@americanrvcenter.com

General Information

Pre-Auth #: 108894 Unit: 7M5TD2924SC306309
Series: Delta Model: 2025DEL262RB
Notes:
Status: Approved with Modifications

Dealer Information

American RV
(812) 867-5200
cbruce@americanrvcenter.com

Basden RV Center, Inc. DBA/ American RV
600 E Baseline Rd
Evansville, IN 47725

Requestor: Ben Hoffman
Return Fax #:
Email: bhoffman@americanrvcenter.com

Operation Line 1

Flat Rate Code: 18006 12 VOLT - GENERAL REPAIR

Fault Code: MISWIRED

Serial #:

Model #:

Notes:

Problem: BATHROOM LIGHTS ARE NOT WORKING. SAYS FUSE IS BLOWN AND WILL BLOW AS SOON AS IT IS REPLACED. HAS A SHORT CUSTOMER ADVISES THAT THE USB PORTS AND THE OVERHEAD LIGHTS IN THE SLIDE ROOM DO NOT WORK. CUSTOMER ADVISES THAT THE USB PLUG ON THE BACK OF THE DINETTE DOES NOT WORK

Time Requested: 3

Time Allowed: 3

Sublet Repairs: 0.00

Cause: Short

Remedy: Traced wires and found they branched off and the bathroom wiring was good. I traced the other branch through the floor and in the underbelly to the front then over to the slideroom. It then branched again to the front of slideroom and to the rear I found the front side was the issue. I pulled on the wire at the switch in the slideroom and the issue stopped. I then hooked power back up and it did not blow fuse I ran room in and out several times and it did not blow the fuse. I then put the underbelly back in place and reinstalled breaker panel and switch panels.

Part Return Req: No

Status: Approved

Operation Line 2

Flat Rate Code: 14061A LINO - REPAIR (Please provide length and wide of area) *Fault Code:* IMPROPERLY INSTALLED

Serial #:

Model #:

Notes:

Problem: CUSTOMER ADVISES THAT THE LINOLEUM ON EACH END OF THE SLIDE ROOM ROLLS UP WHEN THE ROOM IS OUT ALL THE WAY.

Time Requested: 1.2

Time Allowed: 1

Cause: Found the trim at each end the screw heads was catching the linoleum

Sublet Repairs: 0.00

Remedy: Removed screws and beveled the screw opening and installed new screws with beveled heads to seat flush .

Part Return Req: No

Status: Approved with Modifications