

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	2476104
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZT2CKEC6TY040232
USA		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$185.00	SITE/WAREHOUSE	095 / 095A
OWNER INFORMATION		ITEM #	CKT16FQW-95
		DEALER RO #	78038
		CLAIM START DATE	10/22/2025
		CLAIM END DATE	01/01/1900

Retail Date of Purchase

WARRANTY EXPIRATION DATE

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description		
	40-106-24-11-001253	Exterior 12 Volt Wiring - Electrical/12 Volt Exterior/Repair/Electrical		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2025-10-22 14:38:37 :: THE EXTERIOR LIGHT ON THE OFF DOOR SIDE IS NOT COMING ON WITH THE SWITCH. Misabeled switch. Exterior off doorside switched light would not turn on. Pulled light cover and no power at soldered contacts. Pulled light from wall and worked the Wago Clips from cutout and tested for voltage and had none. Double checked for switch in compartment or Control panel and discovered the switch labeled Con Light powered that one light! Not sure to why its labeled "Con Light"?! Reinstalled light and cap sealed it.			
Model#	Dlr Sub Hrs	0.30	Sub Labor Amt	\$55.50
Serial#	Appr Hrs	0.30	Appr Labor Amt	\$55.50
	Notes			

Labor

Line# 2	Operation Code	Operational Description		
	60-136-01-00-001506	Combination City or Gravity Fill - Plumbing/Fresh Water Supply/Replace/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2025-10-22 14:41:10 :: THE BEZEL AROUND THE CITY WATER INLET IS WARPED AND STICKING OUT FROM THE SIDE OF THE TRAILER Top corners are flared out from way they mounted it. Corners were flared out due to how it was mounted. Removed and reinstalled new one and filled gaps on siding to keep it flat. Used puddy on the inner seal and Silicone on the outter cap seal.			
Model#	Dlr Sub Hrs	0.30	Sub Labor Amt	\$55.50
Serial#	Appr Hrs	0.30	Appr Labor Amt	\$55.50
	Notes			

Labor

Line# 3	Operation Code	Operational Description		
	40-106-01-00-001258	Heating Pad - Holding Tank - Electrical/12 Volt Exterior/Replace/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2025-10-22 14:41:46 :: THE GREY TANK HEATING PAD IS HANGING DOWN Hanging down. Removed and cleaned the foam off that remained stuck to tank. Part requested new warmer. Received new tank warmer and installed with shrink crimp connectors.			
Model#	Dlr Sub Hrs	0.50	Sub Labor Amt	\$92.50
Serial#	Appr Hrs	0.50	Appr Labor Amt	\$92.50
	Notes			

Submitted	Labor Amt	\$203.50	Approved	Labor Amt	\$203.50
-----------	-----------	----------	----------	-----------	----------

Parts & Freight	\$0.00
Total	\$203.50

Parts & Freight	\$0.00
Total	\$203.50

DEALER	DATE
--------	------

SIGNATURE

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER	DATE
----------	------

SIGNATURE

All repairs described have been inspected and are satisfactory.