



# Warranty Authorization Form

Date: 12/3/2025

Basden RV Center, Inc. DBA/ American RV  
600 E Baseline Rd  
Evansville, IN 47725  
  
Ph. (812) 867-5200  
cbruce@americanrvcenter.com

## General Information

Pre-Auth #: 109766      Unit: 7M5TD292XTC307174  
Series: Delta      Model: 2026DEL262RB  
Notes:  
Status: Approved with Modifications

## Dealer Information

American RV  
(812) 867-5200  
cbruce@americanrvcenter.com

Basden RV Center, Inc. DBA/ American RV  
600 E Baseline Rd  
Evansville, IN 47725

Requestor: Ben Hoffman  
Return Fax #:  
Email: bhoffman@americanrvcenter.com

## Operation Line 1

*Flat Rate Code:* 14042 DINETTE CHAIR - REPAIR (Photos required of data tag and defect)      *Fault Code:* IMPROPERLY INSTALLED

*Serial #:*

*Model #:*

*Notes:*

*Problem:* THE WALL BETWEEN THE DINETTE AND THE THEATER SEATS CAME APART AGAIN

*Time Requested:* 11.5

*Cause:* FAILED TO BUILD IT CORRECTLY when running the slide room in and out the floor bows and tore the wall apart

*Time Allowed:* 6

*Sublet Repairs:* 0.00

*Remedy:* REMOVED THE RECLINERS AND TOOK APART THE DINETTE BOOTH I MEASURED AND CUT OUT THE LOWER BOARD AND DRILLED HOLES IN THE NEW BOARD FOR THE WIRES AND DRILLED HOLES FOR THE NEW SCREWS AND RECESSED THE MOUNTING HOLES. I THEN INSTALLED AND MADE SURE THE SCREWS DID NOT GO THROUGH THE FLOOR. I THEN MEASURED FOR THE CROSS BRACES AND DRILLED POCKET HOLES FOR THE SCREWS AND INSTALLED WITH LIQUID NAILS AND SCREWS I CUT AND INSTALLED 3 BRACES I ALSO INSTALLED METAL L BRACKETS TO HELP HOLD TOGETHER. THEN I INSTALLED THE DECORE END PEICE AND INSTALLED SCREWS I LIQUID NAILED IT ALSO AND INSTALLED EXTRA SCREWS. I HAD TO TAKE THE SEAT APART AND THE WIRING TO GET THE NEW PANEL INSTALLED ON THE INSIDE OF THE BOOTH ONCE INSTALLED I THEN REINSTALLED THE WIRING I INSTALLED NEW PANELING AND NEW TRIM AROUND THE PANELING AND FILLED ALL THE HOLES WITH PUTTY AND REINSTALLED THE RECLINERS AND AD RAN ROOM IN AND OUT SEVERAL TIMES TO MAKE SURE EVERYTHING HELD PUTTY AND THEN REINSTALLED THE RECLINERS.

*Part Return Req:* No

*Status:* Approved with Modifications

### **Operation Line 2**

*Flat Rate Code:* 22488 FRESH WATER - VACUUM BREAKER -  
REPLACE (Part Return Required)

*Fault Code:* VENDOR

*Serial #:*

*Model #:*

*Notes:*

*Problem:* WHEN THE BLACK TANK FLUSH IS BEING USED IT LEAKS WATER AND SOME  
WATER HAS GONE TO THE UNDER BELLY

*Time Requested:* .75

*Time Allowed:* .75

*Sublet Repairs:* 0.00

*Cause:* traced down under the unit in the underbelly the leak i then noticed it was coming from  
above the tank i then found under the sink the check vlave had bugs init and was leaking badly i  
cleaned out the bugs and put a screen over the top of the vlave and then i had to cove r the  
access holes in the underbelly and sealed them with silicone.

*Remedy:* traced down under the unit in the underbelly the leak i then noticed it was coming from  
above the tank i then found under the sink the check vlave had bugs init and was leaking badly i  
cleaned out the bugs and put a screen over the top of the vlave and then i had to cove r the  
access holes in the underbelly and sealed them with silicone.

*Part Return Req:* Yes

*Status:* Approved

### **Operation Line 3**

*Flat Rate Code:* 22718 UNDERBELLY - REPAIR

*Fault Code:* GOODWILL DEALER

*Serial #:*

*Model #:*

*Notes:* 11/24 bh added more photos approved 2 hrs for line 3 10/31/2025 Paul-  
There are no images attached. at .2. I will good will for dealer 11-10 PHOTOS  
ADDED

*Problem:* UNDERBELLY WAS FILLED WITH WATER WHEN CUSTOMER DROVE AWAY FROM  
THERE LOCATION THE CAMPER HAD BEEN FOR OVER A WEEK. INSPECT WHERE WATER  
MAY HAVE ENTERED THE UNDERBELLY AND VERIFY UNDERBELLY IS OK

*Time Requested:* 2.1

*Time Allowed:* 1

*Sublet Repairs:* 0.00

*Cause:* .removed and inspected and found no issues and put back together.

*Remedy:* .removed and inspected and found no issues and put back together.

*Part Return Req:* No

*Status:* Approved with Modifications

### **Operation Line 4**

*Flat Rate Code:* 22688 SCISSOR JACK - REPLACE (Photos Required) *Fault Code:* VENDOR  
(Photo of tag required)

*Serial #:*

*Model #:*

*Notes:*

*Problem:* REAR LEFT STABILIZER IS BENT

*Time Requested:* .5

*Cause:* Turned in request for parts

*Time Allowed:* .5

*Remedy:* take jack off and install new

*Sublet Repairs:* 0.00

*Part Return Req:* No

*Status:* Approved