



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 78118
Promised Date:
24 OCT 25



Customer #: 32316
KAISER, KEVIN



CUSTOMER WORK ORDER

WO #: 78118

Customer: 32316 - KAISER, KEVIN -
812-453-1043

Tag:

Author: BH

Location: 1202 CHECK TO SEE IF

PREAUT IS CLOSED CHECK

PREAUT

Stock #: 11647

Stock Desc: 2026 TT ALLIANCE RV

DELTA 262RB

Chassis #: 7M5TD292XTC307174

Serial #: 7M5TD292XTC307174

Mileage: 0

Licence:

Invoice #:

Date In: 22 OCT 25

Promised: 31 OCT 25

Date Sched:

Completed: 30 NOV 25

Warr. Date: 15 AUG 25

Job #1 - Warranty

COMPLAINT: THE WALL BETWEEN THE DINETTE AND THE THEATER SEATS CAME APART AGAIN

CAUSE: Turned in request for parts

CORRECTION: REMOVED THE RECLINERS AND TOOK APART THE DINETTE BOOTH I MEASURE AND CUT OUTTHE LOWER BOARD AND DRILLED HOLES INTHE NEW BOARD FOR THE WIRES AND AND DRILLED HOLES FOR THE NEW SCREWS AND RESCESSED THE MOUNTING HOLES. I THEN INSTALLED AND MADE SURE THE SCREWS DID NOT GO THROUGH THE FLOOR. I THEN MEASURED FOR THE CROSS BRACES AND DRILLED POCKET HOLES FOR THE SCREWS AND INSTALLED WITH LIQUID NAILS AND SCREWS I CUT AND IINSTALLED 3 BRACES I ALSO INSTALLED METAL L BRACKETS TO HELP HOLLD TOGETHER. THEN I INSTALLED THE DECORE END PEICE AND INSTALLED SCREWS I LIQUID NAILED IT ALSO AND INSTALLED EXTRA SCREWS. I HAD TO TAKE THE SEAT APART AND THE WIRNG TO GET THE NEW PANEL INSTALLED ON THE INSIDE OF THE BOOTH ONSCE INSTALLED I THEN REINSTALLED THE WIRING I INSTALLED NEW PANELING AND NEW TRIM AROUND THE PANELING AND FLED ALL THE HOLES WITH PUTTY AND REINSTALLED THE RECLINERS AND AD RAN ROOM IN AND OUT SEVERAL TIMES TO MAKE SUR EVERYTHING HELD

PUTTY AND THEN REINSTALLED THE RECLINERS.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	370.00
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	740.00

Parts

Part #	Description	Qty	Price	Total
27473	Stile - 2.5 x 108 - LC Square - Harm	1.00	8.92	8.92
27479	27479 Panel - Dâ€šcor - 4 Star - 2.7	1.00	31.72	31.72
27484	Trim - Batten - Beveled x2 - 3.6 x 0	2.00	1.91	3.82
28527	TRIM - J-MOLDING -5/32 - ALLIANCE GR	16.00	0.17	2.72
12345	2X4X8 LUMBER	3.00	4.47	13.41



**Other Services**

Code	Description	Qty	Price	Total
FRT	UPS FREIGHT	1.00	95.55	95.55

Subtotal for Job #1: 1,266.14**Job #2 - Warranty**

COMPLAINT: WHEN THE BLACK TANK FLUSH IS BEING USED IT LEAKS WATER AND SOME WATER HAS GONE TO THE UNDER BELLY

CORRECTION: traced down under the unit in the underbelly the leak i then noticed it was coming from above the tank i then found under the sink the check vlave had bugs init and was leaking badly i cleaned out the bugs and put a screen over the top of the vlave and then i had to cove r the access holes in the underbelly and sealed them with silicone.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	138.75

Parts

Part #	Description	Qty	Price	Total
219088	SILICONE II BLACK	1.00	13.56	13.56

Subtotal for Job #2: 152.31**Job #3 - Internal**

COMPLAINT: CHECK THE A/C CUSTOMER SAYS THAT THERE IS NO WATER RUN OFF WHEN A/C IS IN USE

CORRECTION: ran ac and it was cooling but its not been warm enough to remove alot of humidty

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	N/C

Subtotal for Job #3: 0.00**Job #4 - Warranty**

COMPLAINT: UNDERBELLY WAS FILLED WITH WATER WHEN CUSTOMER DROVE AWAY FROM THERE LOCATION THE CAMPER HAD BEEN FOR OVER A WEEK. INSPECT WHERE WATER MAY HAVE ENTERED THE UNDERBELLY AND VERIFY UNDERBELLY IS OK

CORRECTION: opened the underbelly in several placed to inspect and did not see any damage from water . i put wood on top of opening s and screwed the underbelly to it and sealed with silicone.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	185.00
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	N/C

Subtotal for Job #4: 185.00**Job #5 - Warranty**

COMPLAINT: REAR LEFT STABILIZER IS BENT

CAUSE: Turned in request for parts

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	16.65
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	61.05
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	14.80

Parts

Part #	Description	Qty	Price	Total
--------	-------------	-----	-------	-------



Subtotal for Job #5:**152.26****Job #WINTER - Internal**

COMPLAINT: WINTERIZE UNIT AND DRAIN HOLDING TANKS.

INCLUDES 2 GALLONS OF ANTI-FREEZE

UNITS WITH WASHING MACHINE OR ICEMAKER
WILL BE EXTRA

DE-WINTERIZATION IS NOT INCLUDED

NUMBER OF GALLONS USED _____

CORRECTION: drained tanks and winterized unit.

Labor

Code	Description	Mechanic	Total
Z990	WINTERIZE UNIT	BRM	N/C
Z990	WINTERIZE UNIT	BRM	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #WINTER:**0.00****Job #6 - Internal**

COMPLAINT: 2 HRS TO REMOVE THE UNDER BELLY AND TAKE PHOTOS

CORRECTION: removed and inspected and found no issues and put back together.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	N/C

Subtotal for Job #6:**0.00**

Parts Total: 133.91

Labour Total: 1,526.25

Sublet Total: 0.00

Extras Total: 95.55

WORK ORDER TOTAL: 1,755.71

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 03 Dec 2025

W/O: 78118
Promised Date: 31 OCT 25Customer #: 32316
KAISER, KEVIN