

BASDEN RV CENTER, INC dba AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 78551
MANUFACTURER'S CLAIM #:

Manufacturer: 1013 - KEYSTONE RV CO
Customer: 1000 - BASDEN'S AMERICAN RV
Address: 600 E. BASELINE RD. EVANSVILLE, IN
USA
47725
Phone:
Stock Number: 11676 - 2026 SPRINGDALE 2100RL 4YDTSGJ2XT7102043
VIN: 4YDTSGJ2XT7102043 HIN: SER#: 4YDTSGJ2XT7102043
Mileage: 0 Work Order Comp: 15 DEC 25
Auth. No: Dealer #: 1194
Warr. Date: Work Order Date: 24 NOV 25 Inv #: 425254

WO # Job # Description JOB INFORMATION

78551 1 CLEAR SILICONE ON THE ROOF
Clear silcione and loose dicor on roof.
During pdi noticed clear silcione on roof. Pictures taken. Cut
clear silcione out and covered hole with dicor. Went to front of
unit were clear silcione was visabel and underneath dicor.
Covered spot with fresh dicor. Also the back non door side cap
had loose dicor. Was able to easily peal up. Added new non
leveling dicor to fill in underneath and cover up.

78551 4 NEEDS NEW REGULATOR
Replace regulator
During pdi while trying to run lp drop test. At 50% while trying
to reach 11wsi regulator bottomed out. Removed regulator from lp
line. Removed mounting bracket from regulator. Removed tank
connection from regulator. New regulator came in. Put lp thread
tape on lp connection for tanks and tightened into regulator.
Took mounting bracket and attached to new regulator. Attached
regulator to lp line. Tightened down and tested on both tanks to
check fo leaks. No leaks found.

78551 2 30 AMP PLUG NEEDS TURNED
30amp plug turned
During pdi noticed that the 30amp plug was turned so you had to
twist the cord upside down to plug in. Cut silcione holding in
place then removed screws. Pulled plug out then removed both back
caps holding outlet in place. Removed screws holding outlet in.

Claim : 78551

 WO # Job # Description JOB INFORMATION

 Rotated outlet to proper position. Screwed back into place. Added
 covers back together. Placed plug in back in place. Screwed in
 and silcioned around it.

78551 3 FRONT ENTRY DOOR NEEDS ADJUSTED
 Front entry door needs adjusted
 During pdi noticed front entry door need adjustment. Adjusted
 striker plate and small improvement was seen. Door was still
 bowed. Used a block of wood at top with light pressure to move
 door to try to bend back straight. Repeated process at bottom of
 door. Door straightened out more. Door latches better

78551 5 DROP TEST FOR REGULATOR INSTALL

 Part No Job# Description PARTS Qty Price Total

 DCR505LSW-1 1 PW HAPS FREE SELF-LEVELING DICOR 1.00 8.72 8.72
 DCR551LSB-1 1 551LSB-1 BLACK NON SAG DICOR 1.00 8.72 8.72
 MECMEGR-253P 4 MEGR-253P LP REGULATOR 2-STAGE 1.00 74.14 74.14

 Lab Code Job# Description LABOUR Hrs Rate Total

 Z990 1 MISCELLANEOUS REPAIR 0.20 180.00 36.00
 Z990 4 MISCELLANEOUS REPAIR 0.30 180.00 54.00
 Z990 4 MISCELLANEOUS REPAIR 0.00 180.00 0.00
 Z990 2 MISCELLANEOUS REPAIR 0.30 180.00 54.00
 Z990 3 MISCELLANEOUS REPAIR 0.30 180.00 54.00
 Z990 5 MISCELLANEOUS REPAIR 0.20 180.00 36.00

Parts Total: 91.58
 Labour Total: 234.00
 Sublet Total: 0.00
 Extras Total: 0.00

>>>> Claim Total: 325.58

Customer Signature: _____

Date: _____