

Pre-Authorization

Pre-Authorization number	PREAUTH529 64 (PA03945949	Reference no.78551	Status	Approved
--------------------------	---------------------------------	--------------------	--------	----------

Servicing Dealer 1194

Name Basden's American RV

Address 600 E Baseline Rd
Evansville, IN 47725

VIN 4YDTSGJ2XT7102043

Retail sold on

For paper claims only use one pre-authorization number per warranty claim form.
Staple a copy of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim form.
The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the amount authorized on the pre-authorization form and return to Keystone RV Company.

Root		Approved Actual				Base		Complaint/Cause/Correction
Operation	Description	Sublet	Sub Hours	Hours	hours	Qty	hours	
2200503D	Roof Termination Moldings, Front Seam	0	0.3	0.2		1	0.2	Complaint: CLEAR SILICONE ON THE ROOF Cause: Clear silcione and loose dicor on roof Correction: During pdi noticed clear silcione on roof. Pictures taken. Cut clear silcione out and covered hole with dicor. Went to front of unit were clear silcione was visabel and underneath dicor. Covered spot with fresh dicor. Also the back non door side cap had loose dicor. Was able to easily peel up. Added new non leveling dicor to fill in underneath and cover up.
5104314A	Receptacle - 120V - Repair	0	0.3	0.3		1	0.2	Complaint: 30 AMP PLUG NEEDS TURNED Cause: 30amp plug turned Correction: During pdi noticed that the 30amp plug was turned so you had to twist the cord upside down to plug in. Cut silcione holding in place then removed screws. Pulled plug out then removed both back caps holding outlet in place. Removed screws holding outlet in. Rotated outlet to proper position. Screwed back into place. Added covers back together. Placed plug in back in place. Screwed in and silcioned around it.
2300103F	Entrance Door - Hinged - Adjust Door or Lock	0	0.3	0.3		1	0.2	Complaint: FRONT ENTRY DOOR NEEDS ADJUSTED Cause: Front entry door needs adjusted Correction: During pdi noticed front entry door need adjustment. Adjusted striker plate and small improvement was seen. Door was still bowed. Used a block of wood at top with light pressure to move door to try to bend back straight. Repeated process at bottom of door. Door straightened out more. Door latches better
6201106B	Regulator - Replace	0	0.3	0.3		1	0.3	Complaint: NEEDS NEW REGULATOR Cause: Replace regulator Correction: During pdi while trying to run lp drop test. At 50% while trying to reach

For paper claims only use one pre-authorization number per warranty claim form.
 Staple a copy of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim form.
 The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the amount authorized on the pre-authorization form and return to Keystone RV Company.



for tanks and tightened into regulator. Took mounting bracket and attached to new regulator. Attached regulator to lp line. Tightened down and tested on both tanks to check fo leaks. No leaks found.

6200106A	Drop Pressure Test - Per	0	0.3	0.2	1	0.2
	Repair When Required					

Pre-Authorization number: PREAUTH52964 1.3

KRV-VCB
Complaint: drop text
Cause: replaced the regulator
Correction: drop test

For paper claims only use one pre-authorization number per warranty claim form.
Staple a copy of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim form.
The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the amount authorized on the pre-authorization form and return to Keystone RV Company.