

 


600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 78551
Promised Date:
24 DEC 25



CUSTOMER WORK ORDER

WO #: 78551

Customer: 1000 - BASDEN'S AMERICAN
RV -
Tag:
Author: BH
Location: 1216 CHECK PREAUTH

Stock #: 11676
Stock Desc: 2026 TT KEYSTONE
SPRINGDALE 2100RL
Chassis #: 4YDTSGJ2XT7102043
Serial #: 4YDTSGJ2XT7102043
Mileage: 0
Licence:

Invoice #:
Date In: 24 NOV 25
Promised: 31 DEC 25
Date Sched:
Completed: 15 DEC 25
Warr. Date:

Job #PDINTT - Internal

COMPLAINT: PDI - NEW TRAVEL TRAILER

CAUSE: New pdi

CORRECTION: Brought unit in. Attached battery box to unit and put in drain holes. Put battery in and connected to unit. Removed lp tanks and put on lp cart. Tanks were vacuum purged and filled both tanks. Brought tanks back inside and attached back to unit. Torqued each set of lug nuts to 110ftlbs. Aired all tires including spare to 75psi. Checked breaks on both sides of camper to be working as well as ebrea. All clearance and break lights work. Grabbed serial and model number off range, fridge, and microwave. Microwave and range work. All outlets work. Gcfi works. Trip tested gcfi and it worked. CO2 detector worked. Smoke detector works. Bathroom fan works. Furnace works. Water heater works. All water points work on city. Control board works and shows levels on tanks. frsh tank fill works. Water pump works. awning lights work. Range fan and light works. All interior lights work. All windows and blinds open and close properly. Grabbed test tv and connected to booster. Turned booster on and checked for reception. Picture and sound came through on tv. Tried to run lp drop test but regulator bottomed out. Checked 12v system. Unplugged unit from shore power. Control board works. Awning still goes in and out. Awning lights come on. Interior lights come on. Lp decetor still works. Fridge still works. Range lights still work. Pump still works. Interior looks good. Inspected all doors to be scratch free. All drawers and cabinet doors scratch and dent free and open and close properly. Futon fold out works. All fabric is in good condition. Company decals added. Exterior looks good. No scratches or dents found. All seals are in good condition with no voids. Step adjustments work. Front steps come out and fold in well. Stabilizer jacks work well. Goes down and support weight well. Runs back up smooth. Ran lp drop test. 13wsi at start. Adjust 50% to 11wsi. Lock up stops at 13wsi. Leak test ran at 8 wsi for 5mins. Unit passed.

Labor

Code	Description	Mechanic	Total
Z991	MISC LABOUR CODE (INTERNAL)	CCV	N/C
Z991	MISC LABOUR CODE (INTERNAL)	CCV	N/C
Z991	MISC LABOUR CODE (INTERNAL)	CCV	N/C
Z991	MISC LABOUR CODE (INTERNAL)	CCV	N/C
Z991	MISC LABOUR CODE (INTERNAL)	CCV	N/C
Z991	MISC LABOUR CODE (INTERNAL)	CCV	N/C
Z991	MISC LABOUR CODE (INTERNAL)	CCV	N/C
Z991	MISC LABOUR CODE (INTERNAL)	CCV	N/C
Z991	MISC LABOUR CODE (INTERNAL)	CCV	N/C
Z991	MISC LABOUR CODE (INTERNAL)	CCV	N/C
Z991	MISC LABOUR CODE (INTERNAL)	CCV	N/C
Z991	MISC LABOUR CODE (INTERNAL)	CCV	N/C

Parts

Part #	Description	Qty	Price	Total
13034	55362 STD BATTERY BOX	1.00	N/C	N/C

Customer #: 1000
BASDEN'S AMERICAN RV,





Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C
LPGI	LP - UNIT SALES	8.00	N/C	N/C

Subtotal for Job #PDINTT: 0.00

Job #WINTER - Internal

COMPLAINT: WINTERIZE UNIT AND DRAIN HOLDING TANKS.

INCLUDES 2 GALLONS OF ANTI-FREEZE

UNITS WITH WASHING MACHINE OR ICEMAKER
 WILL BE EXTRA

DE-WINTERIZATION IS NOT INCLUDED

NUMBER OF GALLONS USED _____

CAUSE: Winterize unit

CORRECTION: Left tankless water heater on. Found pump and set lines to winterize. Connected to antifreeze and ran pink on hot and cold to kitchen sink, bathroom sink, shower, and outdoor shower. Ran pink through toilet. Realsed pressure and depressed city connection. Depressed water heater. Turned off water heater. Drained fresh, grey, and black tanks. Cleanwd up pink at water points and closed up pump.

Labor

Code	Description	Mechanic	Total
Z990	WINTERIZE UNIT	CCV	N/C

Parts

Part #	Description	Qty	Price	Total
24181	-50 RV ANTI-FREEZE GALLON	2.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C

Subtotal for Job #WINTER: 0.00

Job #1 - Warranty

COMPLAINT: CLEAR SILICONE ON THE ROOF

CAUSE: Clear silcione and loose dicor on roof.

CORRECTION: During pdi noticed clear silcione on roof. Pictures taken. Cut clear silcione out and covered hole with dicor. Went to front of unit were clear silcione was visabel and underneath dicor. Covered spot with fresh dicor. Also the back non door side cap had loose dicor. Was able to easily peal up. Added new non leveling dicor to fill in underneath and cover up.

Labor

Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	CCV	36.00

Parts

Part #	Description	Qty	Price	Total
13-1320	PW HAPS FREE SELF-LEVELING DICOR	1.00	8.72	8.72
3388	551LSB-1 BLACK NON SAG DICOR	1.00	8.72	8.72

Subtotal for Job #1: 53.44

Job #2 - Warranty

COMPLAINT: 30 AMP PLUG NEEDS TURNED

CAUSE: 30amp plug turned

CORRECTION: During pdi noticed that the 30amp plug was turned so you had to twist the cord upside down to plug in. Cut silcione holding in place then removed screws. Pulled plug out then removed both back caps holding outlet in place. Removed screws holding outlet in. Rotated outlet to proper position. Screwed



back into place. Added covers back together. Placed plug in back in place. Screwed in and silcioned around it.

Labor		Mechanic	Total
Code	Description	CCV	
Z990	MISCELLANEOUS REPAIR		54.00
Subtotal for Job #2:			54.00

Job #3 - Warranty

COMPLAINT: FRONT ENTRY DOOR NEEDS ADJUSTED

CAUSE: Front entry door needs adjusted

CORRECTION: During pdi noticed front entry door need adjustment. Adjusted striker plate and small improvement was seen. Door was still bowed. Used a block of wood at top with light pressure to move door to try to bend back straight. Repeated process at bottom of door. Door straightened out more. Door latches better

Labor		Mechanic	Total
Code	Description	CCV	
Z990	MISCELLANEOUS REPAIR		54.00
Subtotal for Job #3:			54.00

Job #4 - Warranty

COMPLAINT: NEEDS NEW REGULATOR

CAUSE: Replace regulator

CORRECTION: During pdi while trying to run lp drop test. At 50% while trying to reach 11wsi regulator bottomed out. Removed regulator from lp line. Removed mounting bracket from regulator. Removed tank connection from regulator. New regulator came in. Put lp thread tape on lp connection for tanks and tightened into regulator. Took mounting bracket and attached to new regulator. Attached regulator to lp line. Tightened down and tested on both tanks to check fo leaks. No leaks found.

Labor		Mechanic	Total
Code	Description	CCV	
Z990	MISCELLANEOUS REPAIR		54.00
Z990	MISCELLANEOUS REPAIR		0.00

Parts		Qty	Price	Total
Part #	Description			
06-0443	MEGR-253P LP REGULATOR 2-STAGE	1.00	74.14	74.14
Subtotal for Job #4:				128.14

Job #5 - Warranty

DROP TEST FOR REGULATOR INSTALL

Labor		Mechanic	Total
Code	Description	CCV	
Z990	MISCELLANEOUS REPAIR		36.00
Subtotal for Job #5:			36.00

Parts Total:	91.58
Labour Total:	234.00
Sublet Total:	0.00
Extras Total:	0.00
WORK ORDER TOTAL:	325.58

W/O: 78551
Promised Date: 31 DEC 25



Customer #: 1000
BASDEN'S AMERICAN RV,

