



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 78625
Promised Date:
24 DEC 25



Customer #: 19476
WELLS, DAVID



CUSTOMER WORK ORDER

WO #: 78625 (Appointment Date: 02 DEC 2025 - Time: 09:00am)

Customer: 19476 - WELLS, DAVID -

Tag:

Author: BJW

Location: 1210 BH TO CLOSE

Stock #:

Stock Desc: 2025 TT FOREST RIVER

CAMPSITE DELUXE CAMPSITE

Chassis #:

Serial #: 5ZT2CRRB2SZ080648

Mileage:

Licence:

Invoice #:

Date In: 02 DEC 25

Promised: 31 DEC 25

Date Sched:

Completed: 10 DEC 25

Warr. Date:

Job #1 - Warranty

COMPLAINT: THE OFF DOOR FRONT SLIDE IS NOT GOING IN OR OUT PROPERLY. CUSTOMER THINKS THAT THE GEAR MIGHT BE STIPPED. ONCE CUSTOMER GOT HERE FOR APPOINTMENT, BJ WENT OUT TO TRAILER WITH CUSTOMER. IF YOU STAND TO THE FRONT OF THE FRONT SLIDE ROOM (BETWEEN THE SLIDE ROOM AND THE KITCHEN COUNTER), YOU CAN SEE AND HEAR THE GEAR POPPING WHEN SOMEONE ATTEMPTS TO RUN THE ROOM OUT. SEE BJ IF YOU HAVE ANY QUESTIONS. BJ SAW IT DUPLICATE WITH CUSTOMER. NOTE: UNIT IS WINTERIZED PER CUSTOMER.

CAUSE: Gear box on the motor is bent causing the chain to pop

CORRECTION: Unscrewed the interior cover to the slideroom left motor. Had another tech push the button for the slideroom while I pushed the slideroom out a few inches. Pulled off the bulb seal. Unscrewed the track assembly from the outside. Took pictures of the part numbers on the motor assembly while the motor was out. Put the motor back in and screwed the track back to the exterior wall and slid on the bulb seal. Received the new slideroom motor assembly. Pulled off the bulb seal and unscrewed the track assembly. Disconnected the power and cables then unbolted the slideroom motor. Put in the new slideroom motor and tightened the bolts. Connected the cables to the slideroom and power. Screwed the track to the exterior wall. Slid on the bulb seal. Once the was back together ran the slideroom out and in three times and checked the cable tension, startingwith the bottom cable adjusted Ran the slideroom out and in three more times and adjusted the cables. Put the cable cover trim back on.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	185.00
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	185.00
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	0.00

Parts

Part #	Description	Qty	Price	Total
720136	Actuator - Motor Kit - RH - 20201190	1.00	206.20	206.20

Subtotal for Job #1: 576.20

Job #2 - Internal

COMPLAINT: REPLACE TONGUE JACK AND 20LB DUAL LP TANK COVER AS RESULT OF DAMAGE ON LOT. THIS IS NO CHARGE TO CUSTOMER.

CAUSE: Lot damage to the lp tank cover and tongue jack

CORRECTION: Put in po for a new tongue jack and lp tank cover. Received the new tongue jack. Lifted the



tongue up and supported with a jack stand. Disconnected the power to the jack and unbolted it from the tongue. Unboxed the new tongue jack and bolted it to the tongue and connected the power then tested. Received the new lp tank cover then assembled the cover and put on the lp tanks.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	N/C

Parts				
Part #	Description	Qty	Price	Total
40568	BLACK - Propane Tank Cover; For Dual	1.00	N/C	N/C
3291	3500# STROMBERG ELEC JACK	1.00	N/C	N/C
	-BULK			

Subtotal for Job #2: 0.00

Parts Total: 206.20
Labour Total: 370.00
Sublet Total: 0.00
Extras Total: 0.00

WORK ORDER TOTAL: 576.20

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 10 Dec 2025

W/O: 78625
Promised Date: 31 DEC 25



Customer #: 19476
WELLS, DAVID

