

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	2558757
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZTCFLS07TP432864
USA		CHASSIS VIN	1FDWE3FN9SDD30100
		MILEAGE	5950
		SITE/WAREHOUSE	210 / 210
Labor rate:	\$185.00	ITEM #	FLC27QBF35
OWNER INFORMATION		DEALER RO #	78848
CHUBBY CHOW FACTORY LLC		CLAIM START DATE	01/22/2026
PO BOX 3641		CLAIM END DATE	01/01/1900
Evansville, IN 47735			
USA			
Retail Date of Purchase	03/05/2025	WARRANTY EXPIRATION DATE	03/05/2026

Claim Line Details

Labor

Line#	Operation Code	Operational Description
1	RC-039-01-00-004751	25V486, 2025-389 - FUEL LINE EXTENSION - PERFORM REMEDY - Recall/Fuel System/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : bhoffman@americanrvcenter.com, 2026-01-22 09:01:55 :: RECALL 25V486 FR ID 51-1955
 Disconnected Batteries, drive and house, as instructed in Recall procedure but was unnecessary cause
 Correction Kit has to be ordered 1st... so i Part Requested Kit and reconnected batteries. NEED TO DO THE
 RECALL

Model#	Dlr Sub Hrs	1.00	Sub Labor Amt \$185.00
Serial#	Appr Hrs	1.00	Appr Labor Amt \$185.00

Notes

1) ok nw
 This motorhome is part of Phase#2 for this recall. Dealer MUST order the part through our parts department. Dealer MUST also follow the return instructions accordingly to the recall letter.nw

Labor

Line#	Operation Code	Operational Description
2	20-49-01-11-000591	LED Light Strip - Front Cap - Exterior/Front, Fiberglass Cap, Cab Over/Replace/ Electrical

Complaint, Cause, Correction

Original Note : bhoffman@americanrvcenter.com, 2026-01-22 09:02:31 :: CAP LIGHTS ARE TURNING PURPLE
 Located Cap light switch in overhead bed compartment and 2nd switch by Entry door and turned lights on... took
 pics and part requested new lights. NEED TO PUT IN NEW LIGHTS

Model#	Dlr Sub Hrs	0.40	Sub Labor Amt \$74.00
Serial#	Appr Hrs	0.40	Appr Labor Amt \$74.00

Notes

1) ok nw

Labor

Line# 3	Operation Code 10-9-03-00-000189	Operational Description Tank Strap - Frame & Chassis/Levelers, Underbelly/Install/No Tread Code
Complaint, Cause, Correction		
Original Note : bhoffman@americanrvcenter.com, 2026-01-22 09:10:16 :: BLANK TANK BRACKET IS LOOSE Unmounted Tank Band end. Jacked up unit at the area of black tank and inspected the loose bracket... it was in a stuck pinned in area and actually has another tank support bracket, it looks like they installed the secondary support because the support band has no clearance to be mounted as designed. I was barely able to get unsecured end of bracket band out of pinned position on outside of Bracketed area. Mounted with a Lag Screw and added a 2nd lag thru Band for extra support.		
Model#	Dlr Sub Hrs 0.50	Sub Labor Amt \$92.50

Serial# Appr Hrs 0.50 Appr Labor Amt \$92.50

Notes
1) ok nw

Labor
Line# 4

Operation Code Operational Description
40-196-01-11-004298 Sigma Dual USB Port Charging Dock - Electrical/12 Volt Interior/Replace/
Electrical

Complaint, Cause, Correction
Original Note : bhoffman@americanrvcenter.com, 2026-01-22 09:10:50 :: USB PORT AT ENT DOOR IS NOT
CHARGING C type port has no voltage. Located USB/C type port inside entrance door and tested voltage on
both... USB is working properly but the C type has no voltage. Part requested new Port. Received new USB Port
from Parts and installed and tested.

Model# Dlr Sub Hrs 0.20 Sub Labor Amt \$37.00

Serial# Appr Hrs 0.20 Appr Labor Amt \$37.00

Notes

Submitted	Labor Amt	\$388.50	Approved	Labor Amt	\$388.50
	Parts & Freight	\$0.00		Parts & Freight	\$0.00
	Total	\$388.50		Total	\$388.50

DEALER DATE
SIGNATURE
I certify that I have performed these repairs consistent with Forest
River Policies.

CUSTOMER DATE
SIGNATURE
All repairs described have been inspected and are satisfactory.