



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 78848
Promised Date:
28 FEB 26



CUSTOMER WORK ORDER

WO #: 78848

Customer: 46875 - CHUBBY CHOW
FACTORY LLC - 812-455-2400

Tag:

Author: BH

Location: 0210 BH TO CLOSE

Stock #: 2601R

Stock Desc: 2026 C COACHMEN

FREELANDER 27QB

Chassis #: 1FDWE3FN9SDD30100

Serial #: 1FDWE3FN9SDD30100

Mileage: 5950

Licence:

Invoice #:

Date In: 19 JAN 26

Promised: 28 FEB 26

Date Sched:

Completed: 17 FEB 26

Warr. Date:

Job #1 - Warranty

COMPLAINT: RECALL 25V486 FR ID 51-1955

CAUSE: Fule line recall

CORRECTION: Disconnected Batteries, drive and house, as instructed in Recall procedure but was unnecessary cause Correction Kit has to be ordered 1st... so i Part Requested Kit and reconnected batteries.

Unplugged fuel pump control module. Clamped off both ends of the line. Unplugged the line on bothe ends pulled it throught the frame holder. Rand new line in frame holder and installed both ends to line plugged in module checked for leaks. Good to go.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JTW	92.50
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	92.50

Parts

Part #	Description	Qty	Price	Total
F100231286	32" FUEL LINE RECALL KIT	1.00	40.95	40.95

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-FUEL LINE	1.00	16.26	16.26

Subtotal for Job #1: 242.21

Job #2 - Warranty

COMPLAINT: CAP LIGHTS ARE TURNING PURPLE

CORRECTION: Located Cap light switch in overhead bed compartment and 2nd switch by Entry door and turned lights on... took pics and part requested new lights.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JTW	74.00
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00

Parts

Part #	Description	Qty	Price	Total
F100584060	BADGE, KIT BACKLIT LENS RH/LH 2-LIGH	1.00	109.10	109.10

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-LIGHTS	1.00	16.26	16.26

Customer #: 46875
CHUBBY CHOW FACTORY
LLC,



Subtotal for Job #2: 199.36

Job #3 - Warranty

COMPLAINT: BLANK TANK BRACKET IS LOOSE

CAUSE: Unmounted Tank Band end.

CORRECTION: Jacked up unit at the area of black tank and inspected the loose bracket... it was in a stuck pinned in area and actually has another tank support bracket, it looks like they installed the secondary support because the support band has no clearance to be mounted as designed. I was barely able to get unsecured end of bracket band out of pinned position on outside of Bracketed area. Mounted with a Lag Screw and added a 2nd lag thru Band for extra support.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	92.50

Subtotal for Job #3: 92.50

Job #4 - Warranty

COMPLAINT: USB PORT AT ENT DOOR IS NOT CHARGING

CAUSE: C type port has no voltage.

CORRECTION: Located USB/C type port inside entrance door and tested voltage on both... USB is working properly but the C type has no voltage. Part requested new Port. Received new USB Port from Parts and installed and tested.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	9.25
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	27.75

Parts

Part #	Description	Qty	Price	Total
F100130007	CHARGER, DUAL USB (2 PORTS) 5V BLACK	1.00	6.18	6.18

Subtotal for Job #4: 43.18

Job #5 - External

COMPLAINT: Transferred to BAS*78927 on 30 JAN 26

Estimate amount was 0.00

CHECK AND SEAL ROOF AS NEEDED.

CAUSE: Inspected roof, clean and fill voids

CORRECTION: Inspected roof. Found minor voids and separations along edges at membrane. Retrieved a tube of nonsag white dicor and brushed out and filled voids with Dicor.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #5: 0.00

Job #6 - External

COMPLAINT: Transferred to BAS*78927 on 30 JAN 26

Estimate amount was 0.00

LP PRESSURE TEST

W/O: 78848
Promised Date: 28 FEB 26



Customer #: 46875
CHUBBY CHOW FACTORY
LLC,



CAUSE: DropTest and test pressures on LP System.

CORRECTION: Pulled unit into shop and turned on LP and hooked Hose up to City Water Connection. Ran Tankless Water Heater and Furnace to preform pressure DropTest. Manometer hooked to outside grille quick connect and read 20wc when i 1st turned on LP. After turning on Water Heater and Furnace Manometer read 10wc. Turned Appliances off and turned LP Valve off and wc jumped to 17. It is very cold out today so im going to let Unit warm a bit and do another test. Did another Test and Lock Out pressure was 13wc. DropTest to 8wc and system held efficiently.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	N/C

Subtotal for Job #6: 0.00

Job #7 - External

COMPLAINT: Transferred to BAS*78927 on 30 JAN 26

Estimate amount was 0.00

GENERATOR SQUEAKS WHEN STARTING & STOPPING. IS THERE ANYTHING THAT CAN BE DONE WITH RUBBER BUMPER MOUNTS TO QUIET THEM?

CAUSE: Assess squeak in Generator.

CORRECTION: Started and ran Generator and the shake as its stopping is a normal thing and all Bolts are torqued properly.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	N/C

Subtotal for Job #7: 0.00

Job #8 - External

COMPLAINT: Transferred to BAS*78927 on 30 JAN 26

Estimate amount was 0.00

REMOVE JACKS. HAVE KC PUT IN RENTAL ATTIC AREA.

CAUSE: Remove hydraulic jacks and secure line. Store jacks in attic.

CORRECTION: Rolled under unit and disconnected Hydraulic line to jack and double checked thread size ... 1/4in JIC Male to 1/4in JIC Male is what i need to remove jacks and connect in and out line together. Part requesting for them. Craig ran to hardware store and got parts. Disconnected in and out lines from hydraulic and used conjoiner to conn3ct lines. Cleaned hydraulic fluid from area and removed 4 mount bolts and nuts and removed jack from unit. Used ziptie to secure connected hydraulic lines to frame. Repeated process on other 3 jacks plus removal of the conjoin bracket between the 2 rear jacks had to be removed. The bent jack would not come off the welded stud cause they was bent out of liniment. Attempted to make a tool with a nut welded to the end of pole and use it to straighten the studs but couldn't get tool threaded to stud because of bent so i used my cutting wheel and cut 2 lower studs off and removed last jack. Cleaned up all my different tools and mess from hydraulics. Had KC take jacks to attic.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	N/C

Subtotal for Job #8: 0.00

Job #SVCGEN - External

COMPLAINT: Transferred to BAS*78927 on 30 JAN 26

Estimate amount was 0.00



SERVICE GENERATOR OIL/FILTER

CAUSE: 708hrs change gen oil

CORRECTION: Brought unit in. Removed cover on generator pulled drain plug and drained oil. Once drained placed back in and filled with 1.5quarts of oil. Check oil levels and ran for 30 seconds to run oil through generator. Placed cover on generator and marked hours down

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	CCV	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
PARTS	UNINVENTORIED PARTS	0.00	N/C	N/C
PARTS	UNINVENTORIED PARTS	0.00	N/C	N/C

Subtotal for Job #SVCGEN: 0.00

Job #OILF - External

COMPLAINT: Transferred to BAS*78927 on 30 JAN 26

Estimate amount was 0.00

OIL, LUBE, AND FILTER ON FORD GAS CHASSIS

CAUSE: Change oil 5950miles

CORRECTION: Brought unit in. Grabbed oil pan and went under unit and removed drain plug and oil filter. Let drain. Put some oil on and in new oil filter. Placed and tightened down. Place plug back in. Went and lifted hood and added 8.5 quarts of oil in unit. Checked oil levels on dip stick. Marked mileage of unit and ran for 1 min to get new oil through engine.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	CCV	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
PARTS	UNINVENTORIED PARTS	0.00	N/C	N/C
PARTS	UNINVENTORIED PARTS	0.00	N/C	N/C

Subtotal for Job #OILF: 0.00

Parts Total: 156.23

Labour Total: 388.50

Sublet Total: 0.00

Extras Total: 32.52

WORK ORDER TOTAL: 577.25

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 17 Feb 2026

W/O: 78848
Promised Date: 28 FEB 26



Customer #: 46875
CHUBBY CHOW FACTORY
LLC,

