

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	2559487
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZTCFLS03TP432893
USA		CHASSIS VIN	1FDWE3FNXSDD32339
		MILEAGE	11336
Labor rate:	\$185.00	SITE/WAREHOUSE	210 / 210
OWNER INFORMATION		ITEM #	FLC27QBF35
CHUBBY CHOW FACTORY LLC		DEALER RO #	78866
PO BOX 3641		CLAIM START DATE	01/22/2026
Evansville, IN 47735		CLAIM END DATE	01/01/1900
USA			
Retail Date of Purchase	05/07/2025	WARRANTY EXPIRATION DATE	05/07/2026

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description		
	RC-039-01-00-004751	25V486, 2025-389 - FUEL LINE EXTENSION - PERFORM REMEDY - Recall/Fuel System/Replace/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2026-01-22 14:17:11 :: RECALL 25V486 FR # 51-1955 Recall Parts request submitted for recall after pulling plug and trying to start coach			
Model#	Dlr Sub Hrs	1.00	Sub Labor Amt	\$185.00
Serial#	Appr Hrs	1.00	Appr Labor Amt	\$185.00
	Notes			
	1) ok nw			
	This motorhome is part of phase#2 for this recall. Dealer MUST order part through our parts department. Dealer MUST also follow the return instructions accordingly to the recall letter.nw			

Labor

Line# 2	Operation Code	Operational Description		
	40-106-24-11-001258	Heating Pad - Holding Tank - Electrical/12 Volt Exterior/Repair/Electrical		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2026-01-22 14:18:19 :: BLACK TANK HEATING PAD IS STARTING TO FALL OFF. Black tank heater. Brought unit in. Black tank heater had fallen off. Cleaned up with mineral spirits to get build up off. Once cleaned up used 3m tape prime to stick back with bottle jack to hold wood to keep pad in place. Re,oved wood and jack holding wood in place. Tank heater sticks to tank.			
Model#	Dlr Sub Hrs	0.20	Sub Labor Amt \$37.00	
Serial#	Appr Hrs	0.20	Appr Labor Amt \$37.00	
	Notes			

Labor

Line# 3	Operation Code	Operational Description		
	20-49-01-11-000591	LED Light Strip - Front Cap - Exterior/Front, Fiberglass Cap, Cab Over/Replace/ Electrical		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2026-01-22 14:19:22 :: CAP LIGHTS HAVE TURNED PURPLE			
	Cap lights Cap lights have turned purple when lit parts request submitted			
Model#	Dlr Sub Hrs	0.40	Sub Labor Amt	\$74.00
Serial#	Appr Hrs	0.40	Appr Labor Amt	\$74.00
	Notes			
	1) ok nw			

Labor

Line# 4	Operation Code	Operational Description
---------	----------------	-------------------------

30-102-12-00-002691

Wall Panel - Luan - Interior/Panels, Ceilings, & Interior Moldings/Resecure or Tighten/No Tread Code

Complaint, Cause, Correction

Original Note : bhoffman@americanrvcenter.com, 2026-01-22 14:20:14 :: BEDROOM WALL OPPOSITE SHOWER HAD BOWED AND POPPED LOOSE. Wall board Qent inside and wall board in bedroom was bowing. Removed trim on wall board and pulled staples. Cut excess off of bottom of wallboard once i had pulled the bottom half out. Cut and mesured until board wasnt bowing. Once done stapled back on and looked for and found trim for bottom over board to cover removed board. Cut to length and stapled both trim in place. Made grey wood putty and covered staples

Model# **Dlr Sub Hrs** 0.40 **Sub Labor Amt** \$74.00

Serial# **Appr Hrs** 0.20 **Appr Labor Amt** \$37.00

Notes

flat rate time allowed for repair.nw

Time allowed as goodwill due to the excessive miles on this motorhome

Submitted	Labor Amt	\$370.00
	Parts & Freight	\$0.00
	Total	\$370.00

Approved	Labor Amt	\$333.00
	Parts & Freight	\$0.00
	Total	\$333.00

DEALER	DATE
---------------	-------------

SIGNATURE

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER	DATE
-----------------	-------------

SIGNATURE

All repairs described have been inspected and are satisfactory.