

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	2563570
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZTCFLS05TP432863
USA		CHASSIS VIN	1FDWE3FN7SDD32380
		MILEAGE	3322
		SITE/WAREHOUSE	210 / 210
Labor rate:	\$185.00	ITEM #	FLC27QBF35
OWNER INFORMATION		DEALER RO #	78872
CHUBBY CHOW FACTORY LLC		CLAIM START DATE	01/28/2026
PO BOX 3641		CLAIM END DATE	01/01/1900
Evansville, IN 47735			
USA			
Retail Date of Purchase	04/19/2025	WARRANTY EXPIRATION DATE	04/19/2026

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description		
	RC-039-01-00-004751	25V486, 2025-389 - FUEL LINE EXTENSION - PERFORM REMEDY - Recall/Fuel System/Replace/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2026-01-28 08:23:16 :: RECALL 25V486 FR # 51-1955 Recall Brought unit in. Followed recall protical. Parts request submitted for recall			
Model#	Dlr Sub Hrs	1.00	Sub Labor Amt	\$185.00
Serial#	Appr Hrs	1.00	Appr Labor Amt	\$185.00
	Notes			
	1) ok nw			
	this motorhome is part of phase#2 for this recall. Dealer MUST order part through our parts department. Dealer MUST also follow the return instructions accordingly to the recall letter			

Labor

Line# 2	Operation Code	Operational Description		
	40-106-24-11-001258	Heating Pad - Holding Tank - Electrical/12 Volt Exterior/Repair/Electrical		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2026-01-28 08:23:42 :: BLACK TANK HEATER IS COMING LOOSE Tank heater Brought unit in. Saw black tank heater was falling off of unit. Cleaned area with mineral spirits and dried off. Then applied tape prime to both areas ans used a piece of wood and jack to put pressure on spot while tape prime sets in to stick back to heater. Removed jack from wood holding tank heater up. Tank heater is sticking to tank			
Model#	Dlr Sub Hrs	0.20	Sub Labor Amt	\$37.00
Serial#	Appr Hrs	0.20	Appr Labor Amt	\$37.00
	Notes			

Labor

Line# 3	Operation Code	Operational Description		
	40-196-01-11-004298	Sigma Dual USB Port Charging Dock - Electrical/12 Volt Interior/Replace/ Electrical		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2026-01-28 08:26:03 :: USB CHARGER BY DOOR IS NOT WORKING USB AND USBC IS NOT CHARGING NEED TO REPLACE			
Model#	Dlr Sub Hrs	0.20	Sub Labor Amt	\$37.00
Serial#	Appr Hrs	0.20	Appr Labor Amt	\$37.00
	Notes			

Labor

Line# 4

Operation Code

30-102-01-00-002691

Operational Description

Wall Panel - Luan - Interior/Panels, Ceilings, & Interior Moldings/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : bhoffman@americanrvcenter.com, 2026-01-28 08:26:38 :: HOLE IN FRONT PANEL OF BED. MUST OF BEEN NOTED ON DAF - THERE IS BLUE TAPE NEAR IT. Bed panel Brought unit in. Found hole in bed panel. Parts request submitted for panel and sesm tape

Model#

Dlr Sub Hrs

2.00

Sub Labor Amt

\$370.00

Serial#

Appr Hrs

1.50

Appr Labor Amt

\$277.50

Notes

1) ok nw

Labor

Line# 5

Operation Code

70-147-24-00-001658

Operational Description

TV Swing Bracket - Appliances/Television/Repair/No Tread Code

Complaint, Cause, Correction

Original Note : bhoffman@americanrvcenter.com, 2026-01-28 08:27:28 :: TV IS RUBBING ON CEILING WILL NOT CLOSE FLUSH AGAINST WALL. Tv Brought unit in. Checked tv and it is not locking all ghe way in place. Noticed its missing a turn handle to secure it in place on tv bracket parts request submitted

Model#

Dlr Sub Hrs

0.10

Sub Labor Amt

\$18.50

Serial#

Appr Hrs

0.10

Appr Labor Amt

\$18.50

Notes

Labor

Line# 6

Operation Code

50-134-01-00-001443

Operational Description

LP Regulator - Includes Leak Test - LP Gas/LP Gas System/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : bhoffman@americanrvcenter.com, 2026-01-28 08:28:24 :: LP SAFETY CHECK Lp test Starting pressure was 13.5iwc. At 50% with furnace and range is 11iwc. Lock up stops at 13iwc. Fornleak test ran at 8iwc for 5mins. Had a leak during test. Checked at water heater, furnace, and range for leak. None found. Testing at range to check for leak. After checking and capping all appliances besides range. And spraying manifoldand lines sprayed at regulator andfound vent was leaking. Removedlp line from regulator. Removed regulator from tanke and toom to vise to remove adapter. Once removed placed lp thread tape on and placed adapter on new regulator. Went to unit and put threwd tape on lp line. Attached lp line to regulator and then to tank. Attached all lp lines back to appliances and turned tank on and checked for leaks. Ran new lp test. Starting pressure was 11.5iwc. 50% with range and furance is 10iwc. Adjusted to 11. Lock up pressure stops at 13.5iwc. Running leak test at 8 for 5mins. Unit passed leak test. No new leaks found

Model#

Dlr Sub Hrs

0.50

Sub Labor Amt

\$92.50

Serial#

Appr Hrs

0.50

Appr Labor Amt

\$92.50

Notes

Submitted	Labor Amt	\$740.00	Approved	Labor Amt	\$647.50
	Parts & Freight	\$0.00		Parts & Freight	\$0.00
	Total	\$740.00		Total	\$647.50

DEALER

SIGNATURE

DATE

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER

SIGNATURE

DATE

All repairs described have been inspected and are satisfactory.