



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 78911
Promised Date:
24 JAN 26

CUSTOMER WORK ORDER

WO #: 78911

Customer: 1000 - BASDENS AMERICAN
RV -
Tag:
Author: BH
Location: 0203 BH TO CLOSE

Stock #: 11686
Stock Desc: 2026 TT KEYSTONE
SPRINGDALE 31SUNROOM
Chassis #: 4YDTSGR24T7102236
Serial #: 4YDTSGR24T7102236
Mileage: 0
Licence:

Invoice #:
Date In: 29 JAN 26
Promised: 31 JAN 26
Date Sched:
Completed: 06 FEB 26
Warr. Date:



Job #PDINTT - Internal

COMPLAINT: PDI - NEW TRAVEL TRAILER

CAUSE: Pdi new camper

CORRECTION: Pulled the camper into the service bay. Pulled off the lp tank cover then unbolred thelp tanks and disconnected the lp lines. Filled 2-20 lb lp tanks. Set the lp tanks back on the tongue and bolted down, connected the lp hose. Got a new battery box and bolted to the battery tray. Put a used battery inside the box the connected the positive and negative wires to test the camper. Checked and set the tires to 65psi. Checked and set the lug nuts to 110ftlbs then jacked up the camper to check the brakes and breakaway switch. Plugged in the campers shore cord. Turned on the 12v fridge to cool. Tested the running lights. Went on the roof and checked the membrane and sealer. Connected the garden hose to the city water connection then turned the valve to fill the fresh tank. Dewinterized the camper then turned the valve to city water. Connected the manometer to the lp quick connection and started the lp drop test. Had to raise the lp regulator while running the furnace and water heater to 11 wc. Tested the stove and oven. Channel search the tv in the living area amd used the test tv for the bedroom. Tested the Bluetooth radio, inside and outside speakers. Filled out the paperwork after taking pictures of the appliances. Checked the 120v outlets, usb ports, converter output and 12v items. Tested both ac units,tv, fireplace and the microwave. Opened the couch to a pull out bed and recliner. Opened the windows and emergency exits. The entry door handle is crooked because it is missing a screw. Checked the cabinets for adjustment. Tested the lp detector, smoke alarm and floor vacuum. Checked each faucet for hot water. Connected the hose to the black tank flush and opened the black tank valve to verify it was flowing.

Customer #: 1000
BASDENS AMERICAN RV,



Labor

Code	Description	Mechanic	Total
Z991	MISC LABOUR CODE (INTERNAL)	SAR	N/C
Z991	MISC LABOUR CODE (INTERNAL)	SAR	N/C
Z991	MISC LABOUR CODE (INTERNAL)	SAR	N/C
Z991	MISC LABOUR CODE (INTERNAL)	SAR	N/C

Parts

Part #	Description	Qty	Price	Total
13034	55362 STD BATTERY BOX	1.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C
LPGI	LP - UNIT SALES	8.00	N/C	N/C

Subtotal for Job #PDINTT: 0.00

Job #WINTER - Internal

COMPLAINT: WINTERIZE UNIT AND DRAIN HOLDING TANKS.

INCLUDES 2 GALLONS OF ANTI-FREEZE

UNITS WITH WASHING MACHINE OR ICEMAKER



WILL BE EXTRA
 DE-WINTERIZATION IS NOT INCLUDED
 NUMBER OF GALLONS USED _____

CAUSE: Winterizing 2 gallons

CORRECTION: Turned the valve at the water pump then added 2 gallons through the kitchen faucet, bathroom faucet, toilet, shower, low points, and inside sprayport. Drained the black, grey and fresh tanks.

Labor			
Code	Description	Mechanic	Total
Z990	WINTERIZE UNIT	SAR	N/C
Z990	WINTERIZE UNIT	SAR	N/C
Z990	WINTERIZE UNIT	SAR	N/C

Parts				
Part #	Description	Qty	Price	Total
24181	-50 RV ANTI-FREEZE GALLON	2.00	N/C	N/C

Other Services				
Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C
Subtotal for Job #WINTER:				0.00

Job #1 - Warranty

COMPLAINT: DOOR HANDLE IS CROOKED

CAUSE: Missing screw

CORRECTION: Took pictures of the crooked entry handle. Put in a parts request for a new entry handle.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	55.50
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	0.00

Parts				
Part #	Description	Qty	Price	Total
08200	LOCK ASSEMBLY-BLACK	1.00	33.32	33.32
Subtotal for Job #1:				88.82

Job #2 - Warranty

COMPLAINT: STEP HOLDER IS HITING FRAME

CAUSE: Step holder

CORRECTION: Took pictures of the steps then loosened the bolts and adjusted and tightened the bolts.

Labor				
Code	Description	Mechanic	Total	
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	55.50	
Subtotal for Job #2:				55.50

Job #3 - Warranty

COMPLAINT: SWITCH FOR STAY JACKS IS LOOSE ON THE FRONT

CAUSE: Loose screws

CORRECTION: Took pictures of the switch then checked the screws. Screws were loose. Tightened up the screws.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	37.00

W/O: 78911
 Promised Date: 31 JAN 26



Customer #: 1000
 BASDEN'S AMERICAN RV,



Subtotal for Job #3: 37.00

Job #4 - Warranty

COMPLAINT: FRONT LOWER METAL HAS A CREASE IN IT CLOSER TO THE DOOR SIDE

CAUSE: Crease and rust marks

CORRECTION: Took pictures of the damage to the lower metal on the front cap the put in parts request for new metal.

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)		0.00
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	0.00

Subtotal for Job #4: 0.00

Parts Total: 33.32
Labour Total: 148.00
Sublet Total: 0.00
Extras Total: 0.00
WORK ORDER TOTAL: 181.32

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 06 Feb 2026

W/O: 78911
Promised Date: 31 JAN 26



Customer #: 1000
BASDEN'S AMERICAN RV,

