



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 78938

CUSTOMER WORK ORDER

WO #: 78938

Customer: 1000 - BASDEN'S AMERICAN
RV -
Tag:
Author: BH
Location: 0219 BH TO CLOSE

Stock #: 11693
Stock Desc: 2026 TT COACHMEN APEX
242BARV
Chassis #: 5ZT2CXNB0TS049693
Serial #: 5ZT2CXNB0TS049693
Mileage: 0
Licence:

Invoice #:
Date In: 30 JAN 26
Promised:
Date Sched:
Completed: 19 FEB 26
Warr. Date:

Job #PDINTT - Internal PDI - NEW TRAVEL TRAILER

Labor

Code	Description	Mechanic	Total
Z991	MISC LABOUR CODE (INTERNAL)	ZMS	N/C
Z991	MISC LABOUR CODE (INTERNAL)	ZMS	N/C
Z991	MISC LABOUR CODE (INTERNAL)	ZMS	N/C
Z991	MISC LABOUR CODE (INTERNAL)	ZMS	N/C
Z991	MISC LABOUR CODE (INTERNAL)	ZMS	N/C

Parts

Part #	Description	Qty	Price	Total
13034	55362 STD BATTERY BOX	1.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
LPGI	LP - UNIT SALES	0.00	N/C	N/C

Subtotal for Job #PDINTT: 0.00

Job #WINTER - Internal

WINTERIZE UNIT AND DRAIN HOLDING TANKS.
INCLUDES 2 GALLONS OF ANTI-FREEZE
UNITS WITH WASHING MACHINE OR ICEMAKER
WILL BE EXTRA
DE-WINTERIZATION IS NOT INCLUDED
NUMBER OF GALLONS USED _____

Labor

Code	Description	Mechanic	Total
Z990	WINTERIZE UNIT	ZMS	N/C
Z990	WINTERIZE UNIT	ZMS	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #WINTER: 0.00

Job #1 - Internal

COMPLAINT: SIDE OF THE FRIDGE IS SUNK IN
CAUSE: Check with warranty on repair.

Labor



Customer #: 1000
BASDEN'S AMERICAN RV,



Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)		N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Subtotal for Job #1: 0.00

Job #2 - Warranty

COMPLAINT: WATER LINE BEHIND MANIFOLD IS PINCHED

CAUSE: The line is pinched and isnt allowing water to flow through it.

CORRECTION: Removed the damaged section on water line. Installed a union and a new piece of hose onto the fitting. Tested for leaks.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	55.50

Parts				
Part #	Description	Qty	Price	Total
4794186	1/2" PEX PLASTIC COUPLER	1.00	0.08	0.08

Subtotal for Job #2: 55.58

Job #3 - Warranty

COMPLAINT: INSIDE WATER PUMP SWITCH IS INOP

CAUSE: The outside switch turns on the pump but the inside switch doesnt light up or operate the pump. When the outside switch is on it will also turn off the light in the front compartment. Removed the outside panel apulled the switch for the water pump out. Swapped the wires on the switch but nothing changed.

CORRECTION: Went inside and pulled the controll panel. Found a fuse that was popped. Replaced the fuse and both switches are now working for the water pump.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	37.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00

Subtotal for Job #3: 37.00

Job #4 - Warranty

COMPLAINT: ENTRY STEPS NEED ADJUSTED

CAUSE: Step holder is against the door hinge.

CORRECTION: Moved the holder away from the hinge.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	46.25

Subtotal for Job #4: 46.25

Job #5 - Warranty

COMPLAINT: CABINETS ABOVE SINK HAS PAINT ON THEM

CAUSE: Paint and or putty on cabinets.

CORRECTION: Removed paint and or putty with glass cleaner.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	55.50



Customer #: 1000
BASDEN'S AMERICAN RV,



Subtotal for Job #5: 55.50

Job #6 - Warranty

COMPLAINT: GLUE ON FREEZER DOOR

CAUSE: Glue on the freezer door.

CORRECTION: Cleaned glue with mineral spirits and glass cleaner.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	37.00

Subtotal for Job #6: 37.00

Job #7 - Warranty

COMPLAINT: SHOWER PAN NEEDS SEALED

CAUSE: Anti freeze has seeped through the shower pan.

CORRECTION: Cleaned up anti freeze and removed silicone from the pan. Resealed with silicone.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	37.00

Subtotal for Job #7: 37.00

Job #8 - Warranty

COMPLAINT: SCRATCHES ON BATHROOM DOOR

CAUSE: Therecare scratches on the bathroom door.

CORRECTION: Removed the scratches with mineral spirits and a rag.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	37.00

Subtotal for Job #8: 37.00

Job #9 - Warranty

COMPLAINT: ROOF NEEDS DICOR

CAUSE: There are seams gaps and screw heads showing on the roof.

CORRECTION: Applied dicor to the roof as needed.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	37.00

Parts

Part #	Description	Qty	Price	Total
13-1320	PW HAPS FREE SELF-LEVELING DICOR	1.00	8.72	8.72

Subtotal for Job #9: 45.72

Job #10 - Warranty

COMPLAINT: THE FURNACE WILL NOT TURN ON

CAUSE: During the p d i was running the furnace period the furnace was short , cycling and made a loud pop. I turned the furnace off and back on and it ran for a while and then shut off. When I tried to turn the

W/O: 78938



Customer #: 1000
BASDEN'S AMERICAN RV,



furnace back on the fan kicked on. But it did not go through the ignition cycle. I will need to pull the furnace. Remove the outside exhaust port , removed the inside access panel. I had to remove the duct work and the rear panel to gain access to the gas line fitting to remove it. When trying to pull the furnace out of the cutout , I found that the cutout is too small. It looks like they put the counter top in after they installed the furnace. I need approval for removal and or repair for this.

CORRECTION: We were able to remove a support beam and part of the panel near the cut out. Thus gave us enough room to pull the furnace. Once i placed the furnace on the bench tester i noticed the wire for the sail switch had fell off one of the tabs. Secured the wire to the sail switch and ran for 10 minutes without any issues. Secured the wires,ducts and gas line to the furnace. Installed the exhaust vent assembly with new butol tape and sealed with silicone. Secured the rear access panel and ducts to the furnace. Installed L brackets to hold the furnace in place. Installed the support beam and panel with brad nails and installed access vent cover.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	185.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	370.00

Subtotal for Job #10: 555.00

Job #11 - Warranty

COMPLAINT: LIGHT ON BLUETOOTH RADIO ISNT WORKING

CAUSE: One of the lights on the bluetooth speaker is not working period this is not a repairable item in the entire speaker will need to be replaced.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)		0.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	37.00

Parts

Part #	Description	Qty	Price	Total
F100728335	SPEAKER, ALPINE BLUETOOTH BLACK	1.00	160.88	160.88

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-SPEAKER	1.00	16.30	16.30

Subtotal for Job #11: 214.18

Job #12 - Warranty

COMPLAINT: THE SWITCH ON THE OUTSIDE PANEL IN WET BAY IS TURNING LIGHT OFF WHEN SWITCHING ON THE WATER PUMP

CAUSE: Pulled the outside panel off to look at the wiring. Found a neutral wire capped off. Swapped neutral and hot wires around and thus did not change anything.

CORRECTION: We then found the neutral wire was connected to the pump switch instead of the light switch. Removed the neutral and connected it with a scotch lock onto the neutral wires on the pump awitch. Now the light stays on and the pump works. Installed panel.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	55.50
Z990	MISC LABOUR CODE (EXTERNAL)	BRM	37.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	92.50

Subtotal for Job #12: 185.00



Customer #: 1000
BASDENS AMERICAN RV,



Parts Total:	169.68
Labour Total:	1,119.25
Sublet Total:	0.00
Extras Total:	16.30
WORK ORDER TOTAL:	1,305.23

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Date: 19 Feb 2026

Customer Signature : _____

Customer Work Order



Customer #: 1000
BASDEN'S AMERICAN RV,

