



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 79010
Promised Date:
28 FEB 26

CUSTOMER WORK ORDER

WO #: 79010

Customer: 1000 - BASDEN'S AMERICAN
RV -

Tag:

Author: BH

Location: 0305 CHECK PREAUTH

Stock #: 11709

Stock Desc: 2026 TT COACHMEN

REMOTE 12R

Chassis #: 5ZT2RMAC8TL019637

Serial #: 5ZT2RMAC8TL019637

Mileage: 0

Licence:

Invoice #:

Date In: 11 FEB 26

Promised: 28 FEB 26

Date Sched:

Completed: 28 FEB 26

Warr. Date:

Job #PDINTT - Internal

COMPLAINT: PDI - NEW TRAVEL TRAILER TL019637

CAUSE: Pdi

CORRECTION: Pulled the camper into the service bay from the front lot. Checked the tire pressure and set to 51 psi. Checked and set the lug nuts to 110ftlbs. Got a new battery box then drilled drain holes and mounted it to the tongue. Disconnected the single 20lb lp tank then purged the tank and filled. Mounted the lp tank. Checked the roof membrane and sealer, no touch-up needed at this time. Connected the test box to check the running lights, brakes and breakaway switch. Plugged in the shore cord. Inspected the manual tongue jack and safety chains. Closed the drain on the fresh tank then filled. Closed the drains on the black and grey tanks. Turned the valves at the water pump and dewinterized the camper. Connected the hose to the city water connection. Connected the manometer to the lp quick connection and started the lp drop test. Checked the stove and griddle, but had to use a different lp hose. The lp quick connection hose didn't fit the connection on the frame. Ran the furnace and water heater during the lp drop test and adjusted the lp regulator as necessary. While the furnace was running, sounded like the was something ticking against the fan. Turned off the water heater and furnace. Checked each 120v gfci outlets, ac, microwave. Checked the usb ports Converter output, fridge, lp detector and smoke alarm, ceiling vent fans. Couldn't test tv signal cause the is no antenna. Extended the stability jacks and retracted them.

Labor

Code	Description	Mechanic	Total
Z991	MISC LABOUR CODE (INTERNAL)	SAR	N/C
Z991	MISC LABOUR CODE (INTERNAL)	SAR	N/C
Z991	MISC LABOUR CODE (INTERNAL)	SAR	N/C
Z991	MISC LABOUR CODE (INTERNAL)	SAR	N/C

Parts

Part #	Description	Qty	Price	Total
13034	55362 STD BATTERY BOX	1.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C
LPGI	LP - UNIT SALES	4.00	N/C	N/C

Subtotal for Job #PDINTT: 0.00

Job #WINTER - Internal

COMPLAINT: WINTERIZE UNIT AND DRAIN HOLDING TANKS.

INCLUDES 2 GALLONS OF ANTI-FREEZE

UNITS WITH WASHING MACHINE OR ICEMAKER
WILL BE EXTRA

DE-WINTERIZATION IS NOT INCLUDED

NUMBER OF GALLONS USED _____



Customer #: 1000
BASDEN'S AMERICAN RV,





CAUSE: Winterizing 2 gallons

CORRECTION: Drained the black and grey tanks and fresh tank. Turned the valves at the water pump. Added 2 gallons through the kitchen faucet, shower, toilet, outside shower and drains. Depressed city water connection and water heater.

Labor Code	Description	Mechanic	Total
Z990	WINTERIZE UNIT	SAR	N/C

Parts Part #	Description	Qty	Price	Total
24181	-50 RV ANTI-FREEZE GALLON	2.00	N/C	N/C

Other Services Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C

Subtotal for Job #WINTER: 0.00

Job #1 - Warranty

COMPLAINT: TANK HEATERS FALLING OFF

CAUSE: Heating pad

CORRECTION: The heating pad on the fresh tank and grey tank wasnt sticking to the tanks. Applied 3m tape primer then pressed them against the tank and added tape for temporary hold.

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	37.00

Subtotal for Job #1: 37.00

Job #2 - Warranty

COMPLAINT: FURNACE FAN IS TICKING

CAUSE: Fan blade

CORRECTION: During the pdi the turned on the furnace and the furnace fan was ticking. Shut off the lp then unscrewed the furnace cover. Disconnected the power wires from the furnace. Disconnected the lp line. Unscrewed the furnace from the cabinet. Bench tested the furnace and found the big fan blade was running the metal frame. Disassembled the furnace. Unscrewed the fan blade from the motor. Shaved the fan blade at the ends where it was rubbing. Screwed on the fan to the motor and assembled the furnace. Tested the furnace by bench testing. Furnace was quiet after, rotated the furnace to make sure it was solid and quiet. Put the furnace back inside the camper. Connected the lp line and wires. Mounted the furnace to the cabinet and screwed on the cover. Tested the furnace again inside the camper and it still was quiet. Took pictures of the process.

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	83.25
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	148.00

Subtotal for Job #2: 231.25

Job #3 - Warranty

COMPLAINT: LP QUICK CONNECT HOSE FOR GRIDDLE WONT CONNECT TO FRAME CONNECTION

CAUSE: Lp hose

CORRECTION: Took pictures of the lp hose and put in a parts request got new hose and installed

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)		0.00



Z990

MISC LABOUR CODE (EXTERNAL)

SAR

9.25

Parts

Part #	Description	Qty	Price	Total
F100192196	HOSE, LP 48" WITH QUICK DISCONNECT M	1.00	23.44	23.44

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-HOSE	1.00	16.32	16.32

Subtotal for Job #3: 49.01

Parts Total: 23.44
Labour Total: 277.50
Sublet Total: 0.00
Extras Total: 16.32

WORK ORDER TOTAL: 317.26

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 05 Mar 2026

W/O: 79010
Promised Date: 28 FEB 26



Customer #: 1000
BASDEN'S AMERICAN RV,

