



Pre-Authorization

Pre-Authorization number	PREAUTH737 98 (PA03966018	Reference no.79026	Status	Approved			
Servicing Dealer 1194	Name Basden's American RV	Address 600 E Baseline Rd Evansville, IN 47725	VIN 4YDFCGN29T2504783	Retail sold on			

For paper claims only use one pre-authorization number per warranty claim form.
Staple a copy of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim form.
The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the amount authorized on the pre-authorization form and return to Keystone RV Company.



Root				Approved	Actual			Base	Complaint/Cause/Correction
Operation	Description	Sublet	Sub Hours	Hours	hours	Qty	hours	hours	
3300312B	Blind - Venetian - Holddown	0	0.1	0.1		1	0.1		Complaint: BLIND STRING MOUNT NOT HOLDING IN WALL Cause: Window shade screw pulled from wall Correction: Shot the screw and adjusted the strings so blind works properly now
3200806A	Door - Interior Sliding - Repair	0	0.2	0.2		1	0.2		Complaint: BUNK SLIDING DOOR NOT ALIGNED Cause: Sliding door out of adjustment Correction: Took trim board off and adjusted the hanger on the door to adjust the door with the frame. Door is adjusted and shuts properly now
3201803A	Decorative Wood Trim - Repair - per piece	0	0.1	0.1		1	0.1		Complaint: TRIM IN MASTER BED ISNT ATTACHED Cause: Loose trim Correction: Noticed loose trim in cabinets of master bedroom. Grabbed staple gun and stapled trim into place to secure. Pictures taken.
2315002J	Window - 47" or Less - Complete	0	1	1		1	1		Complaint: WINDDOW IN DINETTE IS BROKEN AND BENT Cause: Trim ring Correction: Noticed the dinette window trim ring had been bent and handle had fallen off track. Pictures taken parts request submitted. Brought unit in. Connected battery to battery box. Grabbed lift so someone could hold window as I removed window ring. Went inside turned light on and removed bothsides of valance at bottom bracket screw and at top where it connects to top piece. Removed top valance at two screws on both sides of it. Removed blinds three screws. Once all was removed and moved that sat infront of window ring pulled each screw out of window ring to remove it. Placed flat straight edge inside to measure wall thickness. Was is 1.75in thick. Placed window ring back together. Placed blinds back in place. Placed top valance

For paper claims only use one pre-authorization number per warranty claim form.

Staple a copy of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim form.

The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the amount authorized on the pre-authorization form and return to Keystone RV Company.



For paper claims only use one pre-authorization number per warranty claim form.

Staple a copy of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim form.

The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the amount authorized on the pre-authorization form and return to Keystone RV Company.