

BASDEN RV CENTER, INC dba AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 79204
MANUFACTURER'S CLAIM #:

Manufacturer: 10024 - FOREST RIVER TRAVEL TRAILER
Customer: 49259 - DANIEL SIMPSON
Address: 7383 S SUNRISE DRIVE FORT BRANCH, IN

47648

Phone: 812-632-0018

Stock Number: 11549 - 2025 CATALINA 283RKSLE 5ZT2CATB8SX034120

VIN: 5ZT2CATB8SX034120 HIN:

SER#: 5ZT2CATB8SX034120

Mileage: 0

Work Order Comp: 13 MAR 26

Auth. No:

Dealer #:

Warr. Date: 21 NOV 25

Work Order Date: 09 MAR 26

Inv #: 427345

WO #	Job #	Description	JOB INFORMATION
------	-------	-------------	-----------------

79204	2	CUSTOMER STATES THEY BLOW FUSES WHEN THEY TURN ON FRONT STRIP LIGHTS Power wire to light was grounded, grounding area is unknown Had to unlock compartment and move personal belongings out of the way. Replaced 15A fuse and powered switch and blew fuse. Located the Wago clip on both Stripped lights where power is connected and disconnected both lights and replaced fuse and it instantly blew. Pulled switch and checked continuity... switch tested correctly. Checked Voltage and Continuity at switch... Voltage is correct but one of the wires has continuity to ground which it should not. Disconnected both Green power wires at the door side Wago Connector and tested Continuity to ground on both... Power wire that jumps from Wago clip over to the OffDoorSide Light is grounded out. New power wire is going to have to be ran from Doorside light over to OffDoorSide light. Spoke with Ben and said its under warranty and go ahead and run new wire. Customer has got the passthru compartment crammed packed! After looking it over and brainstorming a few minutes i was able to come up with another route so i didnt have to completely disassemble the passthru compartment. I was able to go up thru the subfloor and back down over the frame on both sides and pass new wire thru the underbelly section. Tested operations of light and works properly and secured underbelly with underbelly tape.	
-------	---	---	--

79204	5V682	THE CHARGE LINE MAY NOT HAVE OVER CURRENT PROTECTION Recall	
-------	-------	---	--

Claim : 79204

 WO # Job # Description JOB INFORMATION

Preformed recall instructions and is wired correctly but the way
 the wires were tightened on contact studs was making contact and
 Breaker wasn't serving its purpose. I loosened nut and removed off
 of breakers other contact. Secured underbelly.

 Lab Code Job# Description LABOUR Hrs Rate Total

 Z990 2 MISC LABOUR CODE (EXTERNAL) 0.76 195.00 148.20
 Z990 2 MISC LABOUR CODE (EXTERNAL) 0.10 195.00 19.50
 Z990 2 MISC LABOUR CODE (EXTERNAL) 0.89 195.00 173.55
 Z990 V682 MISC LABOUR CODE (EXTERNAL) 0.20 195.00 39.00

Parts Total: 0.00
 Labour Total: 380.25
 Sublet Total: 0.00
 Extras Total: 0.00

>>>> Claim Total: 380.25

Customer Signature: _____

Date: _____