

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	2607977
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZT2CATB8SX034120
USA		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$195.00	SITE/WAREHOUSE	205 / 205
OWNER INFORMATION		ITEM #	ACAT283RKSLE
DANIEL R SIMPSON		DEALER RO #	79204
7383 S SUNRISE DR		CLAIM START DATE	03/12/2026
Fort Branch, IN 47648		CLAIM END DATE	01/01/1900
USA			
Retail Date of Purchase	11/20/2025	WARRANTY EXPIRATION DATE	11/20/2026

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description	
	40-196-24-11-001297	Interior 12 Volt Wiring - Electrical/12 Volt Interior/Repair/Electrical	
	Complaint, Cause, Correction		
	Original Note : bhoffman@americanrvcenter.com, 2026-03-12 14:24:26 :: CUSTOMER STATES THEY BLOW FUSES WHEN THEY TURN ON FRONT STRIP LIGHTS Power wire to light was grounded, grounding area is unknown Had to unlock compartment and move personal belongings out of the way. Replaced 15A fuse and powered switch and blew fuse. Located the Wago clip on both Stripped lights where power is connected and disconnected both lights and replaced fuse and it instantly blew. Pulled switch and checked continuity... switch tested correctly. Checked Voltage and Continuity at switch... Voltage is correct but one of the wires has continuity to ground which it should not. Disconnected both Green power wires at the door side Wago Connector and tested Continuity to ground on both... Power wire that jumps from Wago clip over to the OffDoorSide Light is grounded out. New power wire is going to have to be ran from Doorside light over to OffDoorSide light. Spoke with Ben and said its under warranty and go ahead and run new wire. Customer has got the passthru compartment crammed packed! After looking it over and brainstorming a few minutes i was able to come up with another route so i didnt have to completely disassemble the passthru compartment. I was able to go up thru the subfloor and back down over the frame on both sides and pass new wire thru the underbelly section. Tested operations of light and works properly and secured underbelly with underbelly tape.		
Model#	Dlr Sub Hrs	1.75	Sub Labor Amt \$341.25
Serial#	Appr Hrs	1.75	Appr Labor Amt \$341.25
Notes			

Labor

Line# 2	Operation Code	Operation Description		
	RC-003-13-00-004757	25V682, 2025-545 - MISSING OVERCURRENT PROTECTION - INSPECT & REPAIR - Recall/Electrical/Relocate/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2026-03-12 14:26:35 :: THE CHARGE LINE MAY NOT HAVE OVER CURRENT PROTECTION Recall Preformed recall instructions and is wired correctly but the way the wires were tightened on contact studs waas making contact and Breaker wasnt serving its purpose. I loosened nut and removed off of breakers other contact. Secured underbelly.			
	Model#	Dlr Sub Hrs	0.20	Sub Labor Amt \$39.00
	Serial#	Appr Hrs	0.20	Appr Labor Amt \$39.00
	Notes			

Submitted	Labor Amt	\$380.25	Approved	Labor Amt	\$380.25
	Parts & Freight	\$0.00		Parts & Freight	\$0.00

Total \$380.25

Total \$380.25

DEALER **DATE**

SIGNATURE

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER **DATE**

SIGNATURE

All repairs described have been inspected and are satisfactory.