



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 64045
Promised Date: 12 JUN 21

CUSTOMER WORK ORDER

WO #: 64045

Customer: 1000 - BASDEN'S AMERICAN
RV -

Tag:

Author: BH

Location: CLOSE RO 0603

Stock #: 10790

Stock Desc: 2021 5W KEYSTONE
MONTANA 3763BP

Chassis #: 4YDF37629M4702526

Serial #: 4YDF37629M4702526

Mileage: 0

Licence:

Invoice #:

Date In: 29 APR 21

Promised: 12 JUN 21

Date Sched:

Completed: 30 MAY 21

Warr. Date:

Job #PDINFW - Internal

COMPLAINT: PDI - NEW FIFTH WHEEL

CAUSE: PDI

CORRECTION: CHECK LIGHTS, BRAKES, BREAKAWAY, LUG NUTS, TIRES, ROOF, ACS REFER,
RANG, FILL WATER TANKS AND DRAIN, CHECK FURNACE WATER HEATER, ELETRIC SYSTEMS,
FILL LP TANKS,

Labor

Code	Description	Mechanic	Total
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	JP	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	JP	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	JP	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	JP	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	JP	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	JP	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	JP	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	JP	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	JP	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C
LPGI	LP - UNIT SALES	12.00	N/C	N/C

Subtotal for Job #PDINFW: 0.00

Job #1 - Warranty

COMPLAINT: WHILE FILLING THE FRESH WATER TANK, WATER STARTED RUNNING OUT FROM
THE UNDERBELLY.

CAUSE: TEST FOUND STRAINER LEAKING, TURN IN PO

CORRECTION: INSTALL NEW STRAINER AND TEST, PUT BASMENT COMPARTMENT BACK
TOGETHER

Labor

Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	JP	26.00

Parts

Part #	Description	Qty	Price	Total
5830	Pump - Strainer Mi	1.00	3.61	3.61



Customer #: 1000
BASDEN'S AMERICAN RV,

W/O: 64045
Promised Date: 12 JUN 21



Customer #: 1000
BASDEN'S AMERICAN RV,



Other Services

Code	Description	Qty	Price	Total
FRT	UPS-STRAINER	1.00	10.99	10.99

Subtotal for Job #1: 40.60

Job #2 - Warranty

COMPLAINT: THE LP REGULATOR WENT FROM 13 WC TO 6 WC WITH THE WATER HEATER AND THE FURNACE BOTH RUNNING.

CAUSE: RUN LP DROP TEST. AND TEST FURNACE AND WATER HEATER, LP AT OUTSIDE CONTION WANT FROM 13inwc STATIC TO 6inwc WITH FURNACE AND WATER HEATER RUNNING, WILL NOT ADJUST TO 10 inwc FLOWING

CORRECTION: TURN IN PO FOR REGULATOR
REMOVE OLD REGULATOR KIT, AND INSTALL NEW KIT, TEST RUN FURNACE AND WATER HEATER, RUN LP DROP TEST, CLOSE UNIT UP AND PULL OUT TO LOT

Labor

Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	JP	65.00
Z990	MISCELLANEOUS REPAIR	JP	0.00

Parts

Part #	Description	Qty	Price	Total
327043	REGULATOR KIT - MO	1.00	72.20	72.20

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-REG KIT	1.00	14.62	14.62

Subtotal for Job #2: 151.82

Parts Total: 75.81
Labour Total: 91.00
Sublet Total: 0.00
Extras Total: 25.61
WORK ORDER TOTAL: 192.42

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 10 Jun 2021



e- Authorization

6/10/20
01:55:09 p

3- Authorization number PA02842491 Reference no: 64045 Status: Approved Approved by perry Approved date 6/7/2021
rving Name Address VIN Retail sold on

34 Basden's American RV Basden's American RV 4YDF37629M4702526
600 E Baseline Rd
Evansville, IN 47725

du Root e operation of	Description	Sublet	Sub hours	Approved hours	Actual hours	Qty	Base hours	Complaint / Cause / Correction
1	6101206A Fresh Water Tank	0.00	0.40	0.20		1	0.20	Complaint: WHILE FILLING THE FRESH WATER TANK, WATER STARTED RUNNING OUT FROM THE UNDERBELLY. Cause: TEST FOUND STRAINER LEAKING Correction: INSTALL NEW STRAINER AND TEST, PUT RASMENT COMPARTMENT BACK TOGETHER Complaint: THE LP REGULATOR WENT FROM 13 WC TO 6 WC WITH THE WATER HEATER AND THE FURNACE BOTH RUNNING. Cause: RUN LP DROP TEST. AND TEST FURNACE AND WATER HEATER, LP AT OUTSIDE CONTION WANT FROM 13inwc STATIC TO 6inwc WITH FURNACE AND WATER HEATER RUNNING, WILL NOT ADJUST TO 10 inwc FLOWING Correction: TURN IN PO FOR REGULATOR REMOVE OLD REGULATOR KIT, AND INSTALL NEW KIT, TEST RUN FURNACE AND WATER HEATER, RUN LP DROP TEST, CLOSE UNIT UP AND PULL OUT TO LOT
2	6201106B Regulator - Repla	0.00	1.00	0.50		1	0.30	

3- Authorization number PA02842491 0.70

KRV – Labor time approved in accordance with Keystone RV's
flat rate manual.
VCB: Vendor Charge Back item.

r paper claims ~~only~~ use one pre-authorization number per warranty claim for
ple a copy of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim
m. The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the