

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 10073B

Date In:	23 FEB 24	Author:	MGRAY
Promised Date:	04 JUL 25	Stock No:	11083
:	:	Year:	2022
Customer Name:	1000 - GREENEWAY RV SA	Manufacturer:	FOREST RIVER
Address:	8220 STATE HWY 13 SOUT	Brand:	PUMA TT
:	WISCONSIN RAPIDS, WI	Model:	26FKDS
Postal/Zip:	54494	Miles/Hrs:	0
Phone#(res):	800-758-2272	Exterior Color:	:
Phone#(bus):	:	Unit Type:	TT-TRAVEL TRAILER
Cell Phone:	:	License#:	:
Email:	NONE	Tag#:	:
Purchased Date:	01 MAR 25	:	:
Delivery Date:	12 APR 25	:	:
InService Date:	:	:	:
Serial#:	5ZT2PURB4N4016457	:	:

```
*****
Job #   Description      JOB INFORMATION      Type Bill To
*****
DAF     COMPLAINT:  DAF-WARRANTY REPAIRS-  1.PUDDY ON CELING I      PDI      PRE-D
        IN BEDROOM & KITCHEN  2. CABINET ABOVE
        COUCH SEPARATING FROM CEILING
        CAUSE:      Done
        CORRECTION: Done
WARR    COMPLAINT:  WARRANTY REPAIR 1 -many staples      W      1021    FORES
        protruding from walls
        CAUSE:      Mfg
        CORRECTION: Used nail set to set many staples then
        used putty to fill the holes took 20
        minutes I forgot to punch out please
        adjust APPROVED .35 HOURS
WARR    COMPLAINT:  WARRANTY REPAIR 2 -The toilet seat is      W      1021    FORES
        loose
        CAUSE:      Loose bolts
        CORRECTION: Tightened the bolts APPROVED .10 HOURS
WARR    COMPLAINT:  WARRANTY REPAIR 3 -The bedroom slide in      W      1021    FORES
        the rear floor on the outside of it has
        a crack and it looks like maybe possible
        water damage
        CAUSE:      Pics of rear slide floor for replacement
        from water intrusion. Also see that the
        schwin tech system was installed
        improperly. Gears are jumping. Pics
        uploaded. Need replacement system. Slide
        makes popping noise when going in and
        out. Gear rails where installed off ser
        on walls. Slide is also not centered in
```

Continued on page 2

Work Order : 10073B

```

*****
Job #      Description      JOB INFORMATION      Type Bill To
*****
hole of exterior of wall. Crack in
underside of slide floor and when we
brought it in it was soaked there can
clearly see this was not sealed
correctly many open gaps for water to
enter
CORRECTION: Replaced slide floor. Pre-approval
please for full floor replacement
WARR COMPLAINT: WARRANTY REPAIR 4 -The dining/living      W      1021      FORES
room slide out needs to be adjusted very
tight on one side and loose on the other
CAUSE: Slideout adjustment. Slide is over one
way to far in opening. Brackets under
slide are adjusted to max and can't
adjust anymore. Will need to remount
cross member in order to adjust slide
properly. 2 hours for adjustment.
CORRECTION: ...
WARR COMPLAINT: WARRANTY REPAIR 5 -Dining room slides      W      1021      FORES
front slide seal is ripped at the bottom
CAUSE: Sweeper seal torn on front of main
slide.room is to close to one side.
CORRECTION: adjusted slide out in opening by jacking
room up and removing lag bolts in the
cross bar to make more adjustment room.
refastened cross bar,then adjusted the
brackets to move room over away from
front sweeper to prevent furture damage
to seal. gained about a half inch.
installed new sweeper seal.
WARR COMPLAINT: WARRANTY REPAIR 6 - The wall panel in      W      1021      FORES
the hallway has come loose
CAUSE: Panel not secured by mfg
CORRECTION: Cut seam tape then peeled it back
resecured the panel by pin nailing then
pressed tape back into place APPROVED
.10 HOURS
WARR COMPLAINT: WARRANTY REPAIR 8 -The facia of the      W      1021      FORES
slide olds have deep staple holes
exposed tables both slide rooms
CAUSE: Holes in walls trim throughout unit
CORRECTION: Filled many holes with putty APPROVED
.30 HOUR
WARR COMPLAINT: WARRANTY REPAIR 9 -Behind the stove The      W      1021      FORES
backsplash on one edges chipped
CAUSE: Dull blade to cut the backsplash panel
CORRECTION: I used a paint marker to cover the chips
APPROVED .1 HOURS
WARR COMPLAINT: WARRANTY REPAIR 11 -bulb seal off of      W      1021      FORES

```

Continued on page 3

Work Order : 10073B

slide room
 CAUSE: Loose bulb seal
 CORRECTION: Slid back on when slideroom is being
 done screws need to be added to hold
 seals in place no lifts at moment to
 work on any roof or slide repairs
 APPROVED .50 HOURS

WARR COMPLAINT: WARRANTY REPAIR 12 - ods screw trim W 1021 FORES
 insert has shrunk
 CAUSE: Screw trim shrank
 CORRECTION: Removed shrunken molding then installed
 new APPROVED .10 HOURS

WARR COMPLAINT: WARRANTY REPAIR 13 - trim above sofa is W 1021 FORES
 peeling at edge and silicone above
 cabinets is separated
 CAUSE: Peeling edge on trim
 CORRECTION: Removed trim then glued paper back on
 then nailed into place and puttied the
 mail holes APPROVED .10 HOURS

WARR COMPLAINT: WARRANTY REPAIR 19 the shower faucet W 1021 FORES
 leaks at outlet need new faucet
 CAUSE: Leaking shower faucet
 CORRECTION: Removed screws then base and
 disconnected the connections installed
 new faucet while connecting one
 connection came off water line so had to
 install new connector then tested no
 leaking I then reinstalled the faucet
 and base then siliconed around faucet
 base APPROVED .40 HOURS

WARR COMPLAINT: WARRANTY REPAIR 20 bath sink has bad W 1021 FORES
 scratches on the outside edge
 CAUSE: Scratched from mfg
 CORRECTION: Wet sanded then buffed with polush
 APPROVED .20 HOURS

WARR COMPLAINT: WARRANTY REPAIR 21- BEDROOM SLIDE FLOOR W 1021 FORES
 AND SCHWIN TECH SYSTEM NEED TO BE
 REPLACED DUE TO WATER DAMAGE
 CAUSE: Rear bedroom slide floor has water
 damage from improper sealing.
 CORRECTION: Remove slide and install new floor. Also
 needed new slide mechanism. Reinstall
 slide. Tested good.

 Job # Part No Description PARTS Bill to Qty Price Total

 WARR0 711217025754 CLIP ON WIPER W/2"WIPER- W-1021 7 4.54 31.78
 WARR1 098268299373 1/2" FEMALE SWIVEL ELBOW W-1021 1 6.18 6.18
 WARR2 82204914 SCHINTEC 36 X 54 3/8 SS W-1021 1 1,178.01 1,178.01
 WARR2 179841 DARCO WOVEN UNDERBELLY F W-1021 60 1.55 93.00

Continued on page 4

Work Order : 10073B

Job#	Lab Code	Description	LABOUR	Mech	Bill to	Hrs	Rate	Total

DAF	Z991	DAF-WARRANTY REPAIR		HOD	I-PDI	0.10	70.00	7.00
ARR01	Z992	MISC LABOUR CODE (WARR	HOD		W-1021	0.50	115.00	57.50
ARR02	Z992	MISC LABOUR CODE (WARR	HOD		W-1021	0.10	115.00	11.50
ARR03	Z992	MISC LABOUR CODE (WARR	HOD		W-1021	0.50	115.00	57.50
ARR03	Z992	MISC LABOUR CODE (WARR	TD		W-1021	2.61	115.00	300.15
ARR03	Z992	MISC LABOUR CODE (WARR	TD		W-1021	0.17	115.00	19.55
ARR03	Z992	MISC LABOUR CODE (WARR	TD		W-1021	0.22	115.00	25.30
ARR04	Z992	MISC LABOUR CODE (WARR	HOD		W-1021	0.00	115.00	0.00
ARR04	Z992	MISC LABOUR CODE (WARR	HOD		W-1021	0.50	115.00	57.50
ARR04	Z992	MISC LABOUR CODE (WARR	TD		W-1021	0.53	115.00	60.95
ARR04	Z992	MISC LABOUR CODE (WARR	TD		W-1021	0.50	115.00	57.50
ARR04	Z992	MISC LABOUR CODE (WARR	TD		W-1021	0.47	115.00	54.05
ARR05	Z992	MISC LABOUR CODE (WARR	HOD		W-1021	0.02	115.00	2.30
ARR05	Z992	MISC LABOUR CODE (WARR	TD		W-1021	0.00	115.00	0.00
ARR05	Z992	MISC LABOUR CODE (WARR	TD		W-1021	0.86	115.00	98.90
ARR05	Z992	MISC LABOUR CODE (WARR	TD		W-1021	0.12	115.00	13.80
ARR06	Z992	MISC LABOUR CODE (WARR	HOD		W-1021	0.50	115.00	57.50
ARR08	Z992	MISC LABOUR CODE (WARR	HOD		W-1021	0.30	115.00	34.50
ARR09	Z992	MISC LABOUR CODE (WARR	HOD		W-1021	0.10	115.00	11.50
ARR11	Z992	MISC LABOUR CODE (WARR	HOD		W-1021	0.50	115.00	57.50
ARR12	Z992	MISC LABOUR CODE (WARR	HOD		W-1021	0.50	115.00	57.50
ARR13	Z992	MISC LABOUR CODE (WARR	HOD		W-1021	0.50	115.00	57.50
ARR19	Z992	MISC LABOUR CODE (WARR	HOD		W-1021	1.30	115.00	149.50
ARR20	Z992	MISC LABOUR CODE (WARR	HOD		W-1021	0.50	115.00	57.50
ARR21	Z992	MISC LABOUR CODE (WARR	TD		W-1021	2.59	115.00	297.85
ARR21	Z992	MISC LABOUR CODE (WARR	TD		W-1021	1.55	115.00	178.25
ARR21	Z992	MISC LABOUR CODE (WARR	TD		W-1021	1.86	115.00	213.90
ARR21	Z992	MISC LABOUR CODE (WARR	TD		W-1021	3.47	115.00	399.05
ARR21	Z992	MISC LABOUR CODE (WARR	TD		W-1021	1.26	115.00	144.90
ARR21	Z992	MISC LABOUR CODE (WARR	TD		W-1021	0.00	115.00	0.00
ARR21	Z992	MISC LABOUR CODE (WARR	TD		W-1021	0.00	115.00	0.00

Job #	Excode	Description	EXTRAS	bill to	Qty	Price	Total

ARR01	SSE	SHOP SUPPLIES - EXTERNAL		W-1021	1.00	0.00	0.00
ARR21	FRT	FREIGHT FOR SCHWINTEC	JOB	W-1021	1.00	22.22	22.22
ARR21	M	4'X8'X3/4" PLY WOOD		W-1021	1.00	75.00	75.00

BILLINGS SUMMARY							
Type	Bill Id	Parts	Labour	Sublet	Extras	Tax	Total

I	PDI	0.00	7.00	0.00	0.00	0.00	7.00
W	1021	1308.97	2533.45	0.00	97.22	0.00	3,939.64
Totals		1308.97	2540.45	0.00	97.22	0.00	3,946.64

Continued on page 5

Work Order : 10073B

&k2S
&k0S