

GREENEWAY, INC.  
8220 STATE HWY 13 SOUTH  
WISCONSIN RAPIDS WI  
US  
54494  
(715) 325-5170

WORK ORDER # 13131B

|                 |                        |                 |                   |
|-----------------|------------------------|-----------------|-------------------|
| Date In:        | 26 FEB 26              | Author:         | KOTT              |
| Promised Date:  | 10 APR 26              | Stock No:       | 11471             |
| :               | :                      | Year:           | 2026              |
| Customer Name:  | 17939 - KIESOW, NICK   | Manufacturer:   | FOREST RIVER      |
| Address:        | 111 EAST CEDAR ST P.O. | Brand:          | PUMA DESTINATION  |
| :               | : HORTONVILLE, WI      | Model:          | 38DEN             |
| Postal/Zip:     | 54944                  | Miles/Hrs:      | 0                 |
| Phone#(res):    | 920-213-4178           | Exterior Color: | :                 |
| Phone#(bus):    | :                      | Unit Type:      | TT-TRAVEL TRAILER |
| Cell Phone:     | :                      | License#:       | :                 |
| Email:          | NKIESOW4320@GMAIL.COM  | Tag#:           | DB:2/26           |
| Purchased Date: | 01 NOV 25              | :               | :                 |
| Delivery Date:  | 10 APR 26              | :               | :                 |
| InService Date: | :                      | :               | :                 |
| Serial#:        | 4X4TPUP24TP106657      | :               | :                 |

```
*****
Job #   Description                JOB INFORMATION                Type Bill To
*****
2      COMPLAINT:  BATHROOM DOOR ADJUSTMENT-HIT WHEN          W    1021    FORES
        CAUSE:      The bathroom door is cut uneven on the
                   latch side, it is causing the top corner
                   to rub when closing, we will have to
                   order a new bathroom door H: 72 W: 24
        CORRECTION: . REQ: .50
3      COMPLAINT:  LEFT OF OVEN-BOTTOM DRAWER NOT CLOSING    W    1021    FORES
        CAUSE:      The bottom drawer to the left of the
                   oven was closing rough, it seems it was
                   set on the tracks a little crooked, i
                   was able to line it up and now it opens
                   and closes
        CORRECTION: Done REQ .20
4      COMPLAINT:  MOUNT-TV LIVING ROOM                        W    1021    FORES
        CAUSE:      The tv mount had fallen off the wall
                   during transport, i looked into the wall
                   panel and the mounting plate is mounted
                   way to low to mount the tv properly, we
                   will have to remove both windows and all
                   the outlets and will have to cut the
                   wall paneling above the fireplace
                   counter and remove boyh panels to be
                   able to reinforce both sides so the tv
                   is centred on the wall, will take about
                   8 hours
        CORRECTION: . REQ 8 HOURS
```

Continued on page 2

Work Order : 13131B

```

*****
Job #   Description                JOB INFORMATION                Type Bill To
*****
5       COMPLAINT:  WIRE HOLDER UNDER APPLIANCE SLIDE          W    1021    FORES
              ODS-LOOSE-FIX-ALSO PULL PAPER THAT IS
              STUCK
      CAUSE:      The bar holding all the wires for
                  appliences is sagging down to where it
                  isnt allowing the slide to close all the
                  way and wont seal properly above the
                  wheels, i tried to move the braket and
                  tried to rerun the wires more out of the
                  way hit it is still not out of the way
                  of the seal, we will have to order a new
                  bar with brakets or if the manufaturer
                  has a better suggestion
      CORRECTION: we will have to order a new bar with
                  brakets or if the manufaturer has a
                  better suggestion   REQ 2 HOURS

WARR    COMPLAINT:  WARRANTY REPAIR 1 - Both A/C covers have W    1021    FORES
              scratches on the top, looks like it
              brushed against something in transport.
      CAUSE:      Both of the A/C covers have scratches on
                  the top, looks like they scrapped on
                  something during transport we will need
                  two new covers
      CORRECTION: R&R AC SHROUDS X 2   REQ: 1 HOUR OF LABOR
                  (.50 PER)

WARR    COMPLAINT:  WARRANTY REPAIR 2 - The DS fender is        W    1021    FORES
              cracked above the front tire.
      CAUSE:      The fender on the DS has a large crack
                  above the front tire as well as a
                  smaller crack forming in the middle we
                  will have to order a new fender
      CORRECTION: .. REQ 1 HOURS OF LABOR

WARR    COMPLAINT:  WARRANTY REPAIR 3 - The duct covers in      W    1021    FORES
              the kitchen and bedroom are cracked
              around the screw.
      CAUSE:      The duct covers in the bedroom and in
                  the kitchen have a crack around one of
                  the screws, we dont have any of the same
                  covers we will have to order some.
      CORRECTION: NEED TO R&R DUCT COVERS   REQ .75

WARR    COMPLAINT:  WARRANTY REPAIR 4 - The sewer pipe cap      W    1021    FORES
              is missing
      CAUSE:      The sewer pipe cover broke off the
                  tether, i put a new cover and tether
                  from parts.
      CORRECTION: Done REQ .10

WARR    COMPLAINT:  WARRANTY REPAIR 5 -the filter jn the        W    1021    FORES
              coty water comnection is missing.
      CAUSE:      The small filter and rubber seal in the

```

Continued on page 3

Work Order : 13131B

city water connection was missing and  
causing it to leak, i put one in from  
parts

CORRECTION: Done REQ .10

WARR COMPLAINT: WARRANTY REPAIR 6 - the underbelly W 1021 FORES  
material has a cut in it under the ODS  
slide

CAUSE: There is a small cut in the underbelly  
material that had some tape that was  
falling off of it under the ods slide, i  
took the old tape off and put some new  
on

CORRECTION: Done REQ: .20

```
*****
Job # Part No      Description      PARTS      Bill to      Qty      Price      Total
*****
WARR0 810126234070 FLOOR REGISTER 2X10 NO D W-1021      0      13.00      0.00
WARR0 014717201834 3pk 1" HOSE FILTER WASHE W-1021      1      2.87      2.87
WARR0 711217019111 4" X 180' BOTTOM BOARD - W-1021      1      0.36      0.36
*****
```

```
*****
Job# Lab Code Description      LABOUR      Mech Bill to      Hrs      Rate      Total
*****
2 WARR MANUFACTURER WARRANTY EG W-1021      0.50      140.00      70.00
3 WARR MANUFACTURER WARRANTY EG W-1021      0.50      140.00      70.00
4 Z991 MISC CODE (INTERNAL) EG W-1021      0.21      140.00      29.40
4 Z991 MISC CODE (INTERNAL) EG W-1021      0.29      140.00      40.60
4 Z991 MISC CODE (INTERNAL) EG W-1021      0.50      140.00      70.00
5 WARR MANUFACTURER WARRANTY EG W-1021      0.07      140.00      9.80
5 WARR MANUFACTURER WARRANTY EG W-1021      0.43      140.00      60.20
ARR01 Z992 MISC LABOUR CODE (WARR EG W-1021      0.50      140.00      70.00
ARR02 Z992 MISC LABOUR CODE (WARR EG W-1021      0.50      140.00      70.00
ARR03 Z992 MISC LABOUR CODE (WARR EG W-1021      0.50      140.00      70.00
ARR04 Z992 MISC LABOUR CODE (WARR EG W-1021      0.50      140.00      70.00
ARR05 Z992 MISC LABOUR CODE (WARR EG W-1021      0.50      140.00      70.00
ARR06 Z992 MISC LABOUR CODE (WARR EG W-1021      0.50      140.00      70.00
*****
```

```
*****
Job # Excode      Description      EXTRAS      bill to      Qty      Price      Total
*****
ARR01 SSE SHOP SUPPLIES - EXTERNAL W-1021      1.00      0.00      0.00
*****
```

```
*****
BILLINGS SUMMARY
Type Bill Id      Parts      Labour      Sublet      Extras      Tax      Total
*****
W 1021      3.23      770.00      0.00      0.00      0.00      773.23
Totals      3.23      770.00      0.00      0.00      0.00      773.23
*****
```

Continued on page 4

Work Order : 13131B

&k2S  
&k0S