

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 10076B

Date In: 08 FEB 24 Author: MGRAY
Promised Date: 04 JUL 24 Stock No: 11096
: Year: 2023
Customer Name: 17244 - HUFF, DAVID Manufacturer: FOREST RIVER
Address: 1131 90TH ST S Brand: PUMA TT
: WISCONSIN RAPIDS, WI Model: 24FBSC
Postal/Zip: 54494 Miles/Hrs: 0
Phone#(res): 7152133394 Exterior Color:
Phone#(bus): Unit Type: TT-TRAVEL TRAILER
Cell Phone: License#:
Email: LJHDPH2@SOLARUS.NET Tag#: CMR PU'D 4/8
Purchased Date: 04 MAR 24 :
Delivery Date: 12 MAR 24 :
InService Date: :
Serial#: 5ZT2PUNB7P4018079 :

Job #	Description	JOB INFORMATION	Type	Bill To
DAF	COMPLAINT: DAF-WARRANTY REPAIRS- AREA PUTTY MARKS CAUSE: Mfg left excess putty and nails protruding from ceiling CORRECTION: Tapped nails into place and used putty to fill them wiped with Morpheus oil soap	1. CEILING MAIN	W	1021 FORES
WARR	COMPLAINT: WARRANTY REPAIR 1 -both electric jacks are inop CAUSE: The wires in back of both switches connections were loose CORRECTION: Removed switch covers and screws holding switch in found connections loose on both rocker switches pushed connectors in firmly texted works . I then also pushed wires up into the under belly and spray foamed the holes to seal		W	1021 FORES
WARR	COMPLAINT: WARRANTY REPAIR 2 -bath sink is loose the clamps that hold sink into place are laying on the shelf beneath CAUSE: Improper install from mfg CORRECTION: Removed sink completely then used construction adhesive to secure sink to countertop taped until dried		W	1021 FORES
WARR	COMPLAINT: WARRANTY REPAIR 3 -ptrap disconnected completely under bath sink CAUSE: Mfg left ptrap unscrewed CORRECTION: Screwed into place		W	1021 FORES

Continued on page 2

Work Order : 10076B

```

*****
Job #   Description           JOB INFORMATION           Type Bill To
*****
WARR    COMPLAINT:  WARRANTY REPAIR 4 - the slideroom has      W    1021   FORES
        allowed water into unit
        CAUSE:      Missing stop and or no silicone
        CORRECTION: Put a bit of silicone in each track to
        stop from water getting into unit
WARR    COMPLAINT:  WARRANTY REPAIR 5 -exterior of slide has W    1021   FORES
        no sealant. On the schwintek track its
        missing the small blocks on the system
        that stops water from running down track
        and into unit
        CAUSE:      Missing sealant or block
        CORRECTION: Used a bit of sealant at end of tracks
        on slide rooms
WARR    COMPLAINT:  WARRANTY REPAIR 6 -leaks from both water W    1021   FORES
        lines going up to the bath faucet
        CAUSE:      Mfg
        CORRECTION: The one hose had no washers in it ran to
        ace to get new hose other connections
        were really loose
WARR    COMPLAINT:  WARRANTY REPAIR 7 -the refer tab on      W    1021   FORES
        outer compartment is broken after the
        fact of replacing the clip I also found
        that one bottom tab is missing
        CAUSE:      Broken tab from mfg
        CORRECTION: First installed new tab then found the
        refer door was missing a tab at bottom
        so replaced with new from parts
WARR    COMPLAINT:  WARRANTY REPAIR 9 - cabinet door above  W    1021   FORES
        sofa left when looking at sofa the glass
        has a crack in it
        CAUSE:      Replace cabinet door above sofa left
        side. Glass is cracked.
        CORRECTION: Factory sent wrong color door. Removed
        glass from existing door and install new
        glass. Let silicone dry, then install
        door. Door installed.
WARR    COMPLAINT:  WARRANTY REPAIR 10 - the corner beneath  W    1021   FORES
        radio where water got into unit from
        slide rails not being sealed is
        discolored and staple holes look a bit
        swollen
        CAUSE:      Water damage
        CORRECTION: Cleaned area then used paint pen to
        cover the missing paint from batten trim
        put 3 layers on then filled holes with
        putty
WARR    COMPLAINT:  WARRANTY REPAIR 11 -the slide still has  W    1021   FORES
        water coming in found a large unsealed
        area on each side of slideroom

```

Continued on page 3

Work Order : 10076B

CAUSE: The cups that hold / divert water are not sealed so if they get water in them the water comes out of the unsealed gap in both cups leads to water on floor

CORRECTION: Cleaned area then used clear sealant to seal Please remove 20 min off job I did not clock out when I was done originally

WARR COMPLAINT: WARRANTY REPAIR 12 -ADDED TO WO WHEN W 1021 FORES
DROPPED OFF SCUFF IN TOILET SEAT COVER. TRIED CLEANING OFF AND IT IS INDENTED IN THE PLASTIC OF THE SEAT.

CAUSE: Scuff in toilet seat cover. Pics uploaded.

CORRECTION: Removed scuttled toilet seat and install new one.

Job #	Part No	Description	PARTS	Bill to	Qty	Price	Total
WARR0	146885	NOVAFLEX SEALANT DARK SA		W-1021	1	11.22	11.22
WARR0	3109350.065	VENT ASM, SIDE, 24", BLK, TF		W-1021	1	49.26	49.26
WARR0	610848024825	VENT DOOR LATCH REFER.		W-1021	1	4.03	4.03
WARR0	822082441	DOOR, CABINET, CURIO 21"		W-1021	1	18.71	18.71
WARR0	822067847	GLASS, 17-7/16 X 6-7/16		W-1021	1	6.44	6.44
WARR1	822068165	TOILET PART: SEAT & LID		W-1021	1	60.39	60.39
WARR0	711217014901	D SEAL W/PSA TAPE BLACK		W-1021	7	1.50	10.50

Job#	Lab Code	Description	LABOUR	Mech	Bill to	Hrs	Rate	Total
DAF	Z991	DAF-WARRANTY REPAIR		HOD	W-1021	0.10	115.00	11.50
ARR01	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.00	115.00	0.00
ARR01	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.50	115.00	57.50
ARR02	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.00	115.00	0.00
ARR02	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.50	115.00	57.50
ARR03	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.50	115.00	57.50
ARR04	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.50	115.00	57.50
ARR05	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.50	115.00	57.50
ARR06	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.50	115.00	57.50
ARR07	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.50	115.00	57.50
ARR07	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.00	115.00	0.00
ARR09	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.50	115.00	57.50
ARR09	WARR	MANUFACTURER WARRANTY		TD	W-1021	0.00	115.00	0.00
ARR10	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.35	115.00	40.25
ARR10	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.15	115.00	17.25
ARR11	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.00	115.00	0.00
ARR11	Z992	MISC LABOUR CODE (WARR		HOD	W-1021	0.50	115.00	57.50
ARR12	Z992	MISC LABOUR CODE (WARR		TD	W-1021	0.50	115.00	57.50
ARR09	Z992	MISC LABOUR CODE (WARR		TD	W-1021	0.50	115.00	57.50
ARR12	Z992	MISC LABOUR CODE (WARR		TD	W-1021	0.50	115.00	57.50
ARR09	WARR	MANUFACTURER WARRANTY		TD	W-1021	0.40	115.00	46.00
ARR09	Z992	MISC LABOUR CODE (WARR		TD	W-1021	0.00	115.00	0.00

Continued on page 4

Work Order : 10076B

```
*****
Job#  Lab Code  Description  LABOUR  Mech Bill to    Hrs    Rate    Total
*****
ARR09 WARR      MANUFACTURER WARRANTY TD    W-1021    0.10   115.00   11.50
ARR09 WARR      MANUFACTURER WARRANTY TD    W-1021    0.00   115.00    0.00
*****
```

```
*****
Job #  Excode    Description  EXTRAS  bill to    Qty    Price    Total
*****
ARR01  SSE        SHOP SUPPLIES - EXTERNAL W-1021    1.00    0.00    0.00
ARR09  FRT        FREIGHT      W-1021    1.00   19.46   19.46
ARR09  FRT        FREIGHT      W-1021    1.00   19.51   19.51
ARR12  FRT        FREIGHT      W-1021    1.00   20.66   20.66
*****
```

BILLINGS SUMMARY

```
*****
Type Bill Id      Parts    Labour    Sublet    Extras    Tax    Total
*****
W      1021          160.55   816.50    0.00     59.63    0.00   1,036.68
      Totals          160.55   816.50    0.00     59.63    0.00   1,036.68
*****
```

&k2S
&k0S