

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 10111

Date In: 02 FEB 24 Author: TPASSER
Promised Date: 22 MAY 24 Stock No:
: Year: 2022
Customer Name: 15372 - KUDELA, BRIAN Manufacturer: GRAND DESIGN
Address: 340 COUNTY ROAD O Brand: IMAGINE
: HANCOCK, WI Model: 2910BH
Postal/Zip: 54943 Miles/Hrs:
Phone#(res): 608-387-3883 Exterior Color:
Phone#(bus): Unit Type: TT-TRAVEL TRAILER
Cell Phone: License#:
Email: bkakudela@gmail.com Tag#: 4/26 CMR UPDATED - WP
Purchased Date: :
Delivery Date: :
InService Date: :
Serial#: 573TE3423N6641667 :

Job # Description JOB INFORMATION Type Bill To

SC SERVICE CALL TO HANCOCK - 340 COUNTY RD O I SEP POLIC
1 COMPLAINT: INSIDE REAR BUNKHOUSE DOOR POCKET-SCREWS I SEP POLIC
CAME OUT OF TOP TRACK. REPAIRED IH - CMR
PICKED UP UNIT 1/29 AND NOTICED THE
TRACK FELL AGAIN AND NEEDS TO BE REHUNG.
CAUSE: pics taken What I found was the rear
sliding door for bunk room the screw had
pulled from door
CORRECTION: remove upper header disconnected upper
sliding door bracket remove door and
added better screws re attached the door
and tested ok
2 COMPLAINT: 3/5 CUST STATES REAR ENTRY DOOR LOCK IS E 15372 KUDEL
NOT WORKING PROPERLY. ISSUE WITH KEY
GOING INTO CYLINDER AND THEN WILL NOT
LOCK TOP LOCK. PICS WILL BE EMAILED FOR
REPLACEMENT
CAUSE: pics taken rear entry door need a new
lock due to key cylinder falling out and
damaged
CORRECTION: remove the damage rear entry door lock
installed the door lock assembly and
tested both keys the door also latches
and locks as well
3 COMPLAINT: CUSTOMER STATES AWNING IS SEPERATING W 1020 GRAND
FROM UNIT. RECALL LIPPERT 22E-055
CAUSE: leaky awning track on door side of
camper due to no butyl tape behind track

Continued on page 2

Work Order : 10111

```

*****
Job #   Description                JOB INFORMATION                Type Bill To
*****
                                water was getting in through screws pics
                                taken and also found that the awning
                                seam on fabric has separated pics taken
                                of that as well with need new awning
                                fabric and possibly light track and
                                lights
CORRECTION: extended awning out about foot zip tie
                                both awning arms pulled plastic insert
                                and screws remove awning track cleaned
                                the surface apply butyl tape on back
                                side of awning track secured back yo
                                camper used non leveling dicor on gutter
                                edges I also reattach the plastic insert
                                the track is now sealed

```

```

*****
Job # Part No      Description      PARTS      Bill to      Qty      Price      Total
*****
2      711217016691 RV BAUER DOOR LOCK BLACK E-15372      1      56.24      56.24
3      822010148      AWNING FABRIC ONLY 21' B W-1020      1      410.54      410.54

```

```

*****
Job# Lab Code  Description      LABOUR      Mech Bill to      Hrs      Rate      Total
*****
SC SC          SERVICE CHARGE                I-SEP      0.00      70.00      0.00
1 RV31A-21     DOOR CEILING TRACK R&R JS      I-SEP      0.10      70.00      7.00
2 RV30C-6      ENTRY DOOR ADJUST      JS      E-15372      0.30      115.00      34.50
3 Z992         MISC LABOUR CODE (WARR DL      W-1020      1.70      115.00      195.50

```

```

*****
Job # Excode      Description      EXTRAS      bill to      Qty      Price      Total
*****
SC SC          SERVICE CALL                I-SEP      12.00      3.75      45.00
SC SSE         SHOP SUPPLIES - EXTERNAL      I-SEP      1.00      2.59      2.59
3 FRT          FREIGHT                W-1020      1.00      14.34      14.34

```

```

*****
                                BILLINGS SUMMARY
Type Bill Id      Parts      Labour      Sublet      Extras      Tax      Total
*****
E      15372      56.24      34.50      0.00      0.00      5.02      95.76
I      SEP      0.00      7.00      0.00      47.59      0.00      54.59
W      1020      410.54      195.50      0.00      14.34      0.00      620.38

Totals      466.78      237.00      0.00      61.93      5.02      770.73

```

&k2S

Continued on page 3

Work Order : 10111

&k0S