

GREENEWAY, INC.  
8220 STATE HWY 13 SOUTH  
WISCONSIN RAPIDS WI  
US  
54494  
(715) 325-5170

WORK ORDER # 10214C

Date In: 15 APR 24 Author: MGRAY  
Promised Date: 01 MAY 24 Stock No: 10920  
: Year: 2023  
Customer Name: 17268 - GIOMBI, JOSEPH Manufacturer: GRAND DESIGN  
Address: 1808 LINDEN ST Brand: IMAGINE XLS  
: STEVENS POINT, WI Model: 21BHE  
Postal/Zip: 54481 Miles/Hrs: 0  
Phone#(res): 7158834446 Exterior Color:  
Phone#(bus): Unit Type: TT-TRAVEL TRAILER  
Cell Phone: License#:  
Email: GIOMBI1301@GMAIL.COM Tag#: CMR PICKING UP 4/24  
Purchased Date: 22 MAR 24 :  
Delivery Date: 29 MAR 24 :  
InService Date: :  
Serial#: 573TE2527P3434616 :

\*\*\*\*\*  
Job # Description JOB INFORMATION Type Bill To  
\*\*\*\*\*  
1 COMPLAINT: ADDED - 4/15 - CUSTOMER STATES THAT W 1020 GRAND  
THERE IS SEALANT PEELING UP ON THE ROOF-  
CUSTOMER WOULD LIKE TO HAVE LOOKED AT-  
ODs rear corner. Check entire roof  
CAUSE: I don't see any sealant peeling up on  
the corner, but the alpha sealant didn't  
stick to the skylight. We have seen  
this issue a lot. The rest of the roof  
is fine. I cut off as much of the alpha  
sealant that I could, cleaned the area  
really well, and completely re sealed  
around the whole skylight with dicor.  
CORRECTION: Done.  
2 COMPLAINT: ADDED - 4/15 - WHEN OPENING THE OUTSIDE W 1020 GRAND  
DOOR FOR GRILL. THE LAMENATE IN THE DOOR  
IS PUSHING OUT THE PANEL. - TAPED AND  
PICTURE IN ORDER, CMR WONDERING IF IT IS  
NORMAL OR MOISTURE GETTING IN THERE.  
CAUSE: The paneling is coming off the aluminum  
framework. I put some construction  
adhesive in between the paneling and  
frame and clamped it down.  
CORRECTION: Done.  
3 COMPLAINT: ADDED - 4/15 - FRONT COMPARTMENT DOOR ON W 1020 GRAND  
THE FRONT ARE NOT LOCKING PROPERLY. DOES  
NOT LOCK AT ALL.  
CAUSE: The Ods compartment door frame was bent,  
so I straightened it out. The ds

Continued on page 2

Work Order : 10214C

```

*****
Job #   Description                JOB INFORMATION                Type Bill To
*****
                compartment door has cracks around all
                three locks, so it needs a complete
                replacement. H=21 1/2 x W=25 1/2.
CORRECTION: NEEDS NEW COMPARTMENT DOOR FOR
                REPLACEMENT.
4      COMPLAINT: Some tape under unit hanging down. Can   W    1020   GRAND
                it be cut off or does it need to be
                resealed - TAPPED BOTH NOTICED PIECES
CAUSE:      I cut off the piece under the entry
                steps and put a new piece of tape on. I
                just cut off the piece by the tire.
CORRECTION: Done.
    
```

```

*****
Job # Part No      Description          PARTS      Bill to   Qty      Price      Total
*****
4      711217019111  4" X 180' BOTTOM BOARD - W-1020      2        0.31      0.62
3      822060673      DOOR BAGGAGE DRLUG07 24  W-1020      0        111.83    0.00
    
```

```

*****
Job# Lab Code Description      LABOUR      Mech Bill to      Hrs      Rate      Total
*****
1 WARR      MANUFACTURER WARRANTY  JGK  W-1020      0.50    115.00    57.50
2 Z992      MISC LABOUR CODE (WARR JGK  W-1020      0.50    115.00    57.50
3 Z992      MISC LABOUR CODE (WARR JGK  W-1020      0.40    115.00    46.00
4 Z992      MISC LABOUR CODE (WARR JGK  W-1020      0.20    115.00    23.00
3 Z992      MISC LABOUR CODE (WARR      W-1020      0.00    115.00     0.00
    
```

```

*****
Job # Excode      Description      EXTRAS      bill to   Qty      Price      Total
*****
4 SSE      SHOP SUPPLIES - EXTERNAL  W-1020      1.00      0.00      0.00
    
```

```

*****
                                BILLINGS SUMMARY
Type Bill Id      Parts      Labour      Sublet      Extras      Tax      Total
*****
W      1020      0.62      184.00      0.00      0.00      0.00      184.62
                Totals      0.62      184.00      0.00      0.00      0.00      184.62
    
```

&k2S  
&k0S