

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 10218

Date In:	25 MAR 24	Author:	KOTT
Promised Date:	25 DEC 24	Stock No:	10908
:	:	Year:	2023
Customer Name:	16458 - MULVANEY, MICH	Manufacturer:	GRAND DESIGN
Address:	1426 RAINDANCE TRAIL,	Brand:	REFLECTION FW
:	NEKOOSA, WI	Model:	337RLS
Postal/Zip:	54457	Miles/Hrs:	:
Phone#(res):	414-333-0850	Exterior Color:	:
Phone#(bus):	:	Unit Type:	FW-FIFTH WHEEL
Cell Phone:	:	License#:	:
Email:	KATHLEEN.MULVANEY@OUTL	Tag#:	:
Purchased Date:	29 JUL 23	:	:
Delivery Date:	05 AUG 23	:	:
InService Date:	:	:	:
Serial#:	573FR3724P9924075	:	:

```
*****
Job #   Description          JOB INFORMATION          Type Bill To
*****
WARR    COMPLAINT:  GD CAES # 633106 CUSTOMER STATES THAT      W    1020    GRAND
          THE BLACK WATER TANK IS LEAKING-
          CUSTOMER STATES THAT THEY DUMPED THE
          TANK AND THEN HOOKED UP UNIT AND THERE
          IS A BUNCH OF BLACK WATER COMING OUT OF
          THE UNIT - CMR TRIED TO HAVE LOOKED AT,
          IN OTHER DEALERSHIP IN AZ AND THEY HAD
          HIM WAIT 5 HRS TO TELL HIM IT COULDN'T
          BE FIXED THAT DAY. - GD STATES THAT THE
          MEMBRANE UNDER CAMPER MAY NEED
          REPLACEMENT AND NEED SANATIZE.
          CAUSE:      NPF. I started filling the tank, and a
          section of the underbelly looked like it
          was about ready to fall down, so I took
          out a couple screws and looked inside
          while the tank was filling and nothing
          leaked. I let the tank sit full for four
          days and still no leaks. I took the unit
          out and dumped it.
          CORRECTION: Done.
WARR    COMPLAINT:  CUSTOMER STATES THE FRONT GRAY WATER FOR W    1020    GRAND
          THE KITCHEN SINK DUMP PULL HANDLE DOES
          NOT FEEL LIKE IT IS CONNECTED- CUSTOMER
          SAYS IT FEELS LIKE THE LEVER DOES NOT
          OPEN OR PULL-
          CAUSE:      The gate valve broke into multiple
          pieces. At first glance, I thought their
          wasn't even a gate valve connected. I
*****
```

Continued on page 2

Work Order : 10218

Job #	Description	JOB INFORMATION	Type	Bill To
-------	-------------	-----------------	------	---------

cut an access panel in the underbelly, and I can see that there is still a gate valve in place, but it's in multiple pieces. I have never seen a gate valve grenade like this. I opened up the wall in the front storage, disconnected the gate valve cable and I can see that it's zip tied to other wires and secured to the floor in multiple spots. I cut the zip ties and pulled the cable out. I took the nuts off of the gate valve and when the manufacturer installed the gate valve they positioned the bolt heads towards the reducer on the tank so the top two bolts won't slide out to remove the gate valve. I got a small grinder and cut both of the bolts. I put my foot on the gray tank, grabbed the drain and yanked on it until the gate valve fell out. I ran and secured the cable, put a ratchet strap around the drain, ran the other end to the frame and separated the two pipes enough to where I can get the new gate valve in. I secured the valve, turned the water on and filled the tank to full to check the valve for leaks. I waited a few minutes after the tank was full and no leaks appeared. I secured some of the wires in the underbelly so they were out of my way, I cut a piece of plywood into three strips and placed them in the underbelly along the edges of the access panel I cut. I secured the underbelly with screws and washers and filled any gaps with black silicone. The underbelly has some sag in it so I removed the screws from the steps to the front corner, braced up the center and ran new/more screws in to secure it.

CORRECTION: Done.

WARR	COMPLAINT:	WARRANTY REPAIR 3 - CUSTOMER STATES THAT W	1020	GRAND
		THE KITCHEN ISLAND SEEMS LIKE IT IS		
		WOBBLY- CUSTOMER STATES THAT WHEN YOU		
		WALK BY IT THE COUNTER ALMOST "RATTLES"-		
		OR "ROCKS BACK AND FORTH"		

	CAUSE:	The island has a little wobble if you grab and move it. Otherwise, it's secured. I would have to completely rip
--	--------	---

Continued on page 3

Work Order : 10218

apart the interior of the island to add screws and it could still have a slight wobble. It's up to the manufacturer if they want me to try it. The manufacturer approved the repair, so I took the cabinet doors off and pulled the drawers out. I removed the box that hid the plumbing and started popping the staples on the divider panel. There are a lot of staples in the paneling, and that caused the paneling to rip on the bottom. After I got that panel loose, I removed the paneling on the left side and started on the bottom panel. I got the bottom panel out, and I added eight screws to the base, and just like I said, it still wobbles. It's a rectangle box made out of thin paneling that is only secured on the bottom, one section of it can't be secured because of the furnace ducts underneath it and another corner is open for the plumbing so it WILL wobble. I pulled all the staples that were in the paneling, and since the one piece of paneling was damaged, I notched the other side of it and flipped the panel around so the damaged section is at the top and won't be seen. I stapled the rest of the paneling in, and I had to screw one piece down. We don't have a matching color putty so I used black putty to cover the staple holes.

CORRECTION: Done

WARR COMPLAINT: WARRANTY REPAIR 4 - CUSTOMER STATES THAT W 1020 GRAND
THE UNDER COUNTER TOP LIGHT ON THE BACK
END OF THE COUNTER DOES NOT ALWAYS GO ON
LIKE IT IS SUPPOSED TO- OPPOSITE THE
REFER

CAUSE: Their are two light strips, and one is very dim. One will need to be replaced.

I started removing the faulty light, and the majority of the 3m tape was sticking to the countertop. I had to fillet the rest of the light off and remove as much of the old 3m tape as possible so the new strip will have the best chance at staying attached. The wires on the light are not long enough to reach through to the connections on the inside of the island, so I extended the wires and used heat shrink to hide the connections. When I hooked the light

Continued on page 4

Work Order : 10218

up, the new strip is considerably brighter than the old one. We had the customer come in to see what he wanted, and he gave us the go-ahead to replace both strip lights. Trying to get the old lights off of the back side of the counter was difficult because there may be an inch of clearance between the countertop and side of the island. After I got the majority of the 3m tape removed, I used an adhesion promoter on the edge of the countertop and started going around the island with the new lights. When I got to the back side, I had to use a putty stick to shove the strip up and stick it on. I tested the lights and put the panel back in that hides the wires and re attached the box that hides the plumbing.

CORRECTION: Done.

WARR	COMPLAINT:	WARRANTY REPAIR 5 - CUSTOMER STATES THAT W	1020	GRAND
		THE CD/DVD PLAYER DOES NOT WORK- CUSTOMER STATES THAT IT IS NOT CONNECTED- CUSTOMER STATES THAT IT POPS UP ON THE TV BUT DOES NOTHING ELSE-		
	CAUSE:	NPF These model radios don't play video. They only play audio		

CORRECTION: Done.

WARR	COMPLAINT:	WARRANTY REPAIR 6 - CUSTOMER STATE THAT W	1020	GRAND
		THE TV DOES NOT PICK UP CHANNELS- CUSTOMER WILL DO THE CHANNEL SCAN BUT WILL POP UP STATING THAT THERE IS NOT CONNECTABLE CHANNELS- CUSTOMER WAS ABLE TO PREVIOUSLY CONNECT TO CHANNELS-		
	CAUSE:	NPF I pulled the unit outside, and it picked up 7 channels.		

CORRECTION: Done.

WARR	COMPLAINT:	WARRANTY REPAIR 7 - CUSTOMER STATES THAT W	1020	GRAND
		THE REFRIGERATOR DOES NOT LOOK LEVEL- CUSTOMER STATES THAT THE TOP OF THE REFER IS ALMOST LEANING BACKWARDS AND IS OPERATING NOISY-		
	CAUSE:	The hole the fridge sits in is about an inch out of square and it sits on wheels so their is no adjustments. The fridge is still operating fine, and the noise the customer hears is the compressor under normal operation. We have to see what warranty says.		

CORRECTION: ... PER WARRANTY- REFER IS WITHIN SPEC.
NO CORRECTION

WARR	COMPLAINT:	WARRANTY REPAIR 8 - CUSTOMER STATES THAT W	1020	GRAND
------	------------	--	------	-------

Continued on page 5

Work Order : 10218

		THE WINDOW IN THE REAR OF THE UNIT- WHEN TRYING TO OPEN MAKES A VERY LOUD SCREECHY NOISE-			
	CAUSE:	The frames are metal rubbing on metal so they have to be lubed once in a while. I lubed the frame.			
	CORRECTION:	Done.			
WARR	COMPLAINT:	WARRANTY REPAIR 9 - THE FRONT RIGHT JACK WILL NOT LEVEL- CUSTOMER STATES WHEN TRYING TO AUTO LEVEL THAT LEG IT THROWS AN ERROR-	1020	GRAND	
	CAUSE:	Im not sure what caused the code to appear. I ran all the jacks down six inches and auto retracted them. I auto leveled the unit, and the code went away. I retracted the rear jacks and ran the front jacks up and down to test it further, and the code never appeared again.			
	CORRECTION:	Done.			
WARR	COMPLAINT:	WARRANTY REPAIR 10 - CUSTOMER STATES THAT THE BACK REST CUSHION FOR THE KITCHEN TABLE HAS A SCREW LOOSE- CUSTOMER STATES THAT IT SCRATCHED THE WALL-	W 1020	GRAND	
	CAUSE:	The screw pulled out of the bracket that holds the cushion to the wall. I stuffed the screw hole with wood to give the screw something to bite into and touched up the scratch with putty.			
	CORRECTION:	Done.			
11	COMPLAINT:	CUSTOMER STATES THE DOOR SHADE DOES NOT STAY UP-	W 1020	GRAND	
	CAUSE:	1005 COMPONENT FAILURE. I took the shade out, and I noticed the bottom plastic piece is pretty severely bent. I tried adding some tension to the strings and when I put the shade back in the bent piece won't stay in place. I went and got a new shade and when I went to take the existing window out I can not get the inner collar off. I looked it up online and I guess the only way the window will come out without damaging the door is with a set of LCI window keys which we do not have. So I just took the shade out of the new window and put it in the old window. LCI will have to send another shade to complete the kit.			
	CORRECTION:	...			
12	COMPLAINT:	CUSTOMER STATES THAT THE WOOD TRIM ABOVE	W 1020	GRAND	

Continued on page 6

Work Order : 10218

		THE RECLINER POPS UP AND NEEDS TO BE REATTACHED-			
	CAUSE:	The nails pulled through. Nailed the baton strip backbon and puttied the holes.			
	CORRECTION:	Done.			
13	COMPLAINT:	CUSTOMER STATES THAT THE WOOD TRIM BELOW W	1020	GRAND	
		THE FIRE EXTINGUISHER NEEDS TO BE REATTACHED- PIECE OF TRIM IS IN THE TOP DRAWER DIRECTLY AFTER THE STEPS-			
	CAUSE:	The nails pulled through. Nailed it back on and puttied the holes.			
	CORRECTION:	Done.			
1	COMPLAINT:	CUSTOMER STATES THAT THE TOILET SEEMS W	1020	GRAND	
		LOOSE- WHEN YOU SIT ON THE TOILET IT SEEMS LIKE IT ROCKS BACK AND FORTH FROM SIDE TO SIDE-			
	CAUSE:	The nuts were a little loose. I tightened them down.			
	CORRECTION:	Done.			
3	COMPLAINT:	CUSTOMER STATES THAT THERE IS WATER IN W	1020	GRAND	
		THE REAR LIGHT ON THE ODS- RED REAR LIGHT-			
	CAUSE:	Water leaked into the light. I replaced the light.			
	CORRECTION:	Done.			
WARR	COMPLAINT:	Transferred to GRV*10218B on 08 AUG 24 W	1020	GRAND	
		Estimate amount was 0.00 SAFETY RECALL 23V-455 CURT AXLE GREASE ZERK. PER MFG. ** NEED PIC OF AXLE TAG**			
	CAUSE:	Checked, and everything looks good. When I pulled the first cap off the dust cap was laying inside the hub cap. I took the tire off, inspected the zerk, put the cap back on, put the tire on and torqued it down.			
	CORRECTION:	Done.			
4	COMPLAINT:	Transferred to GRV*10218B on 08 AUG 24 W	1020	GRAND	
		Estimate amount was 0.00 CUSTOMER STATES THAT THE DS AND ODS PROPANE COMPARTMENT DOORS SEEM LOOSE- CUSTOMER STATES THAT THEY COME OPEN IN TRAVEL-			
	CAUSE:	The bottom latch on the ds and the top latch on the ods are to short. I got longer ones and I had to change the shape of them a little bit to get the doors to latch properly.			
	CORRECTION:	Done.			
WARR	COMPLAINT:	CUSTOMER WAS IN CONTACT WITH JANET AT W	1020	GRAND	
		GD. GD IS WANTING PICTURES OF THE UNDERBELLY AND SCREWS HOLDING IT UP. UNDERBELLY WAS DAMAGED FROM LEAKING			

Continued on page 7

Work Order : 10218

BLACKTANK. CASE # 633106
 CAUSE: 1001 CUSTOMER REQUESTED. I started at the front on the ds and started working my way back, removing all the screws in the frame. I had to cut the underbelly for the brake wires to fit through, and when I got to the back, I removed the spare tire, black tank hose holder, and the rear bottom screw track. I started on the rear ods, working my way to the front, and I had to cut the underbelly to fit around all the plumbing drains. I dropped the underbelly completely and drug it out. There are a lot of wires hanging down, so I zip tied them all up out of our way. I rolled out the new underbelly material, cut it to length, and this material is wider, so I cut 6 1/2 inches off. I got Nate to help me, and we slid the new underbelly under the unit, put a piece of plywood on a floor jack, and jacked up the front end of the underbelly. We started at the front and worked our way back, lining up and securing the underbelly. We cut the material around the drains and leaf springs. We had to add four of our own braces in the underbelly to give us something to secure to so there isn't any sag. After the underbelly was in place, we put the spare tire and black tank hose holder back in place and filled every gap we could find with expanding foam. When I went to remove the underbelly, I noticed one of the drain valves for the low point drains is broken, so I replaced it.

CORRECTION: Done.

5 COMPLAINT: Transferred to GRV*10218B on 08 AUG 24 W 1020 GRAND
 Estimate amount was 0.00 CUSTOMER STATES THAT THE DINETTE TABLE IS LOOSE-

CAUSE: The table base is loose. I took the four screws out, flipped the table over and tightened down the nut that's on the bottom. I put the four screws back in and there was still a slight wobble so I added a few nails to the post.

CORRECTION: Done.

6 COMPLAINT: Transferred to GRV*10218B on 08 AUG 24 E 16458 MULVA
 Estimate amount was 0.00 CUSTOMER REQUESTS HAVING PROPANE FILLED

CAUSE: CUSTOMER REQUEST

Continued on page 8

Work Order : 10218

CORRECTION: FILLED- 55LBS

7 COMPLAINT: Transferred to GRV*10218B on 08 AUG 24 W 1020 GRAND
 Estimate amount was 0.00 CUSTOMER STATES
 THAT THE MARKER LIGHT ON THE ODS OF THE
 FRONT CAP IS BURNT OUT AND NEEDS TO BE
 REPLACED- POSSIBLE BAD GROUND

CAUSE: A combination of the manufacturer over
 tightening the screws causing the case
 to crack and they're strands of wiring
 sticking out around the wire connector
 that are touching the aluminum frame. I
 cut the silicone, removed the screws and
 the light fell apart. As I was trying to
 get the wire connectors out, I saw a
 couple of sparks, and after I got the
 connectors out, I saw strands of a wire
 hanging out. We don't have the light, so
 I had to get one ordered. I installed
 and tested the new light.

CORRECTION: Done.

8 COMPLAINT: Transferred to GRV*10218B on 08 AUG 24 W 1020 GRAND
 Estimate amount was 0.00 CUSTOMER STATES
 THAT THE AUTO LEVEL KEEPS THROWING A
 CODE THAT TELLS HIM TO OPERATE MANUALLY-
 SAME CODE THAT IT WAS SAYING PREVIOUSLY-
 SAME CODE THAT WAS PREVIOUSLY-

CAUSE: Faulty controller. I turned the system
 on, and it had a code for the front
 right jack. I extended all the legs six
 inches and retracted them all. I ran the
 front jacks up and down and I noticed
 the the front ds jack is always lagging
 behind. I extended and retracted them
 all four times and the jack would always
 lag. I checked to make sure that the leg
 is getting proper voltage and it is. I
 went to switch the plugs on the
 controller for the front jacks to verify
 if it's a leg or controller issue and
 the plug that's attached to the board
 isn't attached all the way. The solder
 welds broke so I replaced the board. I
 re calibrated the auto level system and
 auto leveled and retracted the system
 several times to test it with no issues.

CORRECTION: Done.

9 COMPLAINT: PLEASE PUTTY THE BRAD NAILS ON THE I PCIH POLIC
 BOTTOM OF THE DINETTE TABLE-

CAUSE: 1001 CUSTOMER REQUESTED Puttied the
 holes. .1 to complete

CORRECTION: Done.

WAR1 COMPLAINT: SAFETY RECALL 23V-455 CURT AXLE GREASE W 1020 GRAND

Continued on page 9

Work Order : 10218

CAUSE: ZERK. ***NEED PIC OF AXLE TAG**
 CHECKED AND EVERYTHING LOOKS GOOD WHEN I
 PULLED THE FIRST CAP OFF THE DUST CAP
 WAS LAYING INSIDE THE HUB CAP. TOOK TIRE
 OFF INSPECTED THE ZERK PUT THE CAP BACK
 ON PUT TIRE ON AND TORQUED IT DOWN

CORRECTION: DONE

10 COMPLAINT: REQUESTS PROPANE FILLED E 16458 MULVA
 CAUSE: CUST REQUEST
 CORRECTION: FILLED 55LBS

```
*****
Job # Part No      Description      PARTS      Bill to      Qty      Price      Total
*****
WARR0 040472103656 11/2HX11/2S TERM VLV W/7 W-1020      1      98.48      98.48
WARR0 8220122020     Vbakor RV Awning Led Lig W-1020      1      33.79      33.79
11     711217025495 THIN SHADE COMPLETE UNIT W-1020      1     106.57     106.57
WARR1 822020074       AXLE GREASE ZERK STANDAR W-1020      0       1.18       0.00
4      822060727      DOOR BAGGAGE BD CAM FING W-1020      0       2.50       0.00
7      822020997      LIGHT LED AMBER MARKER S W-1020      0       6.01       0.00
8      82203280       LCI 4 PT.ONE CONTROL JAC W-1020      0     583.62       0.00
WARR1 51705219      UNDERBELLY CORROGATED 78 W-1020     182       2.41     438.62
WARR1 662545087610 STOP VALVE Q-PEX 1/2      W-1020      1       8.88       8.88
WAR11 822020074       AXLE GREASE ZERK STANDAR W-1020      2       1.18       2.36
*****
```

```
*****
Job#  Lab Code  Description      LABOUR      Mech Bill to      Hrs      Rate      Total
*****
ARR01 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.50     115.00     57.50
ARR01 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.33     115.00     37.95
ARR01 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.17     115.00     19.55
ARR01 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.50     115.00     57.50
ARR02 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.05     115.00      5.75
ARR02 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.00     115.00      0.00
ARR02 Z992      MISC LABOUR CODE (WARR JGK W-1020      2.40     115.00    276.00
ARR02 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.00     115.00      0.00
ARR02 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.05     115.00      5.75
ARR03 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.30     115.00     34.50
ARR03 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.00     115.00      0.00
ARR03 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.00     115.00      0.00
ARR03 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.00     115.00      0.00
ARR03 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.00     115.00      0.00
ARR03 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.00     115.00      0.00
ARR04 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.20     115.00     23.00
ARR04 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.00     115.00      0.00
ARR04 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.00     115.00      0.00
ARR05 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.00     115.00      0.00
ARR06 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.00     115.00      0.00
ARR07 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.00     115.00      0.00
ARR08 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.20     115.00     23.00
ARR09 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.29     115.00     33.35
ARR09 Z992      MISC LABOUR CODE (WARR JGK W-1020      0.21     115.00     24.15
*****
```

Continued on page 10

Work Order : 10218

Job#	Lab Code	Description	LABOUR	Mech	Bill to	Hrs	Rate	Total	

ARR10	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.50	115.00	57.50		
11	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.00	115.00	0.00		
11	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.30	115.00	34.50		
12	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.20	115.00	23.00		
13	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.20	115.00	23.00		
1	WARR	MANUFACTURER WARRANTY	JGK	W-1020	0.20	115.00	23.00		
3	WARR	MANUFACTURER WARRANTY	JGK	W-1020	1.00	115.00	115.00		
ARR11	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.00	115.00	0.00		
ARR11	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.00	115.00	0.00		
4	WARR	MANUFACTURER WARRANTY	JGK	W-1020	0.00	115.00	0.00		
4	WARR	MANUFACTURER WARRANTY	JGK	W-1020	0.00	115.00	0.00		
ARR12	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.00	115.00	0.00		
ARR12	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.00	115.00	0.00		
ARR12	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.00	115.00	0.00		
ARR12	WARR	MANUFACTURER WARRANTY	NOK	W-1020	0.00	115.00	0.00		
5	WARR	MANUFACTURER WARRANTY	JGK	W-1020	0.00	115.00	0.00		
7	WARR	MANUFACTURER WARRANTY	JGK	W-1020	0.00	115.00	0.00		
7	WARR	MANUFACTURER WARRANTY	JGK	W-1020	0.00	115.00	0.00		
7	WARR	MANUFACTURER WARRANTY	JGK	W-1020	0.00	115.00	0.00		
8	Z990	MISC LABOUR CODE (EXTE	JGK	W-1020	0.00	115.00	0.00		
8	Z990	MISC LABOUR CODE (EXTE	JGK	W-1020	0.00	115.00	0.00		
8	Z990	MISC LABOUR CODE (EXTE	JGK	W-1020	0.00	115.00	0.00		
9	Z991	MISC CODE (NTERNAL)	JGK	I-PCIH	0.50	70.00	35.00		
9	Z991	MISC CODE (NTERNAL)	JGK	I-PCIH	0.00	70.00	0.00		
ARR12	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.00	115.00	0.00		
ARR12	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.00	115.00	0.00		
ARR12	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.00	115.00	0.00		
ARR12	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.00	115.00	0.00		
ARR12	WARR	MANUFACTURER WARRANTY	NOK	W-1020	4.00	115.00	460.00		
ARR12	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.00	115.00	0.00		
ARR12	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.00	115.00	0.00		
WAR11	Z992	MISC LABOUR CODE (WARR	JGK	W-1020	0.70	115.00	80.50		

Job #	Excode	Description	EXTRAS	bill to	Qty	Price	Total

11	SSE	SHOP SUPPLIES - EXTERNAL		W-1020	1.00	0.00	0.00
6	LP	PROPANE		E-16458	0.00	1.41	0.00
7	FRT	FREIGHT		W-1020	0.00	12.48	0.00
10	LP	PROPANE		E-16458	55.00	1.41	77.55

BILLINGS SUMMARY							
Type	Bill Id	Parts	Labour	Sublet	Extras	Tax	Total

E	16458	0.00	0.00	0.00	77.55	4.27	81.82
I	PCIH	0.00	35.00	0.00	0.00	0.00	35.00
W	1020	688.70	1414.50	0.00	0.00	0.00	2,103.20

Continued on page 11

Work Order : 10218

BILLINGS SUMMARY

Type Bill Id	Parts	Labour	Sublet	Extras	Tax	Total

Totals	688.70	1449.50	0.00	77.55	4.27	2,220.02

&k2S
&k0S