



8220 State Hwy 13 South
Wisconsin Rapids, WI 54494

[spreading the joy of the camping lifestyle]

(715) 325-5170
mail@greenewayrv.com
www.greenewayrv.com

W/O: 10842
Promised Date:
25 DEC 24

WO #: 10842

Customer Name: 1000 - GREENEWAY RV
SALES & SERVICE

Address: 8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS, WI

Postal/Zip: 54494

Phone#(res): 800-758-2272

Phone#(bus):

Cell Phone:

Email: NONE

Date In: 19 JUL 24

Promised Date: 25 DEC 24

Purchased Date: 27 JUL 24

Delivery Date: 25 DEC 24

InService Date:

Serial#: 4X4TPU820SP103171

Author: KOTT

Stock No: 11201

Year: 2025

Manufacturer: FOREST RIVER

Brand: PUMA DESTINATION

Model: 429LFT

Miles/Hrs: 0

Exterior Color:

Unit Type: TT-TRAVEL TRAILER

License#:

Tag#:

Job #NTTS - Internal

NEW TRAVEL TRAILER STOCK /sold PREP

Labor

Job #	Description	Total
NTTS	NEW STOCK PREP	N/C

Subtotal for Job #NTTS: 0.00

Job #CEN - Internal

CLEAN EXTERIOR- NEW

Labor

Job #	Description	Total
CEN	CLEAN EXTERIOR	N/C

Parts

Part #	Description	Qty	Price	Total
014717396042	HTS STANDARD 10' SEWER HOSE	1.00	N/C	N/C
019079236326	TOILET TISSUE, SGL. 2 PLY	1.00	N/C	N/C
019079900142	PARK ADAPTER BULK 30-15	1.00	N/C	N/C
093344312410	ADAPTER 30 AMP MALE TO 50 AMP FEMALE	1.00	N/C	N/C

Subtotal for Job #CEN: 0.00

Job #ISR01 - Warranty

COMPLAINT: INTERNAL STOCK REPAIR 01 - Dror damaged in Bedroom, slide crushed it.

CAUSE: Slide crushed droor, found when starting prep. At some point between delivery and today, someone closed the slide on the droor that is damaged in bedroom. The check in sheet states no obvious signs of damage were found.

CORRECTION: Rebuilt droor, disassembled and cut new sides. Routed indents for base. Reassembled. Replaced slide hardware. Works ok.

Labor

Job #	Description	Total
ISR01	MISC LABOUR CODE (INTERNAL)	172.50

Customer #: 1000
GREENEWAY RV SALES &
SERVICE





Other Services

Code	Description	Qty	Price	Total
SSE	SHOP SUPPLIES - EXTERNAL	1.00	0.00	0.00
M	MISCELLANEOUS SET OF GLIDES	1.00	12.00	12.00

Subtotal for Job #ISR01: 184.50

Job #WARR01 - Warranty

COMPLAINT: WARRANTY REPAIR 1 - Gas Leak, Manometer test failed twice

CAUSE: Manometer test dropped 1.5psi over 3 minutes and 2psi over 5 minutes. Very slow gas leak. Found very small bubbles with soap test at furnace fitting.

CORRECTION: Tightened furnace fitting and retested gas leak with nanometer. Tested ok. No more leaking.

Labor

Job #	Description	Total
WARR01	MISC LABOUR CODE (WARRANTY)	115.00

Subtotal for Job #WARR01: 115.00

Job #WARR02 - Warranty

COMPLAINT: WARRANTY REPAIR 2 - wall panel seam in bedroom coming apart

CAUSE: Defective construction 1.5h to repair. Order 1" seam tape.

CORRECTION: Pull 4'length of seam tape off, clean residue from tape.

Reattach wall panels pulling off frame. Pound in staples, add a couple more. Reapply seam tape.

Labor

Job #	Description	Total
WARR02	MISC LABOUR CODE (WARRANTY)	57.50

Subtotal for Job #WARR02: 57.50

Job #WARR03 - External

COMPLAINT: WARRANTY REPAIR 3 - Black markings all over kitchen floor area.

CORRECTION: WILL ADVISE AT A LATER DATE ONCE CLEANERS ARE ABLE TO ATTEMPT TO REMOVE MARKS

Labor

Job #	Description	Total
WARR03	MISC LABOUR CODE (WARRANTY)	N/C

Subtotal for Job #WARR03: 0.00

Job #WARR04 - Warranty

COMPLAINT: WARRANTY REPAIR 4 - Bunk wall bracket loose

CAUSE: Screws pulled loose for bunk bracket. (10min fix)

CORRECTION: Used slightly longer screws to hold bracket in place. Screws were only 1" protrusion into the wall

Labor

Job #	Description	Total
WARR04	MISC LABOUR CODE (WARRANTY)	57.50



Subtotal for Job #WARR04: 57.50

Job #WARR05 - Warranty

COMPLAINT: WARRANTY REPAIR 5 - Trim in bunkhouse laying on floor

CAUSE: Nails were too far in, nothing to hold trim in place (15min fix)

CORRECTION: Pin nailed to secure

Labor

Job #	Description	Total
WARR05	MISC LABOUR CODE (WARRANTY)	46.00

Subtotal for Job #WARR05: 46.00

Job #1 - Warranty

COMPLAINT: THE FURNACE IS NOT OPERATING CORRECTLY-

CAUSE: Furnace not receiving full power from power source. Voltage meter showing 10.4v
Furnace only working intermittently.

Tested using a 12.7v battery, furnace working fine on dedicated power source.

New power lead needs to be run from distributor box in rear bathroom, to front bedroom where furnace is located. Around 40'

A considerable undertaking involving dropping underbelly.
(4 hours to fix)

Drop underbelly, feed new power wire, test, rescue underbelly.

CORRECTION: REQUEST 4 HOURS OF LABOR AND 40 FEET OF 8G WIRE.

Labor

Job #	Description	Total
1	MANUFACTURER WARRANTY REPAIR	504.85

Subtotal for Job #1: 504.85

Parts Total: 0.00

Labour Total: 953.35

Sublet Total: 0.00

Extras Total: 12.00

WORK ORDER TOTAL: 965.35

CUSTOMERS CLEAR RECEIPT

The above described property has been received, and after having examined the work done, the material furnished, both the work and material has been found to be satisfactory.
I agree that any goodwill repairs are in no way an admission that the vehicle suffers from any defect or issue, or that the repair should be covered under warranty.

Customer Signature : _____

Date: 07 Aug 2024

W/O: 10842
Promised Date: 25 DEC 24



Customer #: 1000
GREENEWAY RV SALES &
SERVICE,

