

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 11078

Date In:	29 AUG 24	Author:	KOTT
Promised Date:	04 JUL 25	Stock No:	10604
:	:	Year:	2023
Customer Name:	1000 - GREENEWAY RV SA	Manufacturer:	FOREST RIVER
Address:	8220 STATE HWY 13 SOUT	Brand:	FLAGSTAFF CLASSIC TT
:	WISCONSIN RAPIDS, WI	Model:	832BWS
Postal/Zip:	54494	Miles/Hrs:	0
Phone#(res):	800-758-2272	Exterior Color:	:
Phone#(bus):	:	Unit Type:	TT-TRAVEL TRAILER
Cell Phone:	:	License#:	:
Email:	NONE	Tag#:	DB 2/6
Purchased Date:	:	:	:
Delivery Date:	:	:	:
InService Date:	:	:	:
Serial#:	4X4TFLN28P1902563	:	:

```
*****
Job #   Description                JOB INFORMATION                Type Bill To
*****
1      COMPLAINT:  THE TONGUE JACK ON THE UNIT IS NOT          W      1021    FORES
        OPERATING CORRECTLY- WILL NOT OPERATE AT
        ALL-
        CAUSE:      Front jack electronics are moisture
        damaged, control pad deteriorated from
        sun exposure. Needs replacement. Lippert
        Smart Jack.
        CORRECTION: REQUESTING 1.50 OF LABOR
2      COMPLAINT:  LIGHT ABOVE DINETE IS BUSTED. ATTACHED    W      1021    FORES
        PIC. KARENA NOTICED.
        CAUSE:      Light above dinette has been rusting and
        corroded. Moisture leaking into roof
        area from broken solar connection at
        rooftop. See pictures.  Looks like
        solar connector was fastened to roof
        over a piece of debris causing an edge
        to crack, over time the damage spread
        allowing in moisture.  Need to remove
        and replace solar connection on
        roofline, 2x tube's white dicor.  (2hrs
        to remove and replace all components,
        reseal and test)
        CORRECTION: R&R solar input connector REQUESTING 2
        HOURS OF LABOR
3      COMPLAINT:  R&R PUCK LIGHT IN DINETE                    W      1021    FORES
        CAUSE:      Light above dinette has been rusting and
        corroded. Moisture leaking into roof
        area from broken solar connection at
```

Continued on page 2

Work Order : 11078

 Job # Description JOB INFORMATION Type Bill To

 rooftop. See pictures. Need to remove
 and replace 12v puck light
 CORRECTION: REQUESTING .40 FOR LABOR

 Job # Part No Description PARTS Bill to Qty Price Total

 2 82200671 LIGHT INTERIOR 4 1/2 LED W-1021 1 3.24 3.24
 2 822020945 SOLAR ROOF TOP ELECTRICA W-1021 1 33.58 33.58
 2 677917000333 Dicor 501LSW-1 EPDM Self W-1021 2 9.59 19.18

 Job# Lab Code Description LABOUR Mech Bill to Hrs Rate Total

 1 Z992 MISC LABOUR CODE (WARR RW W-1021 0.26 115.00 29.90
 2 Z992 MISC LABOUR CODE (WARR RW W-1021 0.00 115.00 0.00
 1 Z992 MISC LABOUR CODE (WARR RW W-1021 0.24 115.00 27.60
 2 Z992 MISC LABOUR CODE (WARR RW W-1021 0.17 115.00 19.55
 2 Z992 MISC LABOUR CODE (WARR RW W-1021 0.26 115.00 29.90
 2 Z992 MISC LABOUR CODE (WARR RW W-1021 0.07 115.00 8.05
 3 RV8AI-2 CEILING LIGHT R&R DC R W-1021 0.00 115.00 0.00

 BILLINGS SUMMARY
 Type Bill Id Parts Labour Sublet Extras Tax Total

 W 1021 56.00 115.00 0.00 0.00 0.00 171.00
 Totals 56.00 115.00 0.00 0.00 0.00 171.00

&k2S
 &k0S