

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 11225

Date In: 21 SEP 24 Author: MGRAY
Promised Date: 21 OCT 24 Stock No: 10876
: Year: 2023
Customer Name: 14519 - PIETSCH, CHRIS Manufacturer: GRAND DESIGN
Address: 780 RIVER OAKS TRAIL Brand: REFLECTION 150 SERIES
: KRONENWETTER, WI Model: 260RD
Postal/Zip: 54455 Miles/Hrs: 0
Phone#(res): (715) 370-1159 Exterior Color:
Phone#(bus): Unit Type: FW-FIFTH WHEEL
Cell Phone: License#:
Email: PIETSCHERS@MSN.COM Tag#:
Purchased Date: 14 APR 23 :
Delivery Date: 03 MAY 23 :
InService Date: :
Serial#: 573FR3126P3346394 :

Job # Description JOB INFORMATION Type Bill To

1 COMPLAINT: leak from the roof. leaking into the E 14519 PIETS
light in the living room. check light as
well and find where the leak is coming
from.
CAUSE: Roof leaking at sealant from roof vent.
Alpha is separating from vent, should
get pushed through warranty,
manufacturing flaw. Alpha didn't stick
to fixture, also a screw that missed the
hole cracked fixture. (2hrs for vent and
light R&R)
CORRECTION: Saved light, removed and cleaned,
working ok. Scrubbed water stains on
interior panel. Removed alpha sealant
and roof vent, resealed, should be ok
now. Reinstalled light and speaker
inside. Should ask the manufacturer
what is the point of a roof vent if the
opening is sealed under it.
RI COMPLAINT: PREFORM ROOF INSPECTION AND ADVISE IF W 1020 GRAND
REPAIR IS NEEDED. - PHOTOS ATTACHED TO
WO, LOT OF BUBBLING INCLUDING ON THE
SLIDE OUT ROOF. ON SLIDE OUT ROOF THERE
IS A SPOT ON THE UNIT THAT IS HOLD A
POOL OF WATER.
CAUSE: Request roof inspection. Inspected
remainder of roof
CORRECTION: Humped up on roof where seams of decking

Continued on page 2

Work Order : 11225

```

*****
Job #   Description           JOB INFORMATION           Type Bill To
*****
    meet, some bubbling in alpha sealant on
    front cap, entire roof membrane on slide
    out is loose and floating, unsure how to
    proceed, still seems watertight but is a
    cause for concern. Turnabond tape at
    edge still holding back water
    sufficiently, but is being pulled up
    from slide flap seal due to membrane
    humping up as closing.  Try get
    slideout roof membrane replacement
    through warranty.  REQUEST: 18 HOURS OF
    LABOR PLUS PARTS.
2      COMPLAINT:  CMR STATES "BATTERY CHARGING FROM 110V   E    14519  PIETS
    SOURCE DOES NOT WORK
    CAUSE:         Request diagnosis of batteries not
    charging when on shore power.  When
    started working on coach battery monitor
    showed 95%, plugged into shore power.
    When completed with tasks battery
    monitor showed 100%  Who, what, where,
    when, why, how?  NPF
    CORRECTION:   Tested charging system at converter with
    multimeter, working fine, tested
    batteries with an amp clamp, working as
    they should, charging while plugged in.
    Unsure what was going on when issue
    presented, no current problem found with
    battery setup.
3      COMPLAINT:  CMR STATES THAT THE BATTERY COMPARTMENT E    14519  PIETS
    DOOR NEEDS REPLACEMENT.
    CAUSE:         CMR requests replacement of front
    compartment door, previously quoted.
    CORRECTION:   ...
WARR    COMPLAINT:  A/C fan rubbing shroud                    E    14519  PIETS
    CAUSE:         Started the A/C to assist drying out
    roof where leaking and noticed
    immediately the A/C was making excessive
    noise.  (30min)
    CORRECTION:   A/C fan shroud contacting fan blades,
    needs adjustment.  Added washers to
    shim shroud so plastics don't contact.
4      SLIDE ROOF REPAIR                                     E    14519  PIETS
WS     COMPLAINT:  WINTERIZE WATER SYSTEM & TRAPS -SELF   E    14519  PIETS
    CONTAINED - TOWABLE
    CAUSE:         Winterize needed
    CORRECTION:   Winterize complete
    
```

Continued on page 3

Work Order : 11225

```
*****
Job # Part No      Description      PARTS      Bill to      Qty      Price      Total
*****
3      822061007      DOOR BAGGAGE DRLUG07 50  E-14519      0      196.19      0.00
1      756815008754  MUSHROOM STYLE PLUMBING E-14519      1      15.30      15.30
1      677917000333  Dicor 501LSW-1 EPDM Self E-14519      1      12.02      12.02
WS     071247312003  -50 ANTIFREEZE/ 1 GALLON E-14519      0      9.62      0.00
*****
```

```
*****
Job# Lab Code Description LABOUR Mech Bill to      Hrs      Rate      Total
*****
1 Z990 MISC LABOUR CODE (EXTE RW E-14519      0.00      130.00      0.00
RI Z991 PREFORM ROOF INSPECTIO RW W-1020      0.30      115.00      34.50
2 DIAG DIAGNOSTICS RW E-14519      1.00      130.00      130.00
3 DIAG DIAGNOSTICS RW E-14519      0.10      130.00      13.00
3 RV31B-4 COMPARTMENT DOOR R&R E-14519      0.00      130.00      0.00
1 Z990 MISC LABOUR CODE (EXTE RW E-14519      1.00      130.00      130.00
ARR01 Z992 MISC LABOUR CODE (WARR RW E-14519      0.50      130.00      65.00
1 Z990 MISC LABOUR CODE (EXTE RW E-14519      0.00      130.00      0.00
WS W495 WINTERIZE RV (WATER SY DL E-14519      0.70      130.00      91.00
*****
```

```
*****
Job # Excode Description EXTRAS bill to      Qty      Price      Total
*****
1 SSE SHOP SUPPLIES - EXTERNAL E-14519      1.00      32.18      32.18
WS J-ADJ QUOTE ADJUSTMENT E-14519      1.00      14.00      14.00
*****
```

```
*****
BILLINGS SUMMARY
Type Bill Id      Parts      Labour      Sublet      Extras      Tax      Total
*****
E 14519      27.32      429.00      0.00      46.18      27.69      530.19
W 1020      0.00      34.50      0.00      0.00      0.00      34.50

Totals      27.32      463.50      0.00      46.18      27.69      564.69
*****
```

&k2S
&k0S