

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 11477

Date In: 16 OCT 24 Author: MZYWICKI
Promised Date: 31 DEC 24 Stock No:
: Year: 2023
Customer Name: 17089 - GLEESING, MIKE Manufacturer: GRAND DESIGN
Address: Brand: SOLITUDE
: Model: 373FB-R
Postal/Zip: Miles/Hrs:
Phone#(res): 414-336-0509 Exterior Color:
Phone#(bus): Unit Type: FW-FIFTH WHEEL
Cell Phone: License#:
Email: KATHRYNG225@GMAIL.COM Tag#: 11/7
Purchased Date: :
Delivery Date: :
InService Date: :
Serial#: 573FS422XPAA13235 :

Job # Description JOB INFORMATION Type Bill To

1 CUSTOMER REQUESTS SERVICE CALL TO THEIR PROPERTY E 17089 GLEES
6701 14TH AVE ALMOND
2 COMPLAINT: CUSTOMER STATES THAT NONE OF THE FANS IN E 17089 GLEES
THEIR UNIT ARE WORKING OTHER THAN THE
ONE IN THEIR BATHROOM. CUSTOMER HAD
STATED THAT WE HAD DONE WORK ON THEIR
UNIT PREVIOUSLY FOR OTHER REASONS AND
THAT THE FANS WERE WORKING BEFORE THEY
BROUGHT THEIR UNIT IN BUT AFTER THE UNIT
WAS DROPPED OFF THE FANS NO LONGER
WORKED. CUSTOMER HAD STATED THAT THEY
HAD TALKED TO US TO DO SOME
TROUBLESHOOTING WHICH LEAD THE FANS TO
WORK AGAIN BUT THEY ARE NO LONGER
WORKING NOW. WOULD LIKE DIAG
CAUSE: pics taken of what I diagnose was the
comucation wires for kitchen fan and
bathroom fan in ceiling had been chewed
CLAIM NUMBER: 738213
CORRECTION: what I did for kitchen fan was I had
fished one end of wire out of ceiling
and strip all wiring and re attached
them together with Waco connector and
for bathroom fan I had remove some wall
trim and corner of wall panel and ran
new wire upwall behind panel and
through ceiling and re attached
everything together and both ceiling

Continued on page 2

Work Order : 11477

```

*****
Job #   Description           JOB INFORMATION           Type Bill To
*****
3       COMPLAINT:          fans are now working
        CUSTOMER STATES THAT THEIR FURNACE IS ONLY WORKING ON THE ELECTRIC SETTING AND NOT THE GAS SETTING. WOULD LIKE THE FURNACE LOOKED AT AND DIAGNOSED
        CAUSE:              checked voltage to furnace was 13.48
                           checked I found hi limit switch wire off
                           so I re attached wire and I was getting
                           gas but no spark at control board
                           diagnose bad control module pic taken of
                           part used
        CORRECTION:        after replacing the control module on
                           furnace I re attached gas line and
                           tested furnace the furnace is working
                           REQUESTS 1.4 HOURS LABOR
4       COMPLAINT:          CUSTOMER STATES THAT THEY WOULD LIKE
        THEIR WATER HEATER LOOKED OVER AS IT DOES NOT RUN ON THE ELECTRIC SETTING AT ALL. WOULD LIKE DIAGNOSIS
        CAUSE:              checked voltage at heating is good I did
                           continuity test on element is bad pic
                           taken of part used
        CORRECTION:        after replacing the electric element on
                           water heater I also filled and amp
                           drawn at 12.2 amps the water heater is
                           now working   REQUSTS 1 HOUR LABOR
    
```

```

*****
Job # Part No      Description           PARTS   Bill to   Qty   Price   Total
*****
4     145856        SUBURBAN 120V ELEMENT   W-1020   1     12.56   12.56
3     755790716500  3G FAN CONTROL MODULE   W-1020   1    130.09  130.09
    
```

```

*****
Job# Lab Code Description   LABOUR   Mech Bill to   Hrs   Rate   Total
*****
2 DIAG          DIAGNOSTICS           JS   E-17089   1.80  140.00  252.00
3 DIAG          DIAGNOSTICS           JS   W-1020   1.40  115.00  161.00
4 DIAG          DIAGNOSTICS           JS   W-1020   1.00  115.00  115.00
    
```

```

*****
Job # Excode      Description           EXTRAS   bill to   Qty   Price   Total
*****
1 SC          SERVICE CALL           E-17089  27.00   3.75   101.25
1 SSE        SHOP SUPPLIES - EXTERNAL E-17089  1.00   18.90   18.90
    
```

Continued on page 3

Work Order : 11477

BILLINGS SUMMARY

Type	Bill Id	Parts	Labour	Sublet	Extras	Tax	Total
E	17089	0.00	252.00	0.00	120.15	20.49	392.64
W	1020	142.65	276.00	0.00	0.00	0.00	418.65
	Totals	142.65	528.00	0.00	120.15	20.49	811.29

&k2S
&k0S