

GREENEWAY, INC.  
 8220 STATE HWY 13 SOUTH  
 WISCONSIN RAPIDS WI  
 US  
 54494  
 (715) 325-5170

WORK ORDER # 11492

Date In: 19 OCT 24	Author: KOTT
Promised Date: 04 JUL 25	Stock No: 11280
:	Year: 2025
Customer Name: 1020 - GRAND DESIGN	Manufacturer: GRAND DESIGN
Address: 11333 COUNTY RD 2	Brand: IMAGINE
: MIDDLEBURY, IN	Model: 2670MK
Postal/Zip: 46540	Miles/Hrs: 0
Phone#(res): 888-825-2820	Exterior Color:
Phone#(bus):	Unit Type: TT-TRAVEL TRAILER
Cell Phone:	License#:
Email: NONE	Tag#: STOCK PREP
Purchased Date:	:
Delivery Date:	:
InService Date:	:
Serial#: 573TE3228S6652842	:

```
*****
Job #   Description                JOB INFORMATION                Type Bill To
*****
NTTS    COMPLAINT: NEW TRAVEL TRAILER STOCK PREP          I    PDI    PRE-D
        CAUSE: New unit
        CORRECTION: Complete
CEN     COMPLAINT: CLEAN EXTERIOR- NEW                      I    PDI    PRE-D
        CAUSE: Ods slide inop. No power coming from
              control board. Wire severed in between
              the board and the motor.
        CORRECTION: Ran new power wire from the board to the
              motor in the underbelly system.
WS      COMPLAINT: WINTERIZE WATER SYSTEM & TRAPS -SELF    I    PDI    PRE-D
              CONTAINED - TOWABLE
        CAUSE: New prep
        CORRECTION: Completed
WARR    COMPLAINT: WARRANTY REPAIR 1 - ODS DINNETTE SLIDE  W    1020  GRAND
              OUT HAS ISSUE. HAD TO BE MANUALLY PUT
              IN.
        CAUSE: Ods dinette slide will not come in or
              out. When pressing the button on panel,
              it gives several flashes indicating
              there is a problem. requested 1.5 hours
        CORRECTION: Had to disconnect hot wire from control
              box and run a new one from control box
              to slide motor. Slide works good now.
              Will need to drop underbelly later when
              unit is to be prepped to get pictures of
              bad wire.
WARR    COMPLAINT: WARRANTY REPAIR 2 - bubbles in dicor on  W    1020  GRAND
              roof
*****
```

Continued on page 2

Work Order : 11492

```

*****
Job #   Description           JOB INFORMATION           Type Bill To
*****
CAUSE:      Mfg - requested .5 hr
CORRECTION: Popped the bubbles and Cleaned and
              sealed the areas that had bubbles
WARR    COMPLAINT:  WARRANTY REPAIR 3 - ods black metal   W    1020   GRAND
              towards front of unit has a divet and
              scuff in it
CAUSE:      looks as iff something was skid along
              the bottom of the bottom j-wrap.
              possibly something bouncing off by light
              and scraping the bottom piece. need
              replacement. j - wrap needs to be 13'
              long x 1' wide 3"bend in the bottom with
              1" flat piece at the end of the j-wrap.
              added photos of damage.      requested 1.5
              hr labor
CORRECTION: .....
WARR    COMPLAINT:  WARRANTY REPAIR 4 - the bottom black   W    1020   GRAND
              metal rock guard has 2 divers where
              rocks hit it in transportation to here I
              believe
CAUSE:      Looks like a couple rocks hit the black
              bottom front metal  Get preauth to
              change metal measures 96" wide x 26"
              tall with 1" bend at bottom please order
              if approved  requested 1.5 hour labor
CORRECTION: .....
WARR    COMPLAINT:  WARRANTY REPAIR 5 - SLIDE OUT IS NOT   W    1020   GRAND
              WORKING PROPERLY. DIAGNOSE.
CAUSE:      Ods quit working. Checked all
              connections at controller and motor. All
              connections were good. Used a battery
              direct to motor, and it still would not
              work. Motor is bad. Need new motor and
              possibly controller. Pics uploaded.
              REQUEST 1.5 HOURS FOR LABOR
CORRECTION: ...

```

```

*****
Job # Part No      Description           PARTS   Bill to   Qty   Price   Total
*****
WS     071247312003 -50 ANTIFREEZE/ 1 GALLON I-PDI      0     7.55    0.00
WARR0 822070087     SLIDEOUT ACTUATOR 40" W/ W-1020  0    557.96  0.00

```

```

*****
Job# Lab Code  Description  LABOUR  Mech Bill to   Hrs   Rate   Total
*****
NTTS RV1F-1A  NEW STOCK PREP          HOD I-PDI      0.00  70.00   0.00
NTTS RV1F-1A  NEW STOCK PREP          HOD I-PDI      0.46  70.00  32.20
NTTS RV1F-1A  NEW STOCK PREP          HOD I-PDI      2.54  70.00 177.80

```

Continued on page 3

Work Order : 11492

```
*****
Job#  Lab Code  Description  LABOUR  Mech Bill to  Hrs  Rate  Total
*****
NTTS RV1F-1A  NEW STOCK PREP          HOD  I-PDI      1.50  70.00  105.00
  CEN CE      CLEAN EXTERIOR          TD   I-PDI      0.10  70.00   7.00
  WS W495     WINTERIZE RV (WATER SY HOD  I-PDI      0.70  70.00  49.00
ARR01 Z992    MISC LABOUR CODE (WARR TD   W-1020    0.00  115.00   0.00
ARR01 Z992    MISC LABOUR CODE (WARR TD   W-1020    0.50  115.00  57.50
ARR02 Z992    MISC LABOUR CODE (WARR HOD  W-1020    0.50  115.00  57.50
ARR03 Z992    MISC LABOUR CODE (WARR HOD  W-1020    0.50  115.00  57.50
ARR04 Z992    MISC LABOUR CODE (WARR HOD  W-1020    0.50  115.00  57.50
ARR05 Z992    MISC LABOUR CODE (WARR TD   W-1020    0.00  115.00   0.00
ARR05 Z992    MISC LABOUR CODE (WARR TD   W-1020    0.02  115.00   2.30
ARR05 Z992    MISC LABOUR CODE (WARR TD   W-1020    0.11  115.00  12.65
ARR05 Z992    SLIDE OUT ACTUATOR      W-1020    0.00  115.00   0.00
ARR04 RV31F-7  ROCK GUARD R&R FRONT R   W-1020    0.00  115.00   0.00
ARR05 Z992    MISC LABOUR CODE (WARR TD   W-1020    0.37  115.00  42.55
*****
```

```
*****
Job #  Excode  Description  EXTRAS  bill to  Qty  Price  Total
*****
ARR02  SSE      SHOP SUPPLIES - EXTERNAL  W-1020  1.00  0.00  0.00
*****
```

BILLINGS SUMMARY

```
*****
Type Bill Id  Parts  Labour  Sublet  Extras  Tax  Total
*****
I   PDI      0.00  371.00  0.00  0.00  0.00  371.00
W   1020     0.00  287.50  0.00  0.00  0.00  287.50

Totals      0.00  658.50  0.00  0.00  0.00  658.50
*****
```

&k2S  
&k0S