



Warranty Claim Form

Date: 1/15/2026

1127 Greenway RV Sales & Service
 8220 State Hwy 13 South
 Wisconsin Rapids, WI 54494
 United States
 Ph. 715-325-5170
 mail@greenwayrv.com

General Information

573FS3725SAA21223
 Solitude 3203GK
 Retail Purchase Date: null
 Work Started: 12/3/2025
 Work Completed: 12/16/2025

Claim Status: Paid
 Dealer Work Order #: 11809B
 Unit Offline Date: 3/4/2025

Claim #: 959076
 Labor: \$294.00
 Parts: \$3.69
 Shipping: \$0.00
 Total: \$297.69

Notes: Sg 12/19/25 340001 - Note repaired not replaced

Dealer Information

Customer Information

1127 Greenway RV Sales & Service
 8220 State Hwy 13 South
 Wisconsin Rapids, WI 54494
 United States

715-325-5170
 mail@greenwayrv.com
 Approved Labor Rate: \$140.00

Operation Line # 1

Flat Rate Code: 340001 Water Heater Assembly - R&R *Fault Code:* Damaged/Maintenance

Problem: NO REPAIR CODE* The funnel trap on the water heater is rusty as well as the small plug. *Hours:* .6

Cause: The drip tray on the water heater was rusty and the small plug was rusted. *Amount:* 84.00

Remedy: Cleaned the tray the best we could and put rust treatment on it and the small plug needed to be replaced. *Sublet Repairs:* \$0.00

Manufacturer #: 1 *Model #:* 1 *Serial #:* 1

| <u>Part</u> | <u>Description</u> | <u>Return Tag #</u> | <u>Qty</u> | <u>Units</u> | <u>Amount</u> |
|---|---|---------------------|------------|--------------|---------------|
| 960204 Miscellaneous Part for claim use only | Miscellaneous Part for claim use only | | 1 | 1 | 0.00 |
| 340032 WATER HEATER DRAIN PIPE END PLUG ONLY F/ FWH09A-AM TANKLESS FURRIION | WATER HEATER DRAIN PIPE END PLUG ONLY F/ FWH09A-AM TANKLESS FURRIION C-FWH09A-007 | | 1 | 1 | 3.69 |

Operation Line # 2

Flat Rate Code: 320008 Gray Tank - Repair In Place

Fault Code: Improper Installation/Build

Problem: The rear gally tank for the kitchen sink is not reading full, it only reads up to 2/3.

Hours: 1.5

Cause: The rear gall tank for the kitchen sink was only reading to 2/3 full when the tank was full and water was coming up through the sink, when I pulled the underbelly, the full sensor wire was laying not connected.

Amount: 210.00

Remedy: Put a new connector on and made sure the wire was tight on the probe.

Sublet Repairs:
\$0.00

Manufacturer #:

Model #:

Serial #: