

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 11824

Date In: 25 MAR 25 Author: MGRAY
Promised Date: 12 MAY 25 Stock No: 10708
: Year: 2023
Customer Name: 1021 - FOREST RIVER Manufacturer: FOREST RIVER
Address: 21815 NETWORK PLACE Brand: FLAGSTAFF SUPER-LITE T
: CHICAGO, IL Model: 29RLBS
Postal/Zip: 60673-1218 Miles/Hrs: 0
Phone#(res): 219-534-3167 Exterior Color:
Phone#(bus): 219-534-3167 Unit Type: TT-TRAVEL TRAILER
Cell Phone: License#:
Email: NONE Tag#: DB 5/13
Purchased Date: 25 JUN 24 :
Delivery Date: 02 JUL 24 :
InService Date: :
Serial#: 4X4TFLL24PZ185390 :

Job # Description JOB INFORMATION Type Bill To

WARR COMPLAINT: WARRANTY REPAIR 2 - Oven works but W 1021 FORES
doesn't heat right. Will not get up to
temperature of 425 and is very slow to
heat at all.
CAUSE: Test oven for operation of temp.
REQUEST 1.0 LABOR
CORRECTION: Turned oven on to max setting of 490.
Got up to 475.
WARR COMPLAINT: WARRANTY REPAIR 1 - Panel under the bed W 1021 FORES
towards the front of the camper has
warped and distorted pulling off of the
aluminum frame.
CAUSE: Done REQUEST .5
CORRECTION: Done
WARR COMPLAINT: WARRANTY REPAIR 3 - Carpet next to the W 1021 FORES
bed towards the bathroom is not attached
and is loose.
CAUSE: Carpet next to bed is loose and needs to
be refastened. REQUEST .75
CORRECTION: Had to unmount bed frame from slide
floor, then tuck the carpet back under
bed frame. Staple carpet down, then
reattached bed frame.
WARR COMPLAINT: WARRANTY REPAIR 4 - Carpet by fireplace W 1021 FORES
will not lay down on the floor with
slide out extended.
CAUSE: Carpet near fireplace bunches up when
slide is all the way out. REQUEST .5

Continued on page 2

Work Order : 11824

```

*****
Job #   Description           JOB INFORMATION           Type Bill To
*****
CORRECTION: Adjusted stopping point of slideout at
            the accuator to prevent carpet from
            bunching up.
WARR    COMPLAINT: WARRANTY REPAIR 5 - Outdoor light on the W    1021    FORES
            drivers side by the water hook up does
            not work.
            CAUSE:   Outside light by city water is burnt
            out. REQUEST .25
            CORRECTION: Installed new light. Tested good.
WARR    COMPLAINT: WARRANTY REPAIR 6 - Front awning has          W    1021    FORES
            slits in it where the LED lights are
            along the length of the awning. Should
            be replaced.
            CAUSE:   Check awning fabric for defects. Has
            holes in it near the bead seam. Need to
            order new fabric only with light. Awning
            is 11'. 1000 DEFECT FROM MANUFACTURER. I
            took pics of the rips in the awning
            fabric
            CORRECTION: Removed awning then removed fabric from
            tube. Then installed new fabric. Put
            awning back on ...
WARR    COMPLAINT: WARRANTY REPAIR 7 - Rear A/C seems as if W    1021    FORES
            not cooling as it should . Front A/C
            works great. REAR A/C DOES NOT SEEM TO
            BE COLD
            CAUSE:   Check main ac for operation. REQUEST .5
            CORRECTION: Intake temp 75 degrees. Discharge temp
            50 degrees. With in normal parameters.
WARR    COMPLAINT: WARRANTY REPAIR 8 - Sealant on roof          W    1021    FORES
            joints is cracking in places including
            the slide outs. CMR CLEANED UP SOME TO
            MAKE SURE THERE WASN'T DAMAGES FROM RAIN
            WHEN DRIVING HOME.
            CAUSE:   Roof inspection. Recommend a roof
            reseal. The sealant is cracked along all
            the slide roof tracks, roof screw
            tracks, and around almost every fixture
            on the roof. I cleaned and re-sealed
            the slide roof edges and around
            everything on the roof. The customer
            tried sealing up the roof edge so I had
            to trim as much of that off as I could
            so I could seal the edge properly. I
            taped off the screw track and re sealed
            the edges.
            CORRECTION: ... Done.
WARR    COMPLAINT: WARRANTY REPAIR 9 - Fireplace has a          W    1021    FORES
            yellow sticker inside it that needs to

```

Continued on page 3

Work Order : 11824

be removed.
 CAUSE: Remove stiker from fireplace. REQUEST
 .25
 CORRECTION: Stiker taken out.

WARR COMPLAINT: WARRANTY REPAIR 10 - Bathroom vanity W 1021 FORES
 countertop front edge is cracked at the
 center.
 CAUSE: 25.5" wide x23 3/8" deep. Vanity counter
 has a Crack in the front. Need to order
 new one.
 CORRECTION: Removed cracked counter top and
 installed new one. Pressure tested
 system for leaks.

WARR COMPLAINT: WARRANTY REPAIR 11 - Gray water tank W 1021 FORES
 indicator does not read empty when no
 water is in the tank. NOW STARTED
 WORKING AFTER DRIVING.
 CAUSE: Grey tank reads 1/3 when tank is empty.
 CORRECTION: Recommend tank probe cleaner if
 continues.

WARR COMPLAINT: WARRANTY REPAIR 12 - Blind on entry door W 1021 FORES
 window is warped at the top and keeps
 pulling out of the top retaining clips I
 have reinstalled it 3 times, should be
 replaced. BLIND IS BOWED AT THE TOP.
 CAUSE: Blind in entrance door is warped on top.
 Need to order new one. 11.5 wide x 21.5
 high.
 CORRECTION: Installed new window shade.

WARR COMPLAINT: WARRANTY REPAIR 13 - Replace wall panels W 1021 FORES
 on driver and passenger side rear slide
 outs that have wrinkled wall covering. -
 verify that is this not the same at the
 panel replace from 10702B
 CAUSE: Paneling is peeling above dinette slide.
 CORRECTION: Was able to heat shrink paneling .

WARR COMPLAINT: WARRANTY REPAIR 14 - KITCHEN SLIDE IS W 1021 FORES
 STARTING TO SQUEAL GOING IN AND OUT. DID
 LUBE THE SLIDE BUT STILL CONTNUING TO
 MAKE NOISE.
 CAUSE: Test slide out on kitchen. Making a
 squeeling noise.
 CORRECTION: Lubricated slideout rams. Seams to help
 the noise.

WARR COMPLAINT: WARRANTY REPAIR 15 - BED PANEL ON THE W 1021 FORES
 FRONT MOST SIDE HAS COME LOOSE FROM
 STRUCTURE. LOOKS BOWED IN TOWARD FRONT
 OF BED. WOULD LIKE TACTED BACK IN PLACE.
 CAUSE: Fasten lower side panel under bed.
 CORRECTION: Refstened panel under bed that had
 popped loose.

Continued on page 4

Work Order : 11824

```
*****
Job # Part No      Description      PARTS    Bill to    Qty    Price    Total
*****
WARR0 822020341      LIGHT PORCH LED OVAL W/S W-1021    1      5.77     5.77
WARR1 848150059901    LIPPERT THIN SHADE KIT   W-1021    1     116.01   116.01
WARR1 822039295      COUNTERTOP - SOP: FOR LA W-1021    1      40.26    40.26
WARR0 677917000333    Dicor 501LSW-1 EPDM Self W-1021    6      8.72    52.32
WARR0 677917000661    10.3oz LAP SEALANT WHITE W-1021    1      9.05     9.05
WARR0 677917000333    Dicor 501LSW-1 EPDM Self W-1021    6      8.72    52.32
WARR0 82202405        AWNING FABRIC - VDS: BLA W-1021    0     333.70     0.00
*****
```

```
*****
Job#  Lab Code  Description      LABOUR    Mech Bill to    Hrs    Rate    Total
*****
ARR02 Z992      MISC LABOUR CODE (WARR TD W-1021    0.50   140.00   70.00
ARR01 Z992      MISC LABOUR CODE (WARR TD W-1021    0.50   140.00   70.00
ARR03 Z992      MISC LABOUR CODE (WARR TD W-1021    0.25   140.00   35.00
ARR04 Z992      MISC LABOUR CODE (WARR TD W-1021    0.50   140.00   70.00
ARR05 Z992      MISC LABOUR CODE (WARR TD W-1021    0.50   140.00   70.00
ARR06 Z992      MISC LABOUR CODE (WARR JGK W-1021    0.48   140.00   67.20
ARR07 Z992      MISC LABOUR CODE (WARR TD W-1021    0.50   140.00   70.00
ARR08 Z992      MISC LABOUR CODE (WARR JGK W-1021    0.00   140.00     0.00
ARR09 Z992      MISC LABOUR CODE (WARR TD W-1021    0.50   140.00   70.00
ARR10 Z992      MISC LABOUR CODE (WARR TD W-1021    0.37   140.00   51.80
ARR11 Z992      MISC LABOUR CODE (WARR TD W-1021    0.50   140.00   70.00
ARR12 Z992      MISC LABOUR CODE (WARR TD W-1021    0.36   140.00   50.40
ARR13 Z992      MISC LABOUR CODE (WARR TD W-1021    0.00   140.00     0.00
ARR14 Z992      MISC LABOUR CODE (WARR TD W-1021    0.12   140.00   16.80
ARR15 Z992      MISC LABOUR CODE (WARR TD W-1021    0.21   140.00   29.40
ARR03 Z992      MISC LABOUR CODE (WARR TD W-1021    0.25   140.00   35.00
ARR15 Z992      MISC LABOUR CODE (WARR TD W-1021    0.29   140.00   40.60
ARR10 Z992      MISC LABOUR CODE (WARR TD W-1021    0.13   140.00   18.20
ARR12 Z992      MISC LABOUR CODE (WARR TD W-1021    0.14   140.00   19.60
ARR13 Z992      MISC LABOUR CODE (WARR TD W-1021    0.50   140.00   70.00
ARR14 Z992      MISC LABOUR CODE (WARR TD W-1021    0.38   140.00   53.20
ARR06 Z992      MISC LABOUR CODE (WARR TD W-1021    0.02   140.00     2.80
ARR08 Z992      MISC LABOUR CODE (WARR TD W-1021    0.36   140.00   50.40
ARR13 Z992      MISC LABOUR CODE (WARR TD W-1021    0.00   140.00     0.00
ARR10 RV32A-7      COUNTERTOP R&R (PER RU TD W-1021    1.75   140.00  245.00
ARR02 Z992      MISC LABOUR CODE (WARR TD W-1021    0.50   140.00   70.00
ARR08 Z992      MISC LABOUR CODE (WARR TD W-1021    0.00   140.00     0.00
ARR06 Z992      MISC LABOUR CODE (WARR TD W-1021    0.50   140.00   70.00
ARR06 Z992      MISC LABOUR CODE (WARR JGK W-1021    0.00   140.00     0.00
ARR08 Z992      MISC LABOUR CODE (WARR JGK W-1021    0.00   140.00     0.00
ARR08 Z992      MISC LABOUR CODE (WARR JGK W-1021    0.14   140.00   19.60
ARR08 Z992      MISC LABOUR CODE (WARR JGK W-1021    1.90   140.00  266.00
ARR08 Z992      MISC LABOUR CODE (WARR JGK W-1021    0.51   140.00   71.40
ARR08 Z992      MISC LABOUR CODE (WARR JGK W-1021    0.56   140.00   78.40
ARR08 Z992      MISC LABOUR CODE (WARR JGK W-1021    0.46   140.00   64.40
ARR06 Z992      MISC LABOUR CODE (WARR RW W-1021    0.49   140.00   68.60
ARR06 Z992      MISC LABOUR CODE (WARR RW W-1021    0.01   140.00     1.40
*****
```

Continued on page 5

Work Order : 11824

```
*****
Job #  Excode   Description  EXTRAS      bill to     Qty    Price    Total
*****
ARR10  FRT         FREIGHT FOR WARR10      W-1021     1.00    18.50    18.50
*****
```

BILLINGS SUMMARY

```
*****
Type Bill Id      Parts    Labour    Sublet    Extras    Tax    Total
*****
W      1021          275.73   1985.20    0.00     18.50    0.00    2,279.43
      Totals          275.73   1985.20    0.00     18.50    0.00    2,279.43
*****
```

&k2S
&k0S