

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 11903

Date In: 18 APR 25 Author: MGRAY
Promised Date: 25 APR 25 Stock No: 11031
: Year: 2024
Customer Name: 12665 - KARNATZ, CHRIS Manufacturer: GRAND DESIGN
Address: 700 OAK DR Brand: REFLECTION FW
: JEFFERSON, WI Model: 324MBS
Postal/Zip: 53549 Miles/Hrs:
Phone#(res): 920-988-7632 Exterior Color:
Phone#(bus): Unit Type: FW-FIFTH WHEEL
Cell Phone: License#:
Email: KARNATZ.CHRIS@GMAIL.CO Tag#:
Purchased Date: 20 SEP 24 :
Delivery Date: 11 OCT 24 :
InService Date: :
Serial#: 573FR3820R9925547 :

Job # Description JOB INFORMATION Type Bill To

1 COMPLAINT: marker light in the side of the unit not W 1020 GRAND
working. ds of unit
CAUSE: Front DS amber marker light strobing and
flickering. Bad wiring connection behind
marker light. Removed crimp connector
and applied a wago connector, staying on
solid now.
CORRECTION: Went to test marker lights and found the
battery drained to 2v. This kind of deep
discharge harms the battery. Connected
the Victron smart charger to it while
performing the brake and bearing
service. Gave battery a recondition
charge. Disassembled DS front marker l
light fixture. Whole assembly was full
of water. Let it dry out. Checked wiring
connections, found one connection to be
questionable, replaced connector,
working as it should now. Reassembled
light fixture, cleaned up and reapplied
sealants. Repeated the cleaning and
resealing to the opposite side fixture.
REQUESTING 1 HOUR
BBI COMPLAINT: Transferred to GRV*11903B on 30 APR 25 E 12665 KARNA
Estimate amount was 0.00 BRAKE AND
BEARING INSPECTION - MAKE SURE
EVERYTHING IS GREASED OR NOTED IF
NEEDED. APPROVED TO DO IF NEED TO BE

Continued on page 2

Work Order : 11903

```

*****
Job #   Description           JOB INFORMATION           Type Bill To
*****
                                DONE.
    CAUSE:   Request brake and bearing inspection.
    CORRECTION: Brakes are still nearly new, not much
                brake dust present.      Grease in
                bearings are still red and tacky. Looks
                lightly used. A clean and repack is not
                necessary for many more miles yet. Like
                new condition.      Pumped 1 shot of
                fresh grease in each wheel hub.
WARR    COMPLAINT:  WARRANTY REPAIR 1 - Replace ODS baggage W    1020    GRAND
                door
    CAUSE:   Baggage door deformed on ODS.
                Compartment door won't stay latched.
                Door and door frame require replacement.
                25x34.5 in, Unknown cause, (1.5hr)
    CORRECTION: REQUESTING 1.5 HOURS

```

```

*****
Job#  Lab Code  Description  LABOUR  Mech Bill to  Hrs  Rate  Total
*****
    BBI BBI      BEARING BRAKE INSPECTI RW  E-12665  0.00  140.00  0.00
      1 Z990      MISC LABOUR CODE (EXTE RW  W-1020  1.00  140.00  140.00
    BBI BBI      BEARING BRAKE INSPECTI RW  E-12665  0.00  140.00  0.00
ARR01 Z992      MISC LABOUR CODE (WARR RW  W-1020  0.50  140.00  70.00

```

```

*****
Job #  Excode  Description  EXTRAS  bill to  Qty  Price  Total
*****
    1  SSE      SHOP SUPPLIES - EXTERNAL  W-1020  1.00  0.00  0.00

```

```

*****
                                BILLINGS SUMMARY
Type Bill Id      Parts  Labour  Sublet  Extras  Tax  Total
*****
W    1020          0.00  210.00  0.00  0.00  0.00  210.00

      Totals      0.00  210.00  0.00  0.00  0.00  210.00

```

&k2S
&k0S