

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 11925B

Date In:	13 JUN 25	Author:	MGRAY
Promised Date:	26 SEP 25	Stock No:	11357
:	:	Year:	2025
Customer Name:	17682 - ZOHIMSKY, BRIA	Manufacturer:	GRAND DESIGN
Address:	15 HEMLOCK ST	Brand:	IMAGINE
:	RHINELANDER, WI	Model:	3100RD
Postal/Zip:	54501	Miles/Hrs:	0
Phone#(res):	7155500448	Exterior Color:	:
Phone#(bus):	:	Unit Type:	TT-TRAVEL TRAILER
Cell Phone:	:	License#:	:
Email:	blzohimsky@gmail.com	Tag#:	PARTS INQUIRY: 103599
Purchased Date:	22 APR 25	:	:
Delivery Date:	12 JUN 25	:	:
InService Date:	:	:	:
Serial#:	573TE3621S6654992	:	:

Job #	Description	JOB INFORMATION	Type	Bill To
WARR	COMPLAINT:	WARRANTY REPAIR 1 -light above DS love seat does not light up. Found a 15 amp fuse blown, replaced it then switched light on and the new fuse blew	W	1020 GRAND
	CAUSE:	Short in the light Wired a different light up there and it is not blowing a fuse and lights up. PLEASE ORDER A NEW LIGHT COMPLETE PIC TAKEN Bad light fixture. I put a resettable fuse in the fuse box, and checked the voltage at the wires for the light and it's at 13.4 volts. I checked the wiring under the slide to make sure their wasn't any damage and from what I can see the wiring is fine. I hooked up a different light fixture and left it on for over two hours and it never popped the fuse. Heather took pics for ordering the light.		
	CORRECTION:	 APPROVER .2 WENT BACK TO ALIX TO EXPLAIN IT TOOK US AN HOUR TO VERIFY WHERE THE ISSUE LAID BETWEEN THE LIGHT AND THE WIRING. WAITING FOR UPDATE 6/18 Will need to remove the panel on that wall. then reomove the distrabution panel to access the wire for replacement. then open up the under belly to run a new wire from the panel		

Continued on page 2

Work Order : 11925B

```

*****
Job #   Description           JOB INFORMATION           Type Bill To
*****
                                to the usb charge port to eliminate the
                                existing wire that has a dead short
                                causing the fuse to blow Will need 18'
                                of 12 gauge wire. 6 hours minimum for
                                labor.
WARR    COMPLAINT:  WARRANTY REPAIR 2 - Routered out           W      1020    GRAND
                                decorative slots below fireplace the
                                finish is jagged and peeling
                                CAUSE:      Rough cut
                                CORRECTION: Used sandpaper and lightly sanded the
                                edges
1        PER ANNA- SERVICE CALL TO MAPLEVIEW RESORT AND           I      SEP      POLIC
                                CAMPGROUND SITE 81. SITES NOT NUMBERED PLEASE CALL
                                CUSTOMER WILL MEET AT LODGE. FOR SERVICE CALL DUE TO
                                THE PARTS NOT BEING IN FOR THE UNIT PRIOR TO THE
                                SHOWTHRU-
2        COMPLAINT:  CUSTOMER STATES THAT THE ENTRANCE DOOR       W      1020    GRAND
                                ON THE UNIT IS VERY HARD TO CLOSE- NEEDS
                                TO BE LOOKED AT- MAY JUST BE THE STRIKER
                                PLATE.
                                CAUSE:      Entrance door is hard to close.
                                CORRECTION: Door has too much camber. Use the the
                                camber tool to straighten door. Tested
                                good.

```

```

*****
Job # Part No Description      PARTS      Bill to   Qty    Price    Total
*****
WARR0 82203708 COUNTERTOP 5/8 X 12 X 24 KUN W-1020      1    103.55    103.55
WARR0 82201487 LIGHT INTERIOR 21" 5000K COO W-1020      1     23.44     23.44

```

```

*****
Job#  Lab Code Description    LABOUR    Mech Bill to    Hrs    Rate    Total
*****
ARR01 Z992      MISC LABOUR CODE (WARR HOD W-1020      0.01   140.00     1.40
ARR01 Z992      MISC LABOUR CODE (WARR HOD W-1020      0.20   140.00    28.00
ARR01 Z992      MISC LABOUR CODE (WARR HOD W-1020      0.29   140.00    40.60
ARR01 WARR      MANUFACTURER WARRANTY JGK W-1020      0.00   140.00     0.00
ARR01 WARR      MANUFACTURER WARRANTY JGK W-1020      0.50   140.00    70.00
ARR02 Z992      MISC LABOUR CODE (WARR HOD W-1020      0.20   140.00    28.00
   2 WARR      MANUFACTURER WARRANTY TD W-1020      0.50   140.00    70.00
ARR01 WARR      MANUFACTURER WARRANTY TD W-1020      0.00   140.00     0.00
ARR01 WARR      MANUFACTURER WARRANTY TD W-1020      0.51   140.00    71.40

```

```

*****
Job #  Excode Description    EXTRAS      bill to    Qty    Price    Total
*****
ARR01 SSE      SHOP SUPPLIES - EXTERNAL W-1020      1.00     0.00     0.00
ARR01 FRT      FREIGHT FOR LIGHT WARR01 W-1020      1.00    17.10    17.10

```

Continued on page 3

Work Order : 11925B

```

*****
Job #  Excode   Description   EXTRAS      bill to    Qty    Price    Total
*****
ARR01  FRT      FREIGHT FOR COUNTER TOP    W-1020    1.00    38.95    38.95
ARR01  FRT      FREIGHT                    W-1020    1.00    17.14    17.14

```

```

*****
                        BILLINGS SUMMARY
Type Bill Id      Parts    Labour    Sublet    Extras      Tax      Total
*****
W      1020        126.99    309.40    0.00      73.19     0.00     509.58

      Totals      126.99    309.40    0.00      73.19     0.00     509.58

```

&k2S
&k0S