

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 12198

Date In: 10 JUN 25 Author: KOTT
Promised Date: 25 DEC 25 Stock No: 11371
: Year: 2025
Customer Name: 13977 - TOMSCHIN, PAME Manufacturer: FOREST RIVER
Address: W14371 COTTONVILLE LAN Brand: FLAGSTAFF MICRO-LITE
: COLOMA, WI Model: 22FBS
Postal/Zip: 54930 Miles/Hrs: 0
Phone#(res): 715-228-4105 Exterior Color:
Phone#(bus): Unit Type: TT-TRAVEL TRAILER
Cell Phone: 715-570-2721 License#:
Email: TOMSCHIN@UNIONTEL.NET Tag#: DB: 6/17
Purchased Date: 04 APR 25 :
Delivery Date: 31 MAY 25 :
InService Date: :
Serial#: 4X4TFLX27SD465207 :

Job # Description JOB INFORMATION Type Bill To

1 COMPLAINT: CUSTOMER STATES THAT THE WATER HEATER IS W 1021 FORES
THROWING A "DSI" CODE- NEEDS TO BE
DIAGNOSED-
CAUSE: When I entered the coach batteries were
drained to 10.6v, range light was left
on and refer was running. Attached
Waterhose to city water inlet, Ran water
through waterheater, purged out some air
and turned on waterheater at control
panel. Fired right up first try. I
believe that the unit might have been
air locked, so there was a punch of air
in the lines causing the waterheater not
to push through the lines as it should.
CORRECTION: NPF
2 COMPLAINT: CUSTOMER STATES THAT THE TV IS NOT W 1021 FORES
PICKING UP ANY SIGNAL- NEEDS TO BE
DIAGNOSED-
CAUSE: States TV not picking up any channels.
CORRECTION: Pulled coach outside performed a channel
scan and picked up 10 local stations.
Watched PBS for 3 minutes while I typed
these notes. Seems to work great.
WARR COMPLAINT: WARRANTY REPAIR 3 - Winegard Antenna W 1021 FORES
CAUSE: CMR requested tv training at pickup,
showed them how to channel scan, then
noticed signal would not come in.
Antenna booster is on. Suspect a bad

Continued on page 2

Work Order : 12198

Job # Description JOB INFORMATION Type Bill To

connection or a bad board in Antenna.
Need to pull apart to verify for
warranty. Remove winegard 360 dome and
inspect. (2hrs) have to reseal once
done. Suspect the antennas inability
to pickup station has something to do
with its location on the roof. Antenna
is directly in front of ladder and next
to A/C. Once Antenna was removed from
roof and tilted 90degrees to the north
it picked up channels, signals just
fine. I recommend warranty approves a
different style antenna. The King
antennas seem to function alot better
with the same footprint . Winegard 360,
F100373492, AR2-5G3

CORRECTION: Had to drill larger holes for antenna,
as the new one is positional. Connected
wiring before securing in place to test
functionality. Secured and fastened,
sealed with white self leveling dicor
sealant, and also covered existing alpha
sealant from previous antenna. Works
great now.

Job #	Part No	Description	PARTS	Bill to	Qty	Price	Total
WARR0	677917000333	Dicor 501LSW-1	EPDM Self	W-1021	2	8.72	17.44
WARR0	660045000375	KING JACK	W/AERIAL MOUNT	W-1021	1	167.05	167.05

Job#	Lab Code	Description	LABOUR	Mech	Bill to	Hrs	Rate	Total
1	WARR	MANUFACTURER WARRANTY	RW		W-1021	0.50	140.00	70.00
2	WARR	MANUFACTURER WARRANTY	RW		W-1021	0.50	140.00	70.00
ARR03	Z992	MISC LABOUR CODE	(WARR RW		W-1021	0.00	140.00	0.00
ARR03	Z992	MISC LABOUR CODE	(WARR RW		W-1021	0.43	140.00	60.20
ARR03	Z992	MISC LABOUR CODE	(WARR RW		W-1021	0.15	140.00	21.00
ARR03	Z992	MISC LABOUR CODE	(WARR RW		W-1021	0.48	140.00	67.20
ARR03	Z992	MISC LABOUR CODE	(WARR RW		W-1021	0.03	140.00	4.20
ARR03	Z992	MISC LABOUR CODE	(WARR RW		W-1021	0.00	140.00	0.00

Job #	Excode	Description	EXTRAS	bill to	Qty	Price	Total
ARR03	SSE	SHOP SUPPLIES	- EXTERNAL	W-1021	1.00	0.00	0.00

Continued on page 3

Work Order : 12198

BILLINGS SUMMARY

Type	Bill Id	Parts	Labour	Sublet	Extras	Tax	Total
W	1021	184.49	292.60	0.00	0.00	0.00	477.09
	Totals	184.49	292.60	0.00	0.00	0.00	477.09

&k2S
&k0S