

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 12521

Date In: 07 AUG 25 Author: KOTT
Promised Date: 07 AUG 25 Stock No: 10523
: Year: 2023
Customer Name: 16534 - STEGEHUIS, RIC Manufacturer: GRAND DESIGN
Address: W3144 THIESEN LANE Brand: IMAGINE XLS
: HELENVILLE, WI Model: 22MLE
Postal/Zip: 53137 Miles/Hrs:
Phone#(res): 262-443-5192 Exterior Color:
Phone#(bus): Unit Type: TT-TRAVEL TRAILER
Cell Phone: License#:
Email: rstegehuis6262@gmail.c Tag#:
Purchased Date: 09 SEP 22 :
Delivery Date: 14 OCT 22 :
InService Date: :
Serial#: 573TE2628P3430721 :

Job # Description JOB INFORMATION Type Bill To

RI COMPLAINT: PREFORM ROOF INSPECTION AND ADVISE IF E 16534 STEGE
REPAIR IS NEEDED. CUSOTMER STATES THAT
THERE ARE BUBBLES IN THE ROOF AND THERE
ARE STAPLES PUSHING THROUGH- CUSTOMER
ALSO STATES THAT ARE AREAS THAT IT FEELS
LIKE THERE ROOF DECKING IS SEPERATING-
NEEDS TO BE INSPECTED-
CAUSE: 1000 DEFECT FROM MANUFACTURER. I found
two areas one by the pancake vent and
the second by the antenna that show
signs of water getting in and the
decking is swelling. I found another
spot where a staple is starting to poke
through. The roof membrane and 2-3
sheets of decking will have to be
replaced. I have seen this issue before
and it was caused by the manufacturer
using alpha sealant and not hitting the
pre drilled holes in the roof
attachments and it caused them to crack.
I used my finger and very little effort
to peel the sealant back and I found an
exposed hole right away.
CORRECTION: ... REQUEST .30 HOURS OF LABOR
1 COMPLAINT: RESEAL AROUND THE AFFECTED AREAS W 1020 GRAND
CAUSE: 1000 DEFECT FROM MANUFACTURER. I cleaned
and resealed around the pancake vent and
the antenna.

Continued on page 2

Work Order : 12521

```

*****
Job #   Description                JOB INFORMATION                Type Bill To
*****
CORRECTION: Done. REQUEST .50 HOURS OF LABOR
2 COMPLAINT: COMPLETE ROOF REPLACEMENT WITH TWO          W    1020    GRAND
          SHEETS OF DECKING
CAUSE:    ROTTEN ROOF DECKING DUE TO WATER BEING
          ABLE TO GET IN WERE THE SCREW WERE OVER
          TIGHTENED ON THE ROOF APPLIANCES.
CORRECTION: REQUEST: 37 HOURS OF LABOR

```

```

*****
Job # Part No      Description          PARTS    Bill to    Qty    Price    Total
*****
1     677917000333 Dicor 501LSW-1 EPDM Self W-1020      3      8.72     26.16
2     677917007172 INSTALLATION COMPONENT K W-1020      0     298.21     0.00
2     677917008032 TPO 8FT6IN X 30FT DIFLEX W-1020    0     479.34     0.00

```

```

*****
Job# Lab Code Description    LABOUR    Mech Bill to    Hrs    Rate    Total
*****
RI Z991    PREFORM ROOF INSPECTIO JGK    E-16534    0.02    140.00    2.80
RI Z991    PREFORM ROOF INSPECTIO JGK    E-16534    0.28    140.00    39.20
1 WARR    MANUFACTURER WARRANTY    JGK    W-1020    0.50    140.00    70.00
2 RV30I-8 ROOF R&R RUBBER (PER L    W-1020    0.00    140.00    0.00
2 RV30I-5 ROOF DECK R&R (PER SHE    W-1020    0.00    140.00    0.00

```

```

*****
Job # Excode    Description    EXTRAS    bill to    Qty    Price    Total
*****
RI SSE    SHOP SUPPLIES - EXTERNAL    E-16534    1.00    3.15     3.15
2 M      WOOD          W-1020    0.00    0.00     0.00

```

```

*****
                                BILLINGS SUMMARY
Type Bill Id    Parts    Labour    Sublet    Extras    Tax    Total
*****
E 16534          0.00     42.00     0.00     3.15     2.50     47.65
W 1020          26.16     70.00     0.00     0.00     0.00     96.16

Totals          26.16    112.00     0.00     3.15     2.50    143.81

```

&k2S
&k0S