

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 12549

Date In: 12 AUG 25 Author: MGRAY
Promised Date: 19 AUG 25 Stock No: 11058
: Year: 2024
Customer Name: 17317 - HAGEN, TERRY Manufacturer: FOREST RIVER
Address: 4110 KAUTH DR Brand: FLAGSTAFF SUPER-LITE T
: WISCONSIN RAPIDS, WI Model: 26FKBS
Postal/Zip: 54494 Miles/Hrs:
Phone#(res): 7196608815 Exterior Color:
Phone#(bus): Unit Type: TT-TRAVEL TRAILER
Cell Phone: License#:
Email: tdhagen04@yahoo.com Tag#: RT66
Purchased Date: 03 MAY 24 :
Delivery Date: 30 MAY 24 :
InService Date: :
Serial#: 4X4TFLB23RZ191461 :

Job # Description JOB INFORMATION Type Bill To

1 COMPLAINT: THERE IS A WHEEL WELL TIRM PIECE THAT IS E 17317 HAGEN
PULLING OUT. NEEDED REPAIR OR
REPLACEMENT.
CAUSE: The DS fender skirt has a few mismatched
screws and is cracked, consider
replacement. Overall length is 64", grey
in color. Fender skirts on both sides
are cracked. Do both or just the DS?
CORRECTION: .
2 COMPLAINT: THERE IS A PIECE OF METAL ON THE BOTTOM E 17317 HAGEN
J-WRAP HAS PULLED OUT AND NEEDS TO
CHECKED OUT FOR REPAIR.
CAUSE: J-wrap also missing screws and damaged
on one spot. Looks like it may have
loosened up in the wind and shook it
apart. Supports underneath came loose,
J-Wrap damaged in multiple spots. Repair
or replace? J-wrap is a gunmetal/dark
silver color with a sparkle texture. One
bend, rounded at bottom. Whole piece
needing replacement is 14ft long.
12.5"tall.
CORRECTION: Added some screws to hold in place for
now.
3 NEED MF CHECKED PER AGREEMENT. 5 YEAR MF NEEDS I SAP POLIC
YEARLY INSPECTION.
4 COMPLAINT: BUBBLE IN THE BATHROOM CEILING ABOVE THE W 1021 FORES
SINK.

Continued on page 2

Work Order : 12549

```

*****
Job #   Description           JOB INFORMATION           Type Bill To
*****
      CAUSE:      Solar roof top connector is cracked and
                  has been leaking into ceiling cavity
                  causing interior panel above bathroom
                  sink to deform. This is a manufacturers
                  defect and a very large job, concerning
                  the interior panel. It is likely
                  starting to mold and will require
                  replacement, along with the solar
                  connector.  Removing all the ceiling
                  fixtures in bathroom and the wall behind
                  toilet, all the trim and baten strips,
                  the doors. (60hrs)
      CORRECTION: . REQUEST 60 HOURS OF LABOR

```

```

*****
Job # Part No Description           PARTS           Bill to   Qty   Price   Total
*****
1     EST     F100094467- FENDERSKIRT - 1E- E-17317   0     0.00    0.00
2     EST     ROLLED ALUMINUM - 8D-6: ALLOY E-17317   0     0.00    0.00

```

```

*****
Job#  Lab Code  Description           LABOUR   Mech Bill to   Hrs   Rate   Total
*****
  4  Z990      MISC LABOUR CODE (EXTE RW   W-1021   1.00  140.00  140.00
  2  Z990      MISC LABOUR CODE (EXTE RW   E-17317  1.00  130.00  130.00
  1  Z990      MISC LABOUR CODE (EXTE RW   E-17317  0.91  130.00  118.30
  1  Z990      MISC LABOUR CODE (EXTE RW   E-17317  0.09  130.00  11.70
  1  RV30L-2   FENDERSKIRT R&R TANDEM      E-17317  0.00  130.00   0.00
  1  RV30L-2   FENDERSKIRT R&R TANDEM      E-17317  0.00  130.00   0.00
  2  Z990      INSTALL J-WRAP              E-17317  0.00  130.00   0.00

```

```

*****
Job #  Excode   Description           EXTRAS           bill to   Qty   Price   Total
*****
  1  SSE        SHOP SUPPLIES - EXTERNAL   E-17317   1.00   19.50   19.50

```

```

*****
                                BILLINGS SUMMARY
Type Bill Id           Parts   Labour   Sublet   Extras   Tax   Total
*****
E   17317                0.00   260.00   0.00    19.50   15.40   294.90
W   1021                 0.00   140.00   0.00     0.00    0.00   140.00

      Totals            0.00   400.00   0.00    19.50   15.40   434.90

```

&k2S
&k0S