

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 12549

Date In: 12 AUG 25 Author: MGRAY
Promised Date: 31 OCT 25 Stock No: 11058
: Year: 2024
Customer Name: 17317 - HAGEN, TERRY Manufacturer: FOREST RIVER
Address: 4110 KAUTH DR Brand: FLAGSTAFF SUPER-LITE T
: WISCONSIN RAPIDS, WI Model: 26FKBS
Postal/Zip: 54494 Miles/Hrs:
Phone#(res): 7196608815 Exterior Color:
Phone#(bus): Unit Type: TT-TRAVEL TRAILER
Cell Phone: License#:
Email: tdhagen04@yahoo.com Tag#:
Purchased Date: 03 MAY 24 :
Delivery Date: 30 MAY 24 :
InService Date: :
Serial#: 4X4TFLB23RZ191461 :

Job # Description JOB INFORMATION Type Bill To

1 COMPLAINT: THERE IS A WHEEL WELL TIRM PIECE THAT IS E 17317 HAGEN
PULLING OUT. NEEDED REPAIR OR
REPLACEMENT.
CAUSE: Fender skirts were cracked before being
returned to FR for the roof damage
issue.
CORRECTION: Fender skirts looked new when returned
from FR. Replacement of fender skirt no
longer necessary, they must have noticed
those at the factory, too bad they didnt
do the radious metal too at the same
time. Replaced jwrap all the way
forward from the DS fender skirt. Looks
nice.
2 COMPLAINT: THERE IS A PIECE OF METAL ON THE BOTTOM E 17317 HAGEN
J-WRAP HAS PULLED OUT AND NEEDS TO
CHECKED OUT FOR REPAIR.
CAUSE: J-wrap also missing screws and damaged
on one spot. Looks like it may have
loosened up in the wind and shook it
apart. Supports underneath came loose,
J-Wrap damaged in multiple spots. Repair
or replace? J-wrap is a
gunmetal/dark silver color with a
sparkle texture. One bend, rounded at
bottom. Whole piece needing replacement
is 14ft long. 12.5"tall.
CORRECTION: Added some screws to hold in place for

Continued on page 2

Work Order : 12549

```

*****
Job #   Description           JOB INFORMATION           Type Bill To
*****
3       COMPLAINT:           now. Update:9/25/25, Radious metal
        NEED MF CHECKED PER AGREEMENT. 5 YEAR MF I   SAP   POLIC
        NEEDS YEARLY INSPECTION.
        CORRECTION: THE REAR HALF OF THE UNIT IS LACKING
        MOUSEFREE- WILL NEED TO REAPPLIED.
4       COMPLAINT:           BUBBLE IN THE BATHROOM CEILING ABOVE THE W   1021  FORES
        SINK.
        CAUSE: Solar roof top connector is cracked and
        has been leaking into ceiling cavity
        causing interior panel above bathroom
        sink to deform. This is a manufacturers
        defect and a very large job, concerning
        the interior panel. It is likely
        starting to mold and will require
        replacement, along with the solar
        connector. Removing all the ceiling
        fixtures in bathroom and the wall behind
        toilet, all the trim and baten strips,
        the doors. (60hrs)
        CORRECTION: RESEALED AROUND THE SOLAR CONNECTOR TO
        PREVENT ANY FURTHER DAMAGE. REQUEST 60
        HOURS OF LABOR ****unit is going back
        to the manufacturer to have the repair
        completed****
MFP2    COMPLAINT:           MOUSE FREE PRO- UP TO 20 FT           I   PD   GOODW
        CORRECTION: PER MATT- POLICY DEALERSHIP-
WS      COMPLAINT:           WINTERIZE WATER SYSTEM & TRAPS -SELF   E   17317 HAGEN
        CONTAINED - TOWABLE
        CAUSE: Request winterize.
        CORRECTION: Removed water heater anode, bypassed and
        changed valve positions for winterize.
        Flushed plumbing with antifreeze.
        Winterized.

```

```

*****
Job # Part No      Description           PARTS   Bill to   Qty   Price   Total
*****
MFP20 822051024        MOUSE FREE PRO 5 GALLON   I-PD    20    4.50    90.00
1      82204467        FENDER SKIRT - 1E-6: TAN E-17317    0    44.23    0.00
2      82206604        ROLLED ALUMINUM - PFL: H E-17317    16    8.10   129.60
WS     071247312003    -50 ANTIFREEZE/ 1 GALLON E-17317    3    9.62    28.86
1      82202635        ROLLED ALUMINUM - 8D-6: E-17317    12    9.54   114.48

```

```

*****
Job# Lab Code Description LABOUR Mech Bill to Hrs Rate Total
*****
4 Z990 MISC LABOUR CODE (EXTE RW W-1021 0.30 140.00 42.00
2 Z990 MISC LABOUR CODE (EXTE RW E-17317 0.30 130.00 39.00

```

Continued on page 3

Work Order : 12549

```
*****
Job#  Lab Code  Description  LABOUR  Mech Bill to    Hrs    Rate    Total
*****
  1  Z990      MISC LABOUR CODE (EXTE RW  E-17317    0.91   130.00   118.30
  1  Z990      MISC LABOUR CODE (EXTE RW  E-17317    0.09   130.00    11.70
  1  RV30L-2    FENDERSKIRT R&R TANDEM RW  E-17317    0.00   130.00    0.00
  1  RV30L-2    FENDERSKIRT R&R TANDEM RW  E-17317    0.00   130.00    0.00
  2  Z990      INSTALL J-WRAP          RW  E-17317    0.00   130.00    0.00
MFP20 Z991      INSTALL MOUSE FREE      RW  I-PD       1.00    70.00    70.00
  2  Z990      INSTALL J-WRAP          RW  E-17317    1.70   130.00   221.00
WS W495      WINTERIZE RV (WATER SY RW  E-17317    0.70   130.00    91.00
  1  RV30L-2    FENDERSKIRT R&R TANDEM RW  E-17317    1.00   130.00   130.00
*****
```

```
*****
Job #  Excode  Description  EXTRAS  bill to  Qty  Price  Total
*****
  1  SSE      SHOP SUPPLIES - EXTERNAL  E-17317  1.00  35.00  35.00
  1  FRT      FREIGHT          E-17317  1.00  44.30  44.30
  2  FRT      FREIGHT FOR JOB 2  E-17317  1.00  310.85  310.85
  2  FRT      FREIGHT          E-17317  0.00   0.00   0.00
WS  J-ADJ    QUOTE ADJUSTMENT  E-17317  1.00 -14.86 -14.86
*****
```

```
*****
                                BILLINGS SUMMARY
Type Bill Id      Parts  Labour  Sublet  Extras  Tax  Total
*****
E  17317          272.94  611.00   0.00  375.29  69.34  1,328.57
I  PD            90.00   70.00   0.00   0.00   0.00   160.00
W  1021           0.00   42.00   0.00   0.00   0.00   42.00

Totals          362.94  723.00   0.00  375.29  69.34  1,530.57
*****
```

&k2S
&k0S