

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 13110B

Date In: 20 NOV 25 Author: MGRAY
Promised Date: 25 DEC 25 Stock No: 11520
: Year: 2026
Customer Name: 17841 - OELKE, JAMES Manufacturer: FOREST RIVER
Address: 9113 S. CHICAGO RD Brand: PUMA DESTINATION
: OAK CREEK, WI Model: 421LFT
Postal/Zip: 53154 Miles/Hrs: 0
Phone#(res): 414-254-0666 Exterior Color:
Phone#(bus): Unit Type: TT-TRAVEL TRAILER
Cell Phone: License#:
Email: NONE Tag#: DB 11/20
Purchased Date: 08 SEP 25 :
Delivery Date: 25 DEC 25 :
InService Date: :
Serial#: 4X4TPU820TP107724 :

Job # Description JOB INFORMATION Type Bill To

3 COMPLAINT: BACKSPLASH BEHIND STOVE BUBBLING W 1021 FORES
CAUSE: The back splash behind the stove was warped and was causing the center to bulge out, i put panel nails anywhere that was bulged out. The backsplash above the stove has a bulge it, there is no simple way of taking it off and resticking it, the silicone alone the wall and couter will have to be cut to push the extra material down and the vent hood will have to come off to and glue will have to be put between the wall and the backsplash, will take about 2 hours
CORRECTION: Done
4 COMPLAINT: SEAL UP AROUND WHERE PIPING HOLES GOES W 1021 FORES
INTO UNDERBELLY FOR BLACK/GREY TANK
CAUSE: The holes where the termination hoses come out of the frame from the tank were not sealed from the factory, i sealed them up with expanding foam
CORRECTION: Done. REQUESTING .3 WARRANTY AUTH: .30
WARR COMPLAINT: WARRANTY REPAIR 1 - The LP regulator is W 1021 FORES
letting to much propane thru
CAUSE: The regulator was holding at 17 inches in the water colum, i replaced the regulator.
CORRECTION: Done REQUESTING 1.1HR WARR AUTH: .50

Continued on page 2

Work Order : 13110B

```

*****
Job #   Description           JOB INFORMATION           Type Bill To
*****
WARR    COMPLAINT:  WARRANTY REPAIR 2 - the bathroom light  W   1021   FORES
        switch causes the fuse to blow, bypassed
        the wire and found that there is
        something wrong with the wire they have
        run from the panel to the switch, we
        will have to run a new wire
        CAUSE:  Whenever you turned the rear bathroom
        light on it would pop the fuse for the
        rear power, somewhere in the wall the
        wire is shorted out, i ran a new wire in
        the underbelly to the fuse panel and it
        is no longer popping fuses.
        CORRECTION: Done.
ISRO    COMPLAINT:  INTERNAL STOCK REPAIR 01- the front      I   SEP   POLIC
        awning motor cover got melted by the
        shop heater and is warped.
        CAUSE:  I had the awning out and the shop heater
        on and it melted the motor cover on the
        front awning arm, i replaced the cover
        CORRECTION: Done REQUESTING 1.5HR WARRANTY AUTH:
        1.5 HOURS
WARR    COMPLAINT:  WARRANTY REPAIR 3 - the left closet door W   1021   FORES
        in the rear bedroom has a small crack
        around the latch and the latch is not
        level so it will not secure.
        CAUSE:  Lowered the latch to where it secures
        and put putty over the small crack.
        CORRECTION: Done REQUESTING .6HR WARRANTY AUTH: .20
    
```

```

*****
Job # Part No   Description           PARTS   Bill to   Qty   Price   Total
*****
WARR0 815505013253 AUTO CHANGE OVER REG.  W-1021   1   47.74   47.74
WARR0 815505010665 12" LP HOSE           W-1021   2   22.97   45.94
ISRO1 848150059215 REGAL COVER, DRIVE HEAD I-SEP    1   19.92   19.92
ISRO1 848150059208 REGAL HEAD, BACK COVER, I-SEP    1   30.48   30.48
    
```

```

*****
Job# Lab Code Description   LABOUR   Mech Bill to   Hrs   Rate   Total
*****
  3 Z992 MISC LABOUR CODE (WARR EG W-1021   0.07  140.00   9.80
  4 Z992 MISC LABOUR CODE (WARR EG W-1021   0.50  140.00  70.00
ARR01 Z992 MISC LABOUR CODE (WARR EG W-1021   0.50  140.00  70.00
ARR02 Z992 MISC LABOUR CODE (WARR EG W-1021   0.00  140.00   0.00
ARR02 Z992 MISC LABOUR CODE (WARR EG W-1021   0.50  140.00  70.00
ARR02 Z992 MISC LABOUR CODE (WARR EG W-1021   1.00  140.00 140.00
ARR02 Z992 MISC LABOUR CODE (WARR EG W-1021   0.00  140.00   0.00
ARR02 Z992 MISC LABOUR CODE (WARR EG W-1021   0.00  140.00   0.00
ARR02 Z992 MISC LABOUR CODE (WARR EG W-1021   0.00  140.00   0.00
    
```

Continued on page 3

Work Order : 13110B

```
*****
Job#  Lab Code  Description  LABOUR  Mech Bill to    Hrs    Rate    Total
*****
ARR02 Z992      MISC LABOUR CODE (WARR EG  W-1021    0.00   140.00    0.00
ARR02 Z992      MISC LABOUR CODE (WARR EG  W-1021    0.00   140.00    0.00
ISR01 Z991      MISC LABOUR CODE (INTE EG  I-SEP     0.00    70.00    0.00
ISR01 Z991      MISC LABOUR CODE (INTE EG  I-SEP     0.50    70.00   35.00
ARR03 Z992      MISC LABOUR CODE (WARR EG  W-1021    0.56   140.00   78.40
      3 WARR      MANUFACTURER WARRANTY EG  W-1021    0.00   140.00    0.00
      3 WARR      MANUFACTURER WARRANTY TD  W-1021    1.00   140.00  140.00
*****
```

```
*****
Job #  Excode   Description  EXTRAS      bill to    Qty    Price    Total
*****
ARR01 SSE      SHOP SUPPLIES - EXTERNAL  W-1021    1.00    0.00    0.00
      3 M        PANEL NAILS FROM ACE      W-1021    0.00    0.00    0.00
*****
```

BILLINGS SUMMARY

```
*****
Type Bill Id      Parts    Labour    Sublet    Extras    Tax    Total
*****
I      SEP          50.40    35.00    0.00    0.00    0.00    85.40
W      1021         93.68    578.20    0.00    0.00    0.00   671.88

      Totals    144.08    613.20    0.00    0.00    0.00   757.28
*****
```

&k2S
&k0S