

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 10500

Date In:	17 MAY 24	Author:	KOTT
Promised Date:	25 DEC 24	Stock No:	10218
:	:	Year:	2022
Customer Name:	15389 - PFIFFNER, JOE	Manufacturer:	GRAND DESIGN
Address:	327 WILSHIRE BLVD NORT	Brand:	REFLECTION 150 SERIES
:	STEVENS POINT, WI	Model:	278BH
Postal/Zip:	54481	Miles/Hrs:	0
Phone#(res):	:	Exterior Color:	:
Phone#(bus):	:	Unit Type:	FW-FIFTH WHEEL
Cell Phone:	715-252-1260	License#:	:
Email:	joe46637@yahoo.com	Tag#:	:
Purchased Date:	07 JUL 21	:	:
Delivery Date:	07 JUL 21	:	:
InService Date:	:	:	:
Serial#:	573FR342XN3336864	:	:

```
*****
Job #   Description          JOB INFORMATION          Type Bill To
*****
1      COMPLAINT:  AWNING FABRIC NEEDS TO BE REPLACED-IT IS W    1020    GRAND
      PULLING APART AT THE RAIL AND BY THE
      TUBE WE HAVE SEEN THIS BEFORE ON A
      RECALL
      CAUSE:        Solara Awning coming undone, recall
      warranty. recall #22E-055 This is a
      common recall issue, will need to
      replace awning fabric. NO LABEL ON
      FABRIC, UNIT DOES FALL IN THE RIGHT
      YEAR. Received replacement warranty part
      came in UPS from Grand Design. When
      starting to replace, inspection of new
      part revealed a damaged awning tube. Had
      to swap tubes with what should of been a
      very quick off-and-on task. Also noticed
      a wiring mess that needs correcting at
      connections for awning power. See
      pictures for reference.
      CORRECTION:  ... INSTALLED NEW AWNING
2      COMPLAINT:  CUSTOMER STATES THAT THE BATHROOM FAN IS E    15389    PFIFF
      BROKEN AND NEEDS TO BE REPLACED-
      CUSTOMER REQUESTS HAVING A RAIN SENSOR
      FAN INSTALLED-
      CAUSE:        Replace bad fan in bathroom with maxxfan
      CORRECTION:  Removed dicore and screws on roof,
      removed bathroom ceiling vent.
      Cleaned opening with Quik-Solv prior to
      installing new vent. Installed new
```

Continued on page 2

Work Order : 10500

```

*****
Job #   Description                JOB INFORMATION                Type Bill To
*****
                                MaxxFan Delux, added new screws.
                                Sealed around new vent with three tubes
                                of white self-leveling dicor.
                                Connected fan to power in interior,
                                installed schroud, cleaned up around new
                                edges, some moisture staining on ceiling
                                panel. Tested, working well.

3      COMPLAINT: CUSTOMER REQUESTS HAVING THE PROPANE          E      15389  PFIFF
                                FILLED-

1005   CORRECTION: FILLED- 7 POUNDS PROPANE
        COMPLAINT: RETAIL CUSTOMER REPAIR 01 - Reseal Rear  I      SEP      POLIC
                                Roof Corners
        CAUSE:      Dicor sealant cracked and seperated on
                                Rear roof corners
        CORRECTION: While on roof taking care of bathroom
                                roof vent, noticed both rear corners
                                were exposed to possible moisture issues
                                due to sealant cracked and seperated.
                                Spent the time necessary to clean and
                                reseal both rear corners to prevent
                                water damage.      Noticed one small nick
                                near ODS rear corner in roof membrane,
                                couldnt tell if it went all the way
                                through so hit spot with a shot of dicor
                                too.

```

```

*****
Job # Part No      Description      PARTS      Bill to      Qty      Price      Total
*****
1      822090745    AWNING 20' BLACK SOLID F W-1020      0      336.22      0.00
2      752055000084 MAXXFAN DLX VENT 12V WHI E-15389      1      535.09      535.09
2      677917000333 10.3oz TUBE LAP SEALANT E-15389      3        8.83      26.49

```

```

*****
Job# Lab Code Description      LABOUR      Mech Bill to      Hrs      Rate      Total
*****
1 Z990      MISC LABOUR CODE (EXTE RW      W-1020      0.60      115.00      69.00
2 RV25-12   VENT\FAN R&R COMPLETE RW      E-15389      0.00      130.00      0.00
2 RV25-12   VENT\FAN R&R COMPLETE RW      E-15389      1.20      130.00      156.00
1005 Z990      MISC LABOUR CODE (EXTE RW      I-SEP      0.10      70.00      7.00
1 Z990      MISC LABOUR CODE (EXTE RW      W-1020      1.40      115.00      161.00

```

```

*****
Job # Excode      Description      EXTRAS      bill to      Qty      Price      Total
*****
1 SSE      SHOP SUPPLIES - EXTERNAL      W-1020      1.00      11.70      11.70
3 LP      PROPANE      E-15389      7.00      1.41      9.87
1 FRT      FREIGHT      W-1020      1.00      303.81      303.81

```

Continued on page 3

Work Order : 10500

BILLINGS SUMMARY

Type	Bill Id	Parts	Labour	Sublet	Extras	Tax	Total
E	15389	561.58	156.00	0.00	9.87	40.04	767.49
I	SEP	0.00	7.00	0.00	0.00	0.00	7.00
W	1020	0.00	230.00	0.00	315.51	0.00	545.51
	Totals	561.58	393.00	0.00	325.38	40.04	1,320.00

&k2S

&k0S