



1025 WI-77 Minong WI US 54859 www.linkrvidirect.com

Invoice
\$1,513.36

RO# : 40144 Tag# : TE760398

Check-in: Wed Feb 4, 2026 | 1:30 PM
Ready for Pickup: Thu Feb 26, 2026 | 3:06 PM
Promise Time: Mon Feb 9, 2026 | 6:00 PM

Customer
linkautomotive - 2174
PD7155200709I
Customer
1235491
+1 - (715) 466 - 2222
NO@GMAIL.COM
1025 WI-77
Minong, WI 54859

Pickup-Customer
Same as Customer

Billing-Customer
Same as Customer

Vehicle
2026 Keystone ALPINE
4YDFAVU20 TE760398
1 Mi In / 2 Mi Out
In Service Date:
01/01/2017
Stock #: KS26-29

Service Advisor
KEVIN GOODIEL
goodielk

A.	MISCELLANEOUS	DEALER STATES THE FRONT CAP LIGHTS DONT WORK	Warranty Pay	\$532.18
----	---------------	--	--------------	----------

Job added by KEVIN GOODIEL on Wed Feb 4, 2026 | 1:30 PM

1. Power wire for nose cone light not attached to anything. requesting 5.1 hours including 4 for diag

Op.1 MISCELLANEOUS -MISCELLANEOUS

Labor Sale: \$495.00

Labor Cost: \$158.10

Technician	Certification Number	Actual Hours	Assigned Bill Hours	Flag Hours	Labor Sale	Labor Cost
lafavet	-	3.52	5.1	5.1	\$495.00	\$158.10
boiem	-	0.83	0	0	\$0.00	\$0.00

1. Removed light from nose and removed the silicone sealant covering the hole the wiring goes through. Pulled the connections through hole and tested for power. Lights were not receiving any power. Removed passenger side extrusion along underside of nose cone to locate the wires for light and where they were going. They ran into the framing, so went to passenger side battery compartment to locate. The wires went into the compartment and then into front storage compartment. Located wires in compartment, but had to drop ceiling panel to further trace wires direction. Wires ran across unit and came out behind the leveling touchpad. Wires were laying in the empty cavity not attached to anything. Brought wires out enough to test if they were actually for the nose cone light, and they were. Reinstalled and sealed all pieces of unit that were removed. Took pics of disassembled/removed pieces of unit. Needs hole drilled and light switch installed.

2. Drilled and cut a hole on the front under the nose cone and installed the new switch, lights work like they should

Parts

Parts Total Sale Amount	\$12.73
Parts Total Cost Amount	\$9.79





1025 WI-77 Minong WI US 54859 www.linkrvidirect.com

Invoice
\$1,513.36

RO# : 40144 Tag# : TE760398

Check-in: Wed Feb 4, 2026 | 1:30 PM
Ready for Pickup: Thu Feb 26, 2026 | 3:06 PM
Promise Time: Mon Feb 9, 2026 | 6:00 PM

Customer

linkautomotive - 2174
PD71552007091
Customer
1235491
+1 - (715) 466 - 2222

Billing-Customer

Same as Customer

Vehicle

2026 Keystone ALPINE
4YDFAVU20 TE760398

Service Advisor

KEVIN GOODIEL
goodielk

Op.1 MISCELLANEOUS -MISCELLANEOUS

Labor Sale: \$495.00

Labor Cost: \$158.10

Name	Quantity	Unit Price	Sale Price	Cost Price
777992 - Switch - 12V - Weatherproof - SPST - On/Off - w/Plate - Gasket & Butyl Tape - Black -	1	\$12.73	\$12.73	\$9.79

Fees

\$24.45

Code	Description	Sale Amount	Cost Amount
FF	Freight Fee	\$24.45	\$0.00

Total Labor Sale
\$495.00

Total Labor Cost
\$158.10

Total Parts Sale
\$12.73

Total Parts Cost
\$9.79

B. MISCELLANEOUS	DEALER STATES GFI OUTLETS ON THE INVERTER DONT WORK	Warranty Pay	\$910.93
-------------------------	--	---------------------	-----------------

Job added by KEVIN GOODIEL on Wed Feb 4, 2026 | 1:30 PM

1. Inverter keeps tripping when 120V shore power is connected.

Op.1 MISCELLANEOUS -MISCELLANEOUS

Labor Sale: \$247.50

Labor Cost: \$155.00

Technician	Certification Number	Actual Hours	Assigned Bill Hours	Flag Hours	Labor Sale	Labor Cost
lafavet	-	4	5	5	\$247.50	\$155.00
boiem	-	0.94	0	0	\$0.00	\$0.00

1. Manual reset breaker on inverter was tripped, so tried resetting, but reset tripped immediately and could hear a pop sound in inverter. Tried a couple more times with same issue. Traced the 120V wires and found a junction, so disconnected and tried the reset again. This time did not trip. The 120V wires that I disconnected was the shore power





1025 WI-77 Minong WI US 54859 www.linkrvidirect.com

Invoice
\$1,513.36

RO# : 40144 Tag# : TE760398

Check-in: Wed Feb 4, 2026 | 1:30 PM
Ready for Pickup: Thu Feb 26, 2026 | 3:06 PM
Promise Time: Mon Feb 9, 2026 | 6:00 PM

Customer linkautomotive - 2174 PD7155200709I Customer 1235491 +1 - (715) 466 - 2222	Billing-Customer Same as Customer	Vehicle 2026 Keystone ALPINE 4YDFAVU20 TE760398	Service Advisor KEVIN GOODIEL goodielk
---	---	--	---

Op.1 MISCELLANEOUS -MISCELLANEOUS

Labor Sale: \$247.50

Labor Cost: \$155.00

coming in to inverter. Checked voltage and polarity of wiring and found no issue. With battery on unit, inverter was not putting any power out to outlets. Reconnected the 120V junction and it didn't immediately trip, but did so after about 7 seconds. Inverter is bad. Took pics.

2. Installed inverter. When testing, found that the polarity was backwards at the outlets. Inspected bathroom outlet, as that had the GFCI reset buttons, and it was wired properly. Found a group of daisy chained outlet blocks in storage compartment. Traced the inverter wires to the first block, opened it and the top most set of wires fell out of the block. Checked other boxes and had similar issue on a couple. Was able to reinstall wires on other blocks. Tried to reinstall wires on first block, but the block did not bite into wiring like it should. Removed block and installed junction box, fed wires from block into it and tied together. Outlets showed proper polarity and did not have any error codes on inverter. Found a loose 120V wire running into underbelly that did not have power to it, most likely supposed to tie into inverter circuit. Used an outlet block to cap wires off just to be safe. Reinstalled bathroom outlet and storage compartment panels when done.

Parts

Parts Total Sale Amount \$638.96

Parts Total Cost Amount \$491.51

Name	Quantity	Unit Price	Sale Price	Cost Price
686127 - Inverter - 2000 Watt HF - Sensata - 12V - Hardwired w/Transfer Switch	1	\$638.96	\$638.96	\$491.51

Fees \$24.47

Code	Description	Sale Amount	Cost Amount
FF	Freight Fee	\$24.47	\$0.00

Total Labor Sale
\$247.50

Total Labor Cost
\$155.00

Total Parts Sale
\$638.96

Total Parts Cost
\$491.51

C.	MISCELLANEOUS	DEALER STATES MISSING THE BATTERIES FOR 2 REMOTES	Warranty Pay	\$0.00
----	---------------	---	--------------	--------





1025 WI-77 Minong WI US 54859 www.linkrvidirect.com

Invoice
\$1,513.36

RO# : 40144 Tag# : TE760398

Check-in: Wed Feb 4, 2026 | 1:30 PM
Ready for Pickup: Thu Feb 26, 2026 | 3:06 PM
Promise Time: Mon Feb 9, 2026 | 6:00 PM

Customer
linkautomotive - 2174
PD71552007091
Customer
1235491
+1 - (715) 466 - 2222

Billing-Customer
Same as Customer

Vehicle
2026 Keystone ALPINE
4YDFAVU20 TE760398

Service Advisor
KEVIN GOODIEL
goodielk

Job added by KEVIN GOODIEL on Wed Feb 4, 2026 | 1:30 PM

Op.1 MISCELLANEOUS -MISCELLANEOUS

Labor Sale: \$0.00

Labor Cost: \$0.00

Technician	Certification Number	Actual Hours	Assigned Bill Hours	Flag Hours	Labor Sale	Labor Cost
lafavet	-	0.18	0	0	\$0.00	\$0.00
boiem	-	0	0	0	\$0.00	\$0.00

1. Put 2 new batteries in TV remote, but TV is on the inverter circuit, so could not test. Checked the other 2 remotes, but both had batteries.

Total Labor Sale
\$0.00

Total Labor Cost
\$0.00

Total Parts Sale
\$0.00

Total Parts Cost
\$0.00

D.	MISCELLANEOUS	DEALER STATES SEAM TAPE IN THE BEDROOM IS FALLING DOWN	Warranty Pay	\$37.25
----	---------------	--	--------------	---------

Job added by KEVIN GOODIEL on Wed Feb 4, 2026 | 1:30 PM

1. Seam tape needs replace as it is full of wood shavings and lost its adhesiveness.

Op.1 MISCELLANEOUS -MISCELLANEOUS

Labor Sale: \$33.00

Labor Cost: \$15.50

Technician	Certification Number	Actual Hours	Assigned Bill Hours	Flag Hours	Labor Sale	Labor Cost
lafavet	-	0.15	0.5	0.5	\$33.00	\$15.50
boiem	-	0.35	0	0	\$0.00	\$0.00

1. Seam tape needs replace as it is full of wood shavings and lost its adhesiveness.

2. Removed old tape and Put new seam tape on the wall





1025 WI-77 Minong WI US 54859 www.linkrvidirect.com

Invoice
\$1,513.36

RO# : 40144 Tag# : TE760398

Check-in: Wed Feb 4, 2026 | 1:30 PM
Ready for Pickup: Thu Feb 26, 2026 | 3:06 PM
Promise Time: Mon Feb 9, 2026 | 6:00 PM

Customer
linkautomotive - 2174
PD7155200709I
Customer
1235491
+1 - (715) 466 - 2222

Billing-Customer
Same as Customer

Vehicle
2026 Keystone ALPINE
4YDFAVU20 TE760398

Service Advisor
KEVIN GOODIEL
goodielk

Op.1 MISCELLANEOUS -MISCELLANEOUS

Labor Sale: \$33.00

Labor Cost: \$15.50

Parts

Parts Total Sale Amount \$4.25

Parts Total Cost Amount \$3.25

Name	Quantity	Unit Price	Sale Price	Cost Price
711758 - Seam - Tape - 1" - Rosemary Beach Empress	25	\$0.17	\$4.25	\$3.25

Total Labor Sale
\$33.00

Total Labor Cost
\$15.50

Total Parts Sale
\$4.25

Total Parts Cost
\$3.25

E.	MISCELLANEOUS	DEALER STATES THE REAR CARGO LIGHT IS HANGING DOWN	Warranty Pay	\$33.00
----	---------------	--	--------------	---------

Tags: [Add-on](#)

Job added by KEVIN GOODIEL on Wed Feb 4, 2026 | 1:31 PM

1. Screw hole is stripped out.

Op.1 MISCELLANEOUS -MISCELLANEOUS

Labor Sale: \$33.00

Labor Cost: \$9.30

Technician	Certification Number	Actual Hours	Assigned Bill Hours	Flag Hours	Labor Sale	Labor Cost
lafavet	-	0.17	0.3	0.3	\$33.00	\$9.30
boiem	-	0	0	0	\$0.00	\$0.00

1. The rear screw hole for light was stripped out, so replaced both screws with longer and drilled new hole for the rear screw. Refastened the light strip back in place.





1025 WI-77 Minong WI US 54859 www.linkrvidirect.com

Invoice
\$1,513.36

RO# : 40144 Tag# : TE760398

Check-in: Wed Feb 4, 2026 | 1:30 PM
Ready for Pickup: Thu Feb 26, 2026 | 3:06 PM
Promise Time: Mon Feb 9, 2026 | 6:00 PM

Customer
linkautomotive - 2174
PD7155200709I
Customer
1235491
+1 - (715) 466 - 2222

Billing-Customer
Same as Customer

Vehicle
2026 Keystone ALPINE
4YDFAVU20 TE760398

Service Advisor
KEVIN GOODIEL
goodielk

Total Labor Sale
\$33.00

Total Labor Cost
\$9.30

Total Parts Sale
\$0.00

Total Parts Cost
\$0.00

F.	MISCELLANEOUS	DEALER STATES THERES BROKEN CORNER MOULDING IN CLOSET	Warranty Pay	\$0.00
----	---------------	---	--------------	--------

Tags: Add-on

Job added by KEVIN GOODIEL on Wed Feb 11, 2026 | 9:34 AM

1. OVER TIGHTENED

Op.1 MISCELLANEOUS -MISCELLANEOUS

Labor Sale: \$0.00

Labor Cost: \$0.00

Technician	Certification Number	Actual Hours	Assigned Bill Hours	Flag Hours	Labor Sale	Labor Cost
lafavet	-	0	0	0	\$0.00	\$0.00
boiem	-	0	0	0	\$0.00	\$0.00

1. NEEDS NEW

Total Labor Sale
\$0.00

Total Labor Cost
\$0.00

Total Parts Sale
\$0.00

Total Parts Cost
\$0.00





1025 WI-77 Minong WI US 54859 www.linkrvidirect.com

Invoice
\$1,513.36

RO# : 40144 Tag# : TE760398

Check-in: Wed Feb 4, 2026 | 1:30 PM
Ready for Pickup: Thu Feb 26, 2026 | 3:06 PM
Promise Time: Mon Feb 9, 2026 | 6:00 PM

Customer
linkautomotive - 2174
PD7155200709I
Customer
1235491
+1 - (715) 466 - 2222

Billing-Customer
Same as Customer

Vehicle
2026 Keystone ALPINE
4YDFAVU20 TE760398

Service Advisor
KEVIN GOODIEL
goodielk

	Category	Sale	Cost
	Labor	\$808.50	\$337.90
	Parts	\$655.94	\$504.55
	Sublet	\$0.00	\$0.00
	Sublet Labor	\$0.00	\$0.00
	Sublet Parts	\$0.00	\$0.00
	Fees	\$48.92	\$0.00
	Discounts	\$0.00	-
	Tax	\$0.00	-
	Deductible	\$0.00	-
	Insurance/Warranty	\$0.00	-
	Invoice Total	\$1,513.36	\$842.45

Clock In Info

#	Opcode	Date	Clock In	Clock Out	Time Spent	Pay Type	Technician	Flag Hrs
A	MISC	Mon Feb 9, 2026	3:48 PM	4:24 PM	0.61 hrs	W	lafavet	5.1 hrs
Tag: Regular Hour			Reason: -					
A	MISC	Tue Feb 10, 2026	8:13 AM	11:08 AM	2.91 hrs	W	lafavet	-
Tag: Regular Hour			Reason: -					
B	MISC	Tue Feb 10, 2026	11:08 AM	12:13 PM	1.09 hrs	W	lafavet	5 hrs
Tag: Regular Hour			Reason: Employee clocked out of the job for lunch break					
D	MISC	Tue Feb 10, 2026	12:46 PM	12:55 PM	0.15 hrs	W	lafavet	0.5 hrs
Tag: Regular Hour			Reason: -					
E	MISC	Tue Feb 10, 2026	12:55 PM	1:05 PM	0.17 hrs	W	lafavet	0.3 hrs
Tag: Regular Hour			Reason: -					





1025 WI-77 Minong WI US 54859 www.linkrvdirect.com

Invoice
\$1,513.36

RO# : 40144 Tag# : TE760398

Check-in: Wed Feb 4, 2026 | 1:30 PM
Ready for Pickup: Thu Feb 26, 2026 | 3:06 PM
Promise Time: Mon Feb 9, 2026 | 6:00 PM

Customer
linkautomotive - 2174
PD7155200709I
Customer
1235491
+1 - (715) 466 - 2222

Billing-Customer
Same as Customer

Vehicle
2026 Keystone ALPINE
4YDFAVU20 TE760398

Service Advisor
KEVIN GOODIEL
goodielk

Clock In Info

#	Opcode	Date	Clock In	Clock Out	Time Spent	Pay Type	Technician	Flag Hrs
C	MISC	Tue Feb 10, 2026	1:19 PM	1:30 PM	0.18 hrs	W	lafavet	0 hrs
Tag: Regular Hour			Reason: -					
B	MISC	Thu Feb 26, 2026	9:01 AM	9:58 AM	0.94 hrs	W	boiem	0 hrs
Tag: Regular Hour			Reason: -					
D	MISC	Thu Feb 26, 2026	9:59 AM	10:20 AM	0.35 hrs	W	boiem	0 hrs
Tag: Regular Hour			Reason: -					
B	MISC	Thu Feb 26, 2026	10:26 AM	10:26 AM	0 hrs	W	lafavet	-
Tag: Regular Hour			Reason: -					
A	MISC	Thu Feb 26, 2026	10:50 AM	11:39 AM	0.83 hrs	W	boiem	0 hrs
Tag: Regular Hour			Reason: -					
B	MISC	Thu Feb 26, 2026	10:52 AM	1:46 PM	2.91 hrs	W	lafavet	-
Tag: Regular Hour			Reason: -					
F	MISC	-	-	-	0 hrs	W	lafavet	0 hrs
C	MISC	-	-	-	0 hrs	W	boiem	0 hrs
E	MISC	-	-	-	0 hrs	W	boiem	0 hrs
F	MISC	-	-	-	0 hrs	W	boiem	0 hrs





1025 WI-77 Minong WI US 54859 www.linkrvidirect.com

Invoice
\$1,513.36

RO# : 40144 Tag# : TE760398

Check-in: Wed Feb 4, 2026 | 1:30 PM
Ready for Pickup: Thu Feb 26, 2026 | 3:06 PM
Promise Time: Mon Feb 9, 2026 | 6:00 PM

Customer
linkautomotive - 2174
PD7155200709I
Customer
1235491
+1 - (715) 466 - 2222

Billing-Customer
Same as Customer

Vehicle
2026 Keystone ALPINE
4YDFAVU20 TE760398

Service Advisor
KEVIN GOODIEL
goodielk

Accounting Info - Warranty

GL Account #	Control #	Franchise	Amount
11400	40144	LINK RV	\$1,513.36
57200	40144	LINK RV	-\$808.50
67200	40144	LINK RV	\$337.90
14400	lafavet	LINK RV	-\$337.90
14400	boiem	LINK RV	\$0.00
54200	40144	LINK RV	-\$655.94
64000	40144	LINK RV	\$504.55
14000	40144	LINK RV	-\$504.55
76710	40144	LINK RV	-\$48.92

