

DEALER ACCOUNT #	0008794	CLAIM STATUS	Paid
MYERS RV CENTER INC		CLAIM	2532257
12024 CENTRAL AVE S.E.		CLAIM ORIGIN	WEB
ALBUQUERQUE, NM 87123		ORIGINAL CLAIM ID	
USA		VIN	5ZT2AVRB3TB941232
		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$190.00	SITE/WAREHOUSE	050 / 050
OWNER INFORMATION		ITEM #	AVT26DBS
		DEALER RO #	72379
		CLAIM START DATE	12/18/2025
		CLAIM END DATE	04/02/2026
Retail Date of Purchase		WARRANTY EXPIRATION DATE	

Labor				
Line# 1	Operation Code	Operational Description		
	20-43-24-00-000589	Die Cut, Stripe, Decal, Graphic - Exterior/Exterior Miscellaneous/Repair/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2025-12-18 19:25:40 :: Complaint: Decals are wrinkled Cause: Decals are not smooth to the skin of the trailer Correction: Smooth out the bubbles			
Model#	Dir Sub Hrs	0.60	Sub Labor Amt	\$114.00
Serial#	Appr Hrs	0.60	Appr Labor Amt	\$114.00
	Notes			
	NVCB,.60 to repair decals.Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. TD			

Labor			
Line# 2	Operation Code	Operational Description	
	60-138-24-00-001524	Termination Valve Assembly (Read Notes!!!) - Plumbing/Drainage System/Repair/No Tread Code	
	Complaint, Cause, Correction Original Note : stephanie@dealer-advisors.com, 2025-12-18 19:28:05 :: Complaint: Black tank valve leaks through the valve while closed Cause: Debris between the seals which is not allowing a proper seal Correction: Dumped the tank, used a bent screwdriver to feel between the seals, pulled out some ABS shavings, closed and filled tank and it is still presenting with a slow leak. Dumped again, pulled out more shavings, retested. No more leaks. Dumped tank and checked again, debris is no longer present.		
	Model#	Dlr Sub Hrs	Sub Labor Amt
		1.00	\$190.00
	Serial#	Appr Hrs	Appr Labor Amt
		0.50	\$95.00
	Notes Time for this repair is excessive .50 to clean black tank valve.Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. TD		

Labor		Operational Description	
Line# 3	Operation Code 60-136-15-00-001499	Water Line - Plumbing/Fresh Water Supply/Repair or Replace/No Tread Code	
Complaint, Cause, Correction			
Original Note : stephanie@dealer-advisors.com, 2025-12-18 19:34:52 :: Complaint: Kink in waterline near the pump Cause: There is a kink in the waterline that goes from the pump output to the water filter canister that is impeding flow Correction: Kink is close to the fitting, will need to cut the kink out of the hose, reattach hose to the T fitting and realign the output to alleviate kinking			
Model#	Dlr Sub Hrs	0.60	Sub Labor Amt \$114.00
Serial#	Appr Hrs	0.60	Appr Labor Amt \$114.00
Notes			
NVCB,.60 to fix kink in hose.Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. TD			

Part					
Line# 1	Item #	Description			
	USERPART	88-9165 1/2 Plumb pex clamp			
	Model #	Serial #	Part tag		
	Sub Qty	1.00	Sub Dlr Price	\$0.51	Sub Freight \$0.00
	Appr Qty	1.00	Appr Dlr Price	\$0.51	Appr Freight \$0.00
Notes					

Labor

Line# 4	Operation Code	Operational Description		
	40-197-01-11-001326	30 or 50 Amp Shore Power Cord - Detachable - Electrical/110 Volt Exterior/ Replace/Electrical		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2025-12-18 19:37:08 :: Complaint: 50 amp twist lock will not allow the cord to lock in to place Cause: The angle that the cord has to be plugged in does not allow the cord to stay locked in position. The handle and cord pull the connector down to the left into the unlocked position. Correction: Need to remove the four screws for the twist lock and rotate 180 degrees and reinstall so that when the cord is connected, the weight of the cord keeps the plug in the lock position.			
Model#	Dlr Sub Hrs	0.54	Sub Labor Amt	\$102.60
Serial#	Appr Hrs	0.54	Appr Labor Amt	\$102.60
	Notes			
	NVCB,.54 to reposition 50 amp receptacle.Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. TD			

Labor				
Line# 5	Operation Code	Operational Description		
	30-102-36-00-001101	Slide Out Fascia, each section - Interior/Panels, Ceilings, & Interior Moldings/ Touch Up/No Tread Code		
Complaint, Cause, Correction				
Original Note : stephanie@dealer-advisors.com, 2025-12-18 19:40:22 :: Complaint: Chipped paint on meta plate inside slide fascia Cause: The metal plate on the corner of the inner fascia of the slide has chipping and the paint is wrinkled in two areas Correction: Remove three screws and sand down the wrinkled are, repaint the metal and reinstall. Will need to remove the other corner fascia and spray to that the paint matches.				
Model#	Dlr Sub Hrs	0.60	Sub Labor Amt	\$114.00
Serial#	Appr Hrs	0.60	Appr Labor Amt	\$114.00
Notes				
NVCB,.60 to repair paint.Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. TD				

Part					
Line# 1	Item #	Description			
	USERPART	Paint			
	Model #	Serial #	Part tag		
	Sub Qty	1.00	Sub Dlr Price	\$5.70	Sub Freight \$0.00
	Appr Qty	1.00	Appr Dlr Price	\$5.70	Appr Freight \$0.00
Notes					

Labor					
Line# 6	Operation Code		Operational Description		
	30-99-01-00-001030		Valance - Interior/Soft Goods/Replace/No Tread Code		
	Complaint, Cause, Correction				
	Original Note : stephanie@dealer-advisors.com, 2025-12-18 19:43:16 :: Complaint: Missing valance in the kitchen, it is metal Cause: There is no valance in the kitchen above the sinks. The valances in the living area are all metal and it looks like the kitchen window should have one. Correction: Order metal window valance and install.				
Model#	Dlr Sub Hrs	0.30	Sub Labor Amt	\$57.00	
Serial#	Appr Hrs	0.30	Appr Labor Amt	\$57.00	
	Notes				
	NVCB,..30 to install valance.Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. TD				

Part

Line# 1	Item #	Description			
	F100711502	VALANCE, 3" X 54" X 2", TEXTURED BLACK, 48X29 WINDOW, 19947			
	Model #	Serial #		Part tag	
	Sub Qty	1.00	Sub Dlr Price	\$28.44	Sub Freight \$54.39
	Appr Qty	1.00	Appr Dlr Price	\$27.40	Appr Freight \$54.39

Notes
Dealer has submitted a part cost different than what was charged on the Forest River parts order, S5439486.
The approved cost has been adjusted to \$23.83 + state allowed mark-up of 15%.

Labor

Line# 7	Operation Code	Operational Description		
	30-100-12-00-001049	Cabinet End Panel - Interior/Cabinetry/Resecure or Tighten/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2025-12-18 19:45:42 :: Complaint: Closet panel screws are loose			
	Cause: The panels in the two side closets in the master bedroom are not wide enough o fit between the cabinet			
	and the wall which leaves gaps and screws that have pulled out of the wall panel. Correction: Remove back			
	panels on both sides, inch by half inch wood cleats, relocate them and reinstall the panels. Have to widen both			
	panels by about a half an inch. Requesting .75 hours for each side.			

Model#	Dlr Sub Hrs	1.50	Sub Labor Amt	\$285.00
Serial#	Appr Hrs	1.50	Appr Labor Amt	\$285.00

Notes
NVCB,1.50 to redo closet panels.Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. TD

Labor

Line# 8	Operation Code	Operational Description
	30-99-01-00-001018	Day Night Shade or Roller Shade - Interior/Soft Goods/Replace/No Tread Code
	Complaint, Cause, Correction	
	Original Note : stephanie@dealer-advisors.com, 2025-12-18 19:52:18 :: Complaint: Kitchen blinds are bent	
	Cause: Kitchen blinds are bent, it was noted at delivery Correction: Will need to order blinds	

Model#	Dlr Sub Hrs	0.50	Sub Labor Amt	\$95.00
Serial#	Appr Hrs	0.30	Appr Labor Amt	\$57.00

Notes
NVCB,Time requested is excessive .30 to install shade.TD

Part

Line# 1	Item #	Description			
	F100728686	BLIND, MINI, BLACK, 50 X 31, 39890			
	Model #	Serial #		Part tag	
	Sub Qty	1.00	Sub Dlr Price	\$27.87	Sub Freight \$54.39
	Appr Qty	1.00	Appr Dlr Price	\$27.88	Appr Freight \$54.39

Notes
Computer rounded up \$0.01

Labor

Line# 9	Operation Code	Operational Description
	30-95-24-00-000958	Booth Structure - Interior/Dinette/Repair/No Tread Code
	Complaint, Cause, Correction	
	Original Note : stephanie@dealer-advisors.com, 2025-12-18 19:54:20 :: Complaint: Dinette frame is damaged	
	Cause: Unknown, caused during manufacturing, noted at time of delivery Correction: Three cross braces will have	
	to be removed. The long piece of cracked wood will have to be removed and replaced and the cross braces	
	reinstalled using screws. Requesting an hour for disassembly, cutting a piece of wood to fit and reassembly.	

Model#	Dlr Sub Hrs	1.00	Sub Labor Amt	\$190.00
Serial#	Appr Hrs	1.00	Appr Labor Amt	\$190.00

Notes
Will need pictures to proceed with claim.TD
Apologies. I thought I had attached them. They're on it now.
NVCB,R&I new seat cleet.1.00.Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Part

Line# 1	Item #	Description				
	USERPART	Wood				
	Model #	Serial #		Part tag		
	Sub Qty	1.00	Sub Dlr Price	\$9.50	Sub Freight	\$0.00
	Appr Qty	1.00	Appr Dlr Price	\$9.50	Appr Freight	\$0.00
Notes						

Submitted	Labor Amt	\$1,261.60	Approved	Labor Amt	\$1,128.60
	Parts & Freight	\$180.80		Parts & Freight	\$179.77
	Total	\$1,442.40		Total	\$1,308.37

DEALER

SIGNATURE

DATE

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER

SIGNATURE

DATE

All repairs described have been inspected and are satisfactory.