

# FOREST RIVER WARRANTY CLAIM FORM

<b>DEALER ACCOUNT #</b>	0008794	<b>CLAIM STATUS</b>	Paid
MYERS RV CENTER INC		<b>CLAIM</b>	2618745
12024 CENTRAL AVE S.E.		<b>CLAIM ORIGIN</b>	WEB
ALBUQUERQUE, NM 87123		<b>ORIGINAL CLAIM ID</b>	
USA		<b>VIN</b>	5ZT2AVRBXTB941728
		<b>CHASSIS VIN</b>	
		<b>MILEAGE</b>	0
<b>Labor rate:</b>	\$190.00	<b>SITE/WAREHOUSE</b>	050 / 050
<b>OWNER INFORMATION</b>		<b>ITEM #</b>	AVT26DBS
PHILLIP VANDER KRAATS		<b>DEALER RO #</b>	72859
726 TRAMWAY VISTA DR NE APT 12		<b>CLAIM START DATE</b>	03/24/2026
Albuquerque, NM 87122		<b>CLAIM END DATE</b>	03/30/2026
USA			
<b>Retail Date of Purchase</b>	03/28/2026	<b>WARRANTY EXPIRATION DATE</b>	03/28/2027

## Claim Line Details

### Labor

<b>Line# 1</b>	<b>Operation Code</b>	<b>Operational Description</b>	
	40-196-24-11-001297	Interior 12 Volt Wiring - Electrical/12 Volt Interior/Repair/Electrical	
	<b>Complaint, Cause, Correction</b>		
	Original Note : stephanie@dealer-advisors.com, 2026-03-24 12:16:01 :: Complaint: Water pump kills battery power when running. Water pump only works when living room light switch is on. All lights dim severely when pump is running and power drops from 13.5V to 10.3V. Converter, battery and 120 are all in passing order. Cause: After extensive diagnosis, found no dedicated circuit for monitor panel or water pump. Ground supply was bad to the bathroom as well. Ran test circuits to verify problem and confirm resolution. Correction: Need to run a dedicated circuit from panel in living room to water pump controls in bathroom. Must run new ground from 12V distribution panel to the bathroom to resole bad ground issue. Must remove water pump from living room light circuit.		
	<b>Model#</b>	<b>Dlr Sub Hrs</b>	<b>Sub Labor Amt</b>
		8.00	\$1,520.00
	<b>Serial#</b>	<b>Appr Hrs</b>	<b>Appr Labor Amt</b>
		5.00	\$950.00
	<b>Notes</b>		
	NvCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. TD		

### Labor

<b>Line# 2</b>	<b>Operation Code</b>	<b>Operational Description</b>	
	70-507-24-00-001901	AC Duct - Appliances/Ducting/Repair/No Tread Code	
	<b>Complaint, Cause, Correction</b>		
	Original Note : stephanie@dealer-advisors.com, 2026-03-24 12:18:48 :: Complaint: Air conditioner in living room is quick cycling compressor Cause: Manifold is not sealed properly Correction: reseal manifold Additional Note : stephanie@dealer-advisors.com, 2026-03-24 12:24:47 :: **There were only two labor codes available for the GE ACs. I picked a close code, but could not find one that really fit this repair**		
	<b>Model#</b>	<b>Dlr Sub Hrs</b>	<b>Sub Labor Amt</b>
		0.50	\$95.00
	<b>Serial#</b>	<b>Appr Hrs</b>	<b>Appr Labor Amt</b>
		0.50	\$95.00
	<b>Notes</b>		
	nvCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. TD		

### Part

<b>Line# 1</b>	<b>Item #</b>	<b>Description</b>			
	USERPART	Sealant			
	<b>Model #</b>	<b>Serial #</b>	<b>Part tag</b>		
	<b>Sub Qty</b>	<b>Sub Dlr Price</b>	<b>Sub Freight</b>	<b>\$0.00</b>	
	1.00	\$4.75			
	<b>Appr Qty</b>	<b>Appr Dlr Price</b>	<b>Appr Freight</b>	<b>\$0.00</b>	
	1.00	\$4.75			
	<b>Notes</b>				

**Labor**

Line# 3

**Operation Code**

30-100-36-00-001035

**Operational Description**

Cabinet Door - Interior/Cabinetry/Touch Up/No Tread Code

**Complaint, Cause, Correction**

Original Note : stephanie@dealer-advisors.com, 2026-03-24 12:26:07 :: \*\*just noting at this time, no time needed right now. Bedroom door is peeling and there are scratches ion the cabinet in the bedroom.\*\*

**Model#**

**Dlr Sub Hrs**

0.00

**Sub Labor Amt** \$0.00

**Serial#**

**Appr Hrs**

0.00

**Appr Labor Amt** \$0.00

**Notes**

---

**Submitted**

Labor Amt

\$1,615.00

Parts & Freight

\$4.75

Total

\$1,619.75

**Approved**

Labor Amt

\$1,045.00

Parts & Freight

\$4.75

Total

\$1,049.75

---

**DEALER**

**DATE**

**SIGNATURE**

I certify that I have performed these repairs consistent with Forest River Policies.

---

**CUSTOMER**

**DATE**

**SIGNATURE**

All repairs described have been inspected and are satisfactory.