

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT # 0008794		CLAIM STATUS	Authorized
MYERS RV CENTER INC		CLAIM	2628731
12024 CENTRAL AVE S.E.		CLAIM ORIGIN	WEB
ALBUQUERQUE, NM 87123		ORIGINAL CLAIM ID	
USA		VIN	5ZT3SN3B7TG706104
		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$190.00	SITE/WAREHOUSE	049 / 049A
OWNER INFORMATION		ITEM #	SNF38LAUNDRY
SASHA FLETCHER		DEALER RO #	73082A
PO BOX 265		CLAIM START DATE	04/02/2026
Ribera, NM 87560		CLAIM END DATE	01/01/1900
USA			
Retail Date of Purchase	03/26/2026	WARRANTY EXPIRATION DATE	03/26/2027

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description		
	30-98-24-00-002295	Bed or Bunk Structure - Interior/Beds, Mattress/Repair/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2026-04-02 10:16:10 :: Complaint: Master bed slide is dragging on the floor when all the way retracted Cause: Bed slide supports are too far back and are off center. Frame is not completely secure to the slide. Correction: Removed the mattress. Disconnected the struts from under bed storage. Removed both pieces of plywood. Unscrewed the bed frame from the slide room. Checked the bed supports by measurements and found they were too far back to support the foot of the bed and off center to the right. Moved the bed supports forward and put shims under them. Moved them to be centered under the bed Set the bed frame back in place. Found the bed frame was screwed to the floor with 2 screws at the edge of the slide, but nothing at the head of the bed. Added screws at the head of the bed. Completely reattached the bed frame back to the slide. Reinstalled the plywood and struts. Tested the bed on extend and retract and now stays well above the floor. Reattached the trim that was pulled off from dragging on the floor. Put mattress back in place.			
Model#	Dlr Sub Hrs	1.75	Sub Labor Amt	\$332.50
Serial#	Appr Hrs	1.75	Appr Labor Amt	\$332.50
	Notes			
	nVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD			

Labor

Line# 2	Operation Code	Operational Description		
	30-100-24-00-001046	Cabinet Door - Interior/Cabinetry/Repair/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2026-04-02 10:18:25 :: Complaint: Cabinet door is misaligned			
	Cause: Out of adjustment Correction: Adjusted the doors under the sink to the left of the microwave/pantry			
Model#	Dlr Sub Hrs	0.40	Sub Labor Amt	\$76.00
Serial#	Appr Hrs	0.30	Appr Labor Amt	\$57.00
	Notes			
	nVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD			

Labor

Line# 3	Operation Code	Operational Description		
	30-102-01-00-001097	Seam Tape, per 8 ft. Strip - Interior/Panels, Ceilings, & Interior Moldings/Replace/ No Tread Code		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2026-04-02 10:20:33 :: Complaint: Seam tape is peeling off the wall in the laundry room Cause: Seam tape peeling Correction: Removed seam tape and replace with new seam tape			
Model#		Dlr Sub Hrs	0.20	Sub Labor Amt \$38.00

Serial# Appr Hrs 0.20 Appr Labor Amt \$38.00

Notes

nVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Labor

Line# 4

Operation Code

40-106-12-00-001320

Operational Description

Exterior Recept - Electrical/12 Volt Exterior/Resecure or Tighten/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-04-02 10:22:10 :: Complaint: Plug in basement fell off Cause: PPlug with back board fell off Correction: Moved the backer board over slightly and rescrewed it to the floor

Model# Dlr Sub Hrs 0.15 Sub Labor Amt \$28.50

Serial# Appr Hrs 0.10 Appr Labor Amt \$19.00

Notes

nVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Labor

Line# 5

Operation Code

30-102-24-00-001094

Operational Description

Wall Panel Touch up - Luan - Interior/Panels, Ceilings, & Interior Moldings/Repair/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-04-02 10:23:51 :: Complaint: Dime size hole in the paneling Cause: Hole in panel Correction: Fill hole with silicone, ran seam tape from floor to ceiling to cover the hole

Model# Dlr Sub Hrs 0.20 Sub Labor Amt \$38.00

Serial# Appr Hrs 0.20 Appr Labor Amt \$38.00

Notes

Labor

Line# 6

Operation Code

30-100-01-00-001035

Operational Description

Cabinet Door - Interior/Cabinetry/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-04-02 10:25:32 :: Complaint: Upper cabinet door is warped Cause: Door is warped Correction: Recommend replacement of door

Model# Dlr Sub Hrs 0.40 Sub Labor Amt \$76.00

Serial# Appr Hrs 0.40 Appr Labor Amt \$76.00

Notes

nVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Labor

Line# 7

Operation Code

20-73-01-00-000739

Operational Description

Fenderskirt - Exterior/Fender Skirts, Wheel Well/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-04-02 10:29:32 :: Complaint: Fenderskirt has deep scratches Cause: Happened during transport, reported on delivery Correction: Replace fenderskirt

Model# Dlr Sub Hrs 0.30 Sub Labor Amt \$57.00

Serial# Appr Hrs 0.30 Appr Labor Amt \$57.00

Notes

Labor

Line# 8

Operation Code

20-58-01-00-000813

Operational Description

Lower Radius Metal, per piece - Exterior/Metal, Aluminum Siding/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-04-02 10:30:49 :: Complaint: Jwrap has a hole in it Cause: Happened during transport, reported on delivery Correction: Replace 15 feet of j-wrap on passenger living slide

Model# Dlr Sub Hrs 0.50 Sub Labor Amt \$95.00

Serial# Appr Hrs 0.50 Appr Labor Amt \$95.00

Notes

nVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Labor

Line# 9

Operation Code	Operational Description
30-101-24-00-001074	Interior Door Jamb, U-Channel, Casing, Frame - Interior/Interior Doors/Repair/No Tread Code

Complaint, Cause, Correction
Original Note : stephanie@dealer-advisors.com, 2026-04-02 10:32:54 :: Complaint: Door will open past the stop trim Cause: Door jamb is not square Correction: Added shims under the jamb, got the jamb square so the door will close properly. Puttied all staple holes and nail holes.

Model#	Dlr Sub Hrs	0.30	Sub Labor Amt	\$57.00
Serial#	Appr Hrs	0.30	Appr Labor Amt	\$57.00

Notes
nVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Labor

Line# 10

Operation Code	Operational Description
30-100-01-00-001035	Cabinet Door - Interior/Cabinetry/Replace/No Tread Code

Complaint, Cause, Correction
Original Note : stephanie@dealer-advisors.com, 2026-04-02 10:34:19 :: Complaint: Glass tray from microwave fell during transit Cause: Tray fell and damaged cabinet door Correction: Replace whole cabinet door

Model#	Dlr Sub Hrs	0.40	Sub Labor Amt	\$76.00
Serial#	Appr Hrs	0.40	Appr Labor Amt	\$76.00

Notes
nVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Labor

Line# 11

Operation Code	Operational Description
40-106-01-11-001248	12 Volt In-Line Circuit Breaker or Fuse - Electrical/12 Volt Exterior/Replace/ Electrical

Complaint, Cause, Correction
Original Note : stephanie@dealer-advisors.com, 2026-04-02 10:35:37 :: Complaint: Couch slide is blowing fuses on retract Cause: Ran the slide in and out several times and could not replicate Correction: Had to replace the fuses in order to attempt diag

Model#	Dlr Sub Hrs	0.35	Sub Labor Amt	\$66.50
Serial#	Appr Hrs	0.20	Appr Labor Amt	\$38.00

Notes
nVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Labor

Line# 12

Operation Code	Operational Description
70-179-01-00-001257	Burner Grates - Appliances/Cooktop (Dometic)/Replace/No Tread Code

Complaint, Cause, Correction
Original Note : stephanie@dealer-advisors.com, 2026-04-02 10:39:20 :: Complaint: Range hood fell off during transit and broke the grate for the stove top. actual top next to the burner is damaged too Cause: Range hood not installed properly/too loose Correction: Will need to replace the damaged parts

Model#	123	Dlr Sub Hrs	0.50	Sub Labor Amt	\$95.00
Serial#	abc	Appr Hrs	0.50	Appr Labor Amt	\$95.00

Notes
nVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD

Submitted

Labor Amt	\$1,035.50
Parts & Freight	\$0.00
Total	\$1,035.50

Approved

Labor Amt	\$978.50
Parts & Freight	\$0.00
Total	\$978.50

DEALER

DATE

CUSTOMER

DATE

SIGNATURE

I certify that I have performed these repairs consistent with Forest River Policies.

SIGNATURE

All repairs described have been inspected and are satisfactory.