



12024 Central Ave SE ★ Albuquerque NM 87123
 www.MYERSRV.com
 (505)298-7691 ★ 1-800-748-2078 ★ FAX (505)293-7172

W/O: 72442
 Promised Date:
 17 OCT 25



WO #: 72442 (Appointment Date: 03 OCT 2025 - Time: 11:15am)
 Customer Name: 59318 - MONTES DE OCA, LYDIA B
 Completed Date: 30 JAN 26
 Invoice#: Author: BRIAN
 Stock Desc: 9434 2025 OPEN RANGE 22MLS
 Serial#: 58TBM0BM5S7543055 Date In: 03 OCT 25
 Chassis#: 58TBM0BM5S7543055 Time In:
 Miles/Hrs:
 Tag#: 6799
 Purchased Date: 21 APR 25
 Warranty Date: 21 APR 25

Job #0 - External

CLAIMS:
 J01459531/J01485954/J01459527

Labor

Job #	Description	Total
0	DIAGNOSIS	N/C
Subtotal for Job #0:		0.00

Job #1 - Internal

COMPLAINT: CUSTOMER STATES REFER MAKES A LOUD NOISE WHEN TURNED ON

CAUSE: Customer complaint refrigerator makes a loud noise when turned on

CORRECTION: Had the unit parked in bay 2
 Plugged unit into shore power
 Opened the slide room
 Turned the refrigerator on and closed the door
 The refrigerator never made any kind of noise at all during the jobs done on the work order
 Could not replicate

Labor

Job #	Description	Total
1	REFRIGERATOR DIAGNOSTIC TIME	N/C
Subtotal for Job #1:		0.00

Job #2 - Warranty

COMPLAINT: CUSTOMER STATES 3 BLINDS WILL NOT STAY UP (TWO IN BEDROOM AND ONE IN KITCHEN)

CAUSE: Kitchen blind tension cord loose
 Left bedroom blind pulled away from the wall
 Right bedroom blind tension string loose

CORRECTION: Found the kitchen blind had a loose tension cord
 Adjusted the tension on the cords blind now stays up
 Found the left side bedroom window blind and decor cover was pulled off the wall and a screw missing
 Removed on screw set the decor cover and blind aside added screws to both sides supports set the blind

Customer #: 59318
 MONTES DE OCA, LYDIA B



and window trim back in place and screwed back to the supports.
Then found the tension cords were loose.
Adjusted the tension cords blind now stays up and is attached to the wall.
Found the right side bedroom blind had loosed tension cords
Adjusted the tension on the cords blinds now stay up
Work completed
.30HRS

Labor		
Job #	Description	Total
2	WINDOW SHADE DIAGNOSE	143.20
Subtotal for Job #2:		143.20

Job #3 - Warranty

COMPLAINT: CUSTOMER STATES TRIM ON THE SHOWER SURROUND LOOSE (SINK SIDE)

CAUSE: Trim came loose staples pulled out

CORRECTION: Found the bottom half of the shower trim pulled away from the wall restapled the trim back down and puttied the new staple holes
Trim secure work completed
.10HRS

Labor		
Job #	Description	Total
3	TRIM	179.00
Subtotal for Job #3:		179.00

Job #4 - Internal

COMPLAINT: CUSTOMER STATES TWO BOTTOM KITCHEN DRAWERS ARE BINDING

CAUSE: Drawers sticking hard to open fully hanging up in the middle

CORRECTION: Found the bottom drawer the guides were very dirty and needed to be lubricated
Found the middle drawer guides were also dirty and needed to be lubricated
Also found the drawer was sticking very hard about half way out
Once the rails were cleaned and lubricated the drawers work correctly
.20HRS

Labor		
Job #	Description	Total
4	DRAWERS	N/C
Subtotal for Job #4:		0.00

Job #5 - Internal

COMPLAINT: CUSTOMER STATES WHEN CLOSING RECLINER (TOWARD BEDSIDE) BINDS

CAUSE: Customer complaint the recliner close to the bed binds

CORRECTION: Sat in the recliner and ran out and in 5 times in a row
The recliner moved in and out smoothly
Could not replicate

Labor		
Job #	Description	Total
5	RECLINER	N/C
Subtotal for Job #5:		0.00

Job #6 - Warranty

COMPLAINT: CUSTOMER STATES UNDERBELLY TAPE LOOSE





CAUSE: Tape over a hole in the underbelly coming off

CORRECTION: Cut the loose tape off
 Foam filled the hole
 Work completed
 .30HRS

Labor				
Job #	Description			Total
6	UNDERBELLY			179.00
Parts				
Part #	Description	Qty	Price	Total
17150	SPRAY FOAM, GREAT STUFF (BLACK)	1.00	14.70	14.70
Subtotal for Job #6:				193.70

Job #7 - Warranty

COMPLAINT: CUSTOMER STATES HOOD LIGHT INOPERATIVE

CAUSE: Light has broken wire

CORRECTION: Recommend replacement of the light
 Found the red wire which is soldered to the inside of the light has broken
 To diagnose the issue with the light the set screw had to be removed , the cover for the fan and light switch had to be removed taking 3 screws out . Then the wiring could be moved around to get to the quick disconnect. This is when the red wire was found to be broken off inside the light. The light was put back in place until the new light arrived.
 The new light install required the removal of the set screw unplugging the light. Plugging in the new light putting the light in place and putting the set screw back. Work completed

Labor				
Job #	Description			Total
7	HOOD LIGHT			17.90
Parts				
Part #	Description	Qty	Price	Total
2065685	LIGHT, LED RANGEHOOD INVISION	1.00	12.58	12.58
Subtotal for Job #7:				30.48

Job #8 - Internal

COMPLAINT: CUSTOMER STATES CHECK OVEN
 1. OVEN LIGHT STAYS ON THROUGH COOKING TIME
 2. FLAME FLICKERRS WHILE COOKING

CAUSE: Customer complaint light stays on while oven is in use
 Flames flicker

CORRECTION: Turned on the propane
 Turned the oven on the light is automatic on
 Lite the pilot light set the temp to 350
 Oven heated up quickly to 350 and maintained this temp for 30 minutes
 The flame flicker was the flame coming on and off to maintain temperature
 There not a switch on the oven to turn the light on and off it is a built in feature
 The burner flame was good blue and even
 Oven is operating correctly

Labor			
Job #	Description		Total
8	OVEN DIAGNOSE		N/C



Subtotal for Job #8: 0.00

W/O: 72442
Promised Date: 17 OCT 25



Job #9 - Warranty

COMPLAINT: CUSTOMER STATES BATHROOM DOOR FELL IN TRANSIT / REINSTALLED BUT DOOR DAMAGED AND LATCH LOOSE

CAUSE: Door fell off in transit
Door has no bottom guide

CORRECTION: Recommend full replacement of the door
Door size 25 1/2 inches x 73 inches
Need wall mount bottom door guide
To replace the door will require the removal of the top decor trim
Unlocking the roller locks and removing the door
Installing bottom door guide
Installing door lock on the door
Installing and locking the door back to the rollers and adjusting for proper closing and opening.
Reinstalling decor trim
Requesting 1 hour

Labor

Job #	Description	Total
9	DOOR	143.20

Parts

Part #	Description	Qty	Price	Total
2056141	DOOR, INTERIOR MAPLE 25" X 73" X 1.38" - PRE DRILLED	1.00	124.77	124.77

Subtotal for Job #9: 267.97

Parts Total: 152.05
Labour Total: 662.30
Sublet Total: 0.00
Extras Total: 0.00
WORK ORDER TOTAL: 814.35

Customer #: 59318
MONTES DE OCA, LYDIA B



NOTICE:
DUE TO A LACK OF SPACE, A \$15/DAY STORAGE FEE WILL APPLY IF YOU DO NOT PICK UP YOUR UNIT WITHIN 48 HOURS OF NOTICE OF COMPLETION

EFFECTIVE 01/12/2026 A CREDIT CARD SURCHARGE OF 3% WILL BE APPLIED TO ALL CREDIT CARD TRANSACTIONS

MANUFACTURER'S WARRANTIES AND SERVICE CONTRACTS DO NOT COVER DIAGNOSTIC TIME IF NO PROBLEM IS FOUND

ALTHOUGH WE TAKE PRECAUTIONS TO INSURE YOUR VEHICLE'S SECURITY WHILE IN FOR REPAIRS, WE ARE NOT RESPONSIBLE FOR ANY LOSS OR DAMAGE TO THE VEHICLE OR CONTENTS DUE TO FIRE, THEFT, OR ANY OTHER CAUSE BEYOND OUR CONTROL. WE WOULD APPRECIATE YOUR ASSISTANCE BY REMOVING OR SECURING YOUR VALUABLES SUCH AS GUNS, CAMERAS, JEWELRY, CASH, ETC.

I hereby authorize Myers RV Center, Inc. to perform the repair work set forth in this work order, including the parts and materials necessary. I agree that you are not responsible for delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets and highways for the purpose of testing, inspection or transporting to sublet vendors. An express mechanics lien is hereby acknowledged on the herein described vehicle to secure the payment for repairs performed.

Customer Signature : _____

Date: 30 Jan 2026

