

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0008794	CLAIM STATUS	Authorized
MYERS RV CENTER INC		CLAIM	2597580
12024 CENTRAL AVE S.E.		CLAIM ORIGIN	WEB
ALBUQUERQUE, NM 87123		ORIGINAL CLAIM ID	
USA		VIN	5ZT2CXSB0RS047066
		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$190.00	SITE/WAREHOUSE	220 / 220A
OWNER INFORMATION		ITEM #	APTT265RBSS
VAL ARMSTRONG		DEALER RO #	72271
54 JASON RD		CLAIM START DATE	03/03/2026
Los Lunas, NM 87031		CLAIM END DATE	01/01/1900
USA			
Retail Date of Purchase	10/11/2024	WARRANTY EXPIRATION DATE	10/11/2025

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description		
	60-141-24-00-001602	Fiberglass Tub, Shower Surround - Plumbing/Shower, Tub Surround/Repair/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2026-03-03 14:22:22 :: This is from expired PA 2416089 Customer states shower leaks on floor while in use, Water damage on paneling and slide fascia. Shower door base not sealed. The silicone that was in the front of the door openings pulled away. Hooked up water to the unit. Opened access panel at the base of the shower and on the cabinet next to the shower. Turned the water on using a light and checked all plumbing for leaks. Checked the shower drain connections and water lines. Followed drain pipe from under the shower until it turned and went into the floor. No leaks detected. Inspected the shower door base, found there was some silicone in the area of the doors but nowhere else. Looking at the existing silicone and found it had separated from the shower door base. Replace the access. Scrapped away the old silicone, cleaned the edges, used white silicone and sealed the whole base on the inside of the shower. In the front or outside and sealed this also. Will need to order 3 full length batten strups, door jamb 4x78 to replace those that were damaged by water. Allow the silicone to set over the weekend. hook up city water to the unit and sprayed the walls and shower door with water, found that water was seeping out between the glass and the base that holds the glass in place. Also found water was leaking in the right bottom corner between the wall and shower pan. Added screws to secure the wall and silicone the base at the wall all the way around. Also silicone the bottom of the glass on both sides once the silicone sets will retested. Retest, no leaks.			
Model#	Dlr Sub Hrs	1.00	Sub Labor Amt	\$190.00
Serial#	Appr Hrs	1.00	Appr Labor Amt	\$190.00
	Notes			

Labor

Line# 2	Operation Code	Operational Description		
	20-78-01-00-000801	Lippert Awning Outer Arm - Exterior/Awnings (Lippert)/Replace/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2026-03-03 14:24:14 :: This is from expired PA 2416089 Customer states awning is missing caps and arm is cracked. Top caps are broken and front half is missing. Order new top.			
Model#	Dlr Sub Hrs	0.30	Sub Labor Amt	\$57.00
Serial#	Appr Hrs	0.30	Appr Labor Amt	\$57.00
	Notes			

Submitted	Labor Amt	\$247.00	Approved	Labor Amt	\$247.00
	Parts & Freight	\$0.00		Parts & Freight	\$0.00
	Total	\$247.00		Total	\$247.00

DEALER **DATE**
SIGNATURE

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER **DATE**
SIGNATURE

All repairs described have been inspected and are satisfactory.