

# FOREST RIVER WARRANTY CLAIM FORM

<b>DEALER ACCOUNT #</b>	0008794	<b>CLAIM STATUS</b>	Expired
<b>MYERS RV CENTER INC</b>		<b>CLAIM</b>	2416089
12024 CENTRAL AVE S.E.		<b>CLAIM ORIGIN</b>	WEB
ALBUQUERQUE, NM 87123		<b>ORIGINAL CLAIM ID</b>	
USA		<b>VIN</b>	5ZT2CXSB0RS047066
		<b>CHASSIS VIN</b>	
		<b>MILEAGE</b>	0
<b>Labor rate:</b>	\$190.00	<b>SITE/WAREHOUSE</b>	220 / 220A
<b>OWNER INFORMATION</b>		<b>ITEM #</b>	APTT265RBSS
VAL ARMSTRONG		<b>DEALER RO #</b>	72032
54 JASON RD		<b>CLAIM START DATE</b>	08/27/2025
Los Lunas, NM 87031		<b>CLAIM END DATE</b>	01/01/1900
USA			
<b>Retail Date of Purchase</b>	10/11/2024	<b>WARRANTY EXPIRATION DATE</b>	10/11/2025

## Claim Line Details

### Labor

<b>Line# 1</b>	<b>Operation Code</b>	<b>Operational Description</b>		
	60-141-24-00-001602	Fiberglass Tub, Shower Surround - Plumbing/Shower, Tub Surround/Repair/No Tread Code		
	<b>Complaint, Cause, Correction</b>			
	Original Note : s.caffrey@myersrv.com, 2025-08-27 10:09:45 :: CUSTOMER STATES SHOWER LEAKS ON FLOOR WHILE IN USE / WATER DAMAGE ON PANELING AND SLIDE FACIA / Shower door base not sealed the silicone that was in the front of the door openings pulled away / Hooked up water to the unit Opened access panel at the base of the shower and on the cabinet next to the shower Turned the water on using a light and checked all plumbing for leaks. Checked the shower drain connections and water lines . Followed the drain pipe from under the shower until it turned and went into the floor. No leaks detected Inspected the shower door base found there was some silicone in the area of the doors but no where else . Looking at the existing silicone and found it had separated from the shower door base Replaced the access Scraped away the old silicone, cleaned the edges used white silicone and sealed the whole base on the inside of the shower. In the front or outside and sealed this also Job is complete Will need to order 3 full length batten strips , door jam 4x78 to replace those that were damaged by water Allowed the silicone to set over the weekend . Hooked up city water to the unit.sprayed the walls and shower door with water Found that water was seeping out between the glass and the base that hods the glass in place. Also found water was leaking in the right bottom corner between the wall and shower pan. Added screws to secure the wall and siliconed the base at the wall all the way around Also siliconed the bottom of the glass on both sides Once the silicone sets will retest Retested no leaks detected			
<b>Model#</b>	<b>Dlr Sub Hrs</b>	2.00	<b>Sub Labor Amt</b> \$380.00	
<b>Serial#</b>	<b>Appr Hrs</b>	1.00	<b>Appr Labor Amt</b> \$190.00	
	<b>Notes</b>			

### Labor

<b>Line# 7</b>	<b>Operation Code</b>	<b>Operational Description</b>		
	20-78-01-00-000801	Lippert Awning Outer Arm - Exterior/Awnings (Lippert)/Replace/No Tread Code		
	<b>Complaint, Cause, Correction</b>			
	Original Note : s.caffrey@myersrv.com, 2025-08-27 10:26:40 :: CUSTOMER STATES AWNING MISSING CAPS AND ARM CRACKED / Top caps broken and front half missing / See attached pictures need to order new top caps and replace			
<b>Model#</b>	WILL	<b>Dlr Sub Hrs</b>	0.30	<b>Sub Labor Amt</b> \$57.00
<b>Serial#</b>	GET	<b>Appr Hrs</b>	0.30	<b>Appr Labor Amt</b> \$57.00
	<b>Notes</b>			

<b>Submitted</b>	<b>Labor Amt</b>	\$437.00	<b>Approved</b>	<b>Labor Amt</b>	\$247.00
	<b>Parts &amp; Freight</b>	\$0.00		<b>Parts &amp; Freight</b>	\$0.00
	<b>Total</b>	\$437.00		<b>Total</b>	\$247.00

---

**DEALER** **DATE**  
**SIGNATURE**

I certify that I have performed these repairs consistent with Forest River Policies.

---

**CUSTOMER** **DATE**  
**SIGNATURE**

All repairs described have been inspected and are satisfactory.