



12024 Central Ave SE ★ Albuquerque NM 87123  
 www.MYERSRV.com  
 (505)298-7691 ★ 1-800-748-2078 ★ FAX (505)293-7172

W/O: 72260-1  
 Promised Date:  
 17 JAN 26



WO #: 72260-1

Customer Name: 1000 - MYERS "RV"  
 CENTER, INC.

Completed Date:  
 Invoice#:  
 Author: ADVISOR  
 Stock Desc: 9605 2026 OPEN RANGE  
 COLT 26DBS  
 Serial#: 6X3088  
 Chassis#: 58TBM0BP7T76X3088  
 Miles/Hrs:  
 Tag#:  
 Purchased Date:  
 Warranty Date:

Date In: 17 JAN 26

Time In:

**Job #1 - Warranty**

COMPLAINT: A/c flap on living room ceiling unit will not stay open

CAUSE: Plastic catch tabs not set far enough into plastic cog wheel to allow full engagement which in turn caused flap to close.

CORRECTION: Removed ceiling assembly. Removed catch tabs. Oblonged each screw hole to allow forward engagement of catch tab. Reinstalled and tested function of ceiling assembly. Completed.  
 Asking for .50hr

**Labor**

Job #	Description	Total
1	AIR CONDITIONER FLAPS	N/C
<b>Subtotal for Job #1:</b>		<b>0.00</b>

**Job #2 - Warranty**

COMPLAINT: Bed frame not secure

CAUSE: Panel detached

CORRECTION: Resecured with 4 fasteners into structure. Completed  
 Asking .20hr

**Labor**

Job #	Description	Total
2	BED FRAME panel	N/C
<b>Subtotal for Job #2:</b>		<b>0.00</b>

**Job #3 - Warranty**

COMPLAINT: Thermostat face will not stay on

CAUSE: Lower locking tab on wall mount missing foot to allow for secure fit.

CORRECTION: Replace thermostat wall housing. Rewire after install.  
 Asking .30 hr

**Labor**

Job #	Description	Total
3	AUTO T-STAT	N/C

Customer #: 1000  
 MYERS "RV" CENTER,  
 INC.,



W/O: 72260-1  
Promised Date: 27 JAN 26



Customer #: 1000  
MYERS "RV" CENTER,  
INC.,



Subtotal for Job #3: 0.00

**Job #4 - Warranty**

COMPLAINT: Bedroom sliding door frame detaching

CAUSE: Adhesion failure

CORRECTION: Removed old adhesive. Reapplied silicone to frame. Installed plastic door frame fascia and secured with fasteners. Completed Asking .30 hr

Labor		
Job #	Description	Total
4	SLIDING DOOR - INTERIOR	N/C

Subtotal for Job #4: 0.00

**Job #5 - Warranty**

COMPLAINT: Front cap l.e.d light detaching

CAUSE: Adhesion failure between backer of l.e.d strip and adhesive. L.e.d housing has warped.

CORRECTION: Replace l.e.d strip and adhesive. 93 wide/long Asking 1.0 hr for repair Part needs to be ordered

Labor		
Job #	Description	Total
5	FRONT CAP LIGHT	N/C

Subtotal for Job #5: 0.00

Parts Total:	0.00
Labour Total:	0.00
Sublet Total:	0.00
Extras Total:	0.00
<b>WORK ORDER TOTAL:</b>	<b>0.00</b>

NOTICE:  
DUE TO A LACK OF SPACE, A \$15/DAY STORAGE FEE WILL APPLY IF YOU DO NOT PICK UP YOUR UNIT WITHIN 48 HOURS OF NOTICE OF COMPLETION

EFFECTIVE 01/12/2026 A CREDIT CARD SURCHARGE OF 3% WILL BE APPLIED TO ALL CREDIT CARD TRANSACTIONS

\*\*MANUFACTURER'S WARRANTIES AND SERVICE CONTRACTS DO NOT COVER DIAGNOSTIC TIME IF NO PROBLEM IS FOUND\*\*

ALTHOUGH WE TAKE PRECAUTIONS TO INSURE YOUR VEHICLE'S SECURITY WHILE IN FOR REPAIRS, WE ARE NOT RESPONSIBLE FOR ANY LOSS OR DAMAGE TO THE VEHICLE OR CONTENTS DUE TO FIRE, THEFT, OR ANY OTHER CAUSE BEYOND OUR CONTROL. WE WOULD APPRECIATE YOUR ASSISTANCE BY REMOVING OR SECURING YOUR VALUABLES SUCH AS GUNS, CAMERAS, JEWELRY, CASH, ETC.

I hereby authorize Myers RV Center, Inc. to perform the repair work set forth in this work order, including the parts and materials necessary. I agree that you are not responsible for delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets and highways for the purpose of testing, inspection or transporting to sublet vendors. An express mechanics lien is hereby acknowledged on the herein described vehicle to secure the payment for repairs performed.

Customer Signature : \_\_\_\_\_

Date: 17 Jan 2026

