



12024 Central Ave SE ★ Albuquerque NM 87123
www.MYERSRV.com
(505)298-7691 ★ 1-800-748-2078 ★ FAX (505)293-7172

W/O: 72342
Promised Date:
13 FEB 26



WO #: 72342 (Appointment Date: 09 SEP 2025 - Time: 10:15am)
Customer Name: 60565 - MANUEL, PAULA V
Completed Date: 25 FEB 26
Invoice#:
Author: BRIAN
Stock Desc: 9547 2026 TRACER 255DS
Serial#: 5ZT2TRRB0TB526225
Chassis#: 5ZT2TRRB0TB526225 Date In: 09 SEP 25
Miles/Hrs: Time In:
Tag#: 6980
Purchased Date: 23 AUG 25
Warranty Date: 23 AUG 25

Job #1 - Internal

COMPLAINT: CUSTOMER WOULD LIKE THE STOCK NUMBER REMOVED FROM THE TONGUE JACK - A-FRAME

CAUSE: Stock numbers on A frame

CORRECTION: Removed numbers. Job complete

Labor

Job #	Description	Total
1	REMOVE STOCK # A-FRAME	N/C
Subtotal for Job #1:		0.00

Job #2 - Internal

COMPLAINT: CUSTOMER STATES WHEN YOU FLUSH THE TOLIET WATER COMES OUT THE FRONT OF THE BOWL EVEN ON LOW WATER PRESSURE

CAUSE: 1 of 3 flushes the water runs out of the toilet bowl.

CORRECTION: Working as designed. Up to manufacture for solution.

Labor

Job #	Description	Total
2	TOILET BOWL	N/C
Subtotal for Job #2:		0.00

Job #3 - Warranty

COMPLAINT: CUSTOMER STATES THE PANEL UNDER THE BATHROOM SINK IS NOT SECURED

CAUSE: Panel is coming loose due to faulty staples.

CORRECTION: Removed and added new staples to secure panel. Job complete
.20HRS

Labor

Job #	Description	Total
3	PANEL, INTERIOR	38.00

Customer #: 60565
MANUEL, PAULA V



Subtotal for Job #3: 38.00

Job #4 - Warranty

COMPLAINT: CUSTOMER STATES THE METAL BLIND OVER THE OVEN DOES NOT HAVE AN ADJUSTMENT ROD

CAUSE: Blind rod missing.

CORRECTION: Replaced blind rod. Job complete .10HRS

Labor

Job #	Description	Total
4	BLIND WAND	19.00

Parts

Part #	Description	Qty	Price	Total
20-1151	12" MINI BLIND WAND	1.00	2.83	2.83

Subtotal for Job #4: 21.83

Job #5 - Warranty

COMPLAINT: CUSTOMER STATES BOTH BEDROOM CLOSETS HAVE LIGHT COMING THRU ON THE BOTTOM

CAUSE: Light coming thru bottom caused by gaps in walls.

CORRECTION: Removed trim and added a silicone to seal gaps in wall. Reinstalled trims. Job complete 1.00HRS

Labor

Job #	Description	Total
5	CLOSET (2)	190.00

Subtotal for Job #5: 190.00

Job #6 - Warranty

COMPLAINT: JOB ADDED: WHEN ENTERING THE UNIT THE SEAL TO THE RIGHT OF THE SLIDE HAS LIGHT COMING IN

CAUSE: Seal halfway through bends up not laying flat as rest of seal. Slide seal not flipping out as designed

CORRECTION: Remove and replace slide seal. Part on order.
Began prep to remove old seal and found the seal sent was not the correct one
New photo taken
Hold for parts
Removed old seal pulling numerous staples
Installed new seal
Used screws every 2 feet under the bubble seal
Work completed

Labor

Job #	Description	Total
6	SLIDE OUT SEAL	190.00

Parts

Part #	Description	Qty	Price	Total
F100483995	SEAL, WIPE W/ TALL SINGLE BULB FLIP 'N SEAL 2"	8.00	2.42	19.36

Other Services

Code	Description	Qty	Price	Total
FRT	SHIPPING & HANDLING CHARGES	1.00	17.07	17.07

W/O: 72342
Promised Date: 13 FEB 26



Customer #: 60565
MANUEL, PAULA V



Subtotal for Job #6: 226.43

W/O: 72342
Promised Date: 13 FEB 26

Job #7 - Internal

COMPLAINT: JOB ADDED: THE WINDOW OVER THE COUCH THE LOCK IS REVERSED FROM THE OTHER LOCKS

CAUSE: Window latch cannot be reversed will not work.

CORRECTION: Window lock is working as intended. Job complete

Labor

Job #	Description	Total
7	WINDOW LATCHVLOCK	N/C

Subtotal for Job #7: 0.00

Job #8 - Warranty

COMPLAINT: JOB ADDED: AROUND THE BATHROOM DOOR THE STORAGE ROOM DOOR AND THE LOCKS THE MOLDING IS COMING OFF

CAUSE: Several areas of trim has covering coming off. Will need several sticks of trim to replace. Doors also will need to be replaced.new door handle.

Wall paper peeling off trim

Damaged laundry room door

Damaged bathroom door and door knob

CORRECTION: Remove and replace damaged trim with new trim. Parts on order.

Removed 4 pieces of batten trim between the bathroom door and the laundry room door floor and ceiling

Cut new pieces and nailed them in place, puttied the new nail holes

Trim work completed

Removed the laundry room door taking the screws out of the 3 hinges

Measurements taken and hinges removed from the damaged door and installed on the new door.

Reinstalled new door and door knob, found the striker plate was bent and the hole was not deep enough for the door to stay latched , straightened the striker plate cut the hole in the door jam deeper door closes and latches correctly.

Removed the bathroom door by taking the screws out of the 3 hinges

Measurements taken and hinges removed from the damaged door and installed on the new door , a new door knob was installed on the new door the door was checked for proper operation which it was working correctly

Work completed

Labor

Job #	Description	Total
8	MOLDING	285.00

Parts

Part #	Description	Qty	Price	Total
F100124396	DOOR KNOB, LEVER STYLE, MATTE BLACK	1.00	12.72	12.72
F100686065	DOOR, PASSAGE 22" X 74" - IZZY GRANITE	1.00	54.29	54.29
F100721936	DOOR, PASSAGE 23-7/8" X 74" - IZZY GRANITE	1.00	54.57	54.57

Subtotal for Job #8: 406.58

Job #9 - Warranty

COMPLAINT: JOB ADDED: THE MOLDING IN FRONT OF THE COUCH TO THE LEFT, ON THE FLOOR IS COMING OFF

CAUSE: Wall trim is peeling near couch.

See pictures

Trim on the slide room damaged and wall bulging



Customer #: 60565
MANUEL, PAULA V



CORRECTION: Remove and replace trim. Parts on order.
 This job was done on a separate job line to repair the wall and paneling which was related to the trim
 Work completed

Labor		
Job #	Description	Total
9	MOLDING R&R	38.00
Subtotal for Job #9:		38.00

Job #10 - Warranty

COMPLAINT: JOB ADDED: WHEN ENTERING THE UNIT, TO THE RIGHT OF THE COUCH THE PANEL IS CRACKED & SCRATCHED

CAUSE: Wall panel near couch is damaged has cracks. Order new panel piece.
 See pictures
 Large crack and scratch on the panel to the right of the couch in the slide room

CORRECTION: Remove couch to access panel remove all trim remove panel.cut new piece to proper size and install.Install all trim and move couch back into place.waiting on parts.
 Couch in the slide room had to be removed taking out 16 screws and 2 screws to remove the front kick plate
 All batten trim had to be removed
 Light switch and usb on the back of the panel had to be removed and disconnected, the usb the wires had to be cut
 The panel was removed and 100 nails and staples pulled
 New panel had to be removed from the shipping crate
 New panel was measured and cut to fit holes drilled for the light switch and usb charger.
 New panel was put in place and stapled down
 Front and rear battens were nailed in place
 White silicone was used along the ceiling to match the opposite side
 All new nail staple holes were puttied and cleaned
 Light switch reinstalled
 Usb wires were butt spliced back together and the usb was reinstalled
 Couch reinstalled
 Work completed

Labor		
Job #	Description	Total
10	PANEL, INTERIOR (PER SQ.FT), R & R	380.00

Parts				
Part #	Description	Qty	Price	Total
F100667385	WALL PANEL - SEAPINE MOONSHINE 1/8" X 48" X 96"	1.00	33.28	33.28

Other Services				
Code	Description	Qty	Price	Total
FRT	SHIPPING & HANDLING CHARGES	1.00	373.16	373.16
Subtotal for Job #10:				786.44

Job #11 - Warranty

COMPLAINT: JOB ADDED: THE BOTTOM DRAWER TO THE RIGHT OF THE STOVE WILL NOT STAY CLOSED

CAUSE: Drawer rails sre out of alignment does not close flush.
 See pictures

CORRECTION: Realigned drawer rails for proper operation. Job complete
 .20HRS



Labor		
Job #	Description	Total
11	CABINET DRAWER ADJUST	38.00
Subtotal for Job #11:		38.00

Job #12 - Internal

COMPLAINT: JOB ADDED: DRAIN TANKS & BLOW OUT LINES

CAUSE: Blow out lines and drain tanks.

CORRECTION: Blewed out lines and drained tanks.

Labor		
Job #	Description	Total
12	WINTERIZE RV - BASIC	N/C
Subtotal for Job #12:		0.00

Job #13 - Warranty

COMPLAINT: The left side of the slide room the wall at the base is bulged feels solid behind the panel. Recommend removal of the front and rear batten trims , cutting the white silicone at the top removal of the whole panel to diag what is causing the bulge and not allowing panel and batten to sit flush Repair the issue and reinstall panel , batten , and resilicone the top putty new nail and staple holes Request 1.5 hours

CAUSE: Left side of the slide room wall bulging at the bottom near the slide facia

CORRECTION: Found the wall bulging at the bottom left side of the slide room near the front facia
 Removed front and rear batten strips
 Removed slide trim facia/stile
 Found the paneling was glued to the wall
 From approx mid point near the floor trimmed off approx 1/4 inch of panel picked out the cut piece
 The paneling then laid down flat
 Nailed the stile back in place
 Reinstalled both battens strips
 Used white silicone along the ceiling and floor
 Puttied all new nail holes in both the stile and batten
 Reinstalled the couch
 QC by Jeanette and Brian
 Work completed
 1.20HRS

Labor		
Job #	Description	Total
13	REPAIR WALL	285.00
Subtotal for Job #13:		285.00

Parts Total:	177.05
Labour Total:	1,463.00
Sublet Total:	0.00
Extras Total:	390.23
WORK ORDER TOTAL:	2,030.28



NOTICE:
DUE TO A LACK OF SPACE, A \$15/DAY STORAGE FEE WILL APPLY IF YOU DO NOT PICK UP YOUR UNIT WITHIN 48 HOURS OF NOTICE OF COMPLETION

EFFECTIVE 01/12/2026 A CREDIT CARD SURCHARGE OF 3% WILL BE APPLIED TO ALL CREDIT CARD TRANSACTIONS

MANUFACTURER'S WARRANTIES AND SERVICE CONTRACTS DO NOT COVER DIAGNOSTIC TIME IF NO PROBLEM IS FOUND

ALTHOUGH WE TAKE PRECAUTIONS TO INSURE YOUR VEHICLE'S SECURITY WHILE IN FOR REPAIRS, WE ARE NOT RESPONSIBLE FOR ANY LOSS OR DAMAGE TO THE VEHICLE OR CONTENTS DUE TO FIRE, THEFT, OR ANY OTHER CAUSE BEYOND OUR CONTROL. WE WOULD APPRECIATE YOUR ASSISTANCE BY REMOVING OR SECURING YOUR VALUABLES SUCH AS GUNS, CAMERAS, JEWELRY, CASH, ETC.

I hereby authorize Myers RV Center, Inc. to perform the repair work set forth in this work order, including the parts and materials necessary. I agree that you are not responsible for delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets and highways for the purpose of testing, inspection or transporting to sublet vendors. An express mechanics lien is hereby acknowledged on the herein described vehicle to secure the payment for repairs performed.

Date: 25 Feb 2026

Customer Signature : _____

Customer Work Order

W/O: 72342
Promised Date: 13 FEB 26



Customer #: 60565
MANUEL, PAULA V

